

eta/DYNAFORM

Application Manual

An LS-DYNA Based Sheet Metal Forming
Simulation Solution Package

Version 5.5

Engineering Technology Associates, Inc.
1133 E. Maple Road, Suite 200
Troy, MI 48083

Tel: (248) 729-3010
Fax: (248) 729-3020
Email: support@eta.com

eta/DYNAFORM team
August 2006

Engineering Technology Associates, Inc. All rights reserved ©1998-2006.

FOREWORD

The concepts, methods, and examples presented in this text are for illustrative and educational purposes only, and are not intended to be exhaustive or to apply to any particular engineering problem or design.

This material is a compilation of data and figures from many sources.

Engineering Technology Associates, Inc. assumes no liability or responsibility to any person or company for direct or indirect damages resulting from the use of any information contained herein.

OVERVIEW

The eta/DYNAFORM software package consists of four programs. These programs represent the pre-processor, solver and post-processor. They are: eta/DYNAFORM, eta/Job Submit, eta/POST and eta/3DPlayer.

eta/DYNAFORM is the pre-processor portion of the software package. Sheet metal forming models are constructed using this software. It includes VDA and IGES translators for importing line data and a complete array of tools for altering or constructing line data and meshing it.

LS-DYNA is the software package's solver. eta/DYNAFORM has a complete LS-DYNA interface allowing the user to run LS-DYNA from eta/DYNAFORM.

eta/POST and eta/GRAPH are the post-processing portions of the package. These programs are used to post-process the LS-DYNA result files from the analysis. eta/POST creates contour, deformation, FLD, and stress plots and animations with the result files. eta/GRAPH contains functions for graphically interpreting the same results.



Figure 1: Components of eta/DYNAFORM solution package.

Each of the software components has its own manual which should be referenced for further information on running these programs. These manuals are:

eta/DYNAFORM Application Manual	A comprehensive training manual for using the eta/DYNAFORM software package for various applications.
eta/DYNAFORM User's Manual	A reference guide to the functions contained in the eta/DYNAFORM program (pre-processor).
LS-DYNA User's Manual	A reference guide to the LS-DYNA program (solver).
eta/POST User's Manual	A reference guide to the functions contained in the eta/POST program and eta/GRAPH program (post-processor).

INTRODUCTION

Welcome to the **eta/DYNAFORM version 5.5** Application Manual. The **eta/DYNAFORM version 5.5** is the unified version of the eta/DYNAFORM-PC and UNIX platforms. This manual is meant to give the user a basic understanding of finite element modeling for forming analysis, as well as displaying the forming results. It is by no means an exhaustive study of the simulation techniques and capabilities of **eta/DYNAFORM**. For more detailed study of **eta/DYNAFORM**, the user is urged to attend an **eta/DYNAFORM** training seminar.

This manual details a step-by-step sheet metal forming simulation process through Auto-Setup interface process. Users should take the time to learn setup process as each has inherent benefits and limitations.

The following table outlines the major differences of the traditional setup, the Quick Setup, and the Auto Setup procedure.

TRADITIONAL SETUP	QUICK SETUP	AUTO SETUP
Manual interface can duplicate any tooling configuration: pads, multiple tools, etc.	Automated interface limits flexibility	There are some inner templates that enables user to setup all kinds of operation.
Requires more setup time	Reduces modeling setup time	Reduces setup time and reduces the possibility of make mistake
Manual definition of travel curves	Automated travel curves	Automated travel curves and manual definition curve
Geometrical Offset and Contact Offset	Contact Offset	Both Contact Offset and Geometrical Offset

The exercises provided in the application manual are listed as the following:

1. Single Action Draw: single action/contact offset/copy elements.
2. Double Action Draw: double action/LCS/symmetry.
3. Tubular Hydroforming: hydroforming/working direction.
4. Gravity Loading: gravity loading.
5. Single Action Tailor Welded Blank: weld-forming/mesh physical offset/simple multi-stage.
6. Springback Analysis: springback.
7. Sheet Hydroforming: double action/hydro-forming/draw bead.

*Note: This manual is intended for the application of all **eta/DYNAFORM** platforms. Platform interfaces may vary slightly due to different operating system requirements. This may cause some minor visual discrepancies in the interface screen shots and your version of **eta/DYNAFORM** that should be ignored.*

TABLE OF CONTENTS

Example 1. Single Action	1
DATABASE MANIPULATION	2
Creating an eta/DYNAFORM Database and Analysis Setup.....	2
AUTO SETUP	4
I. New Simulation.....	4
II. General	6
III. Blank Definition.....	6
IV. Blank Material and Property Definition.....	9
V. Tools Definition.....	11
VI. Tools Positioning	20
VII. Process Definition	22
VIII. Animation.....	24
IX. Submit Job.....	26
POST PROCESSING (with eta/POST)	30
I. Reading the Results File into the Post Processor	30
II. Animating Deformation.....	32
III. Animating Deformation, Thickness and FLD.....	33
IV. Plotting Single Frames	36
V. Writing an AVI and E3D File.....	36
Example 2. Double Action.....	40
DATABASE MANIPULATION	41
Creating an eta/DYNAFORM Database and Analysis Setup.....	41
AUTO SETUP	45
I. New Simulation.....	45
II. General	46
III. Blank Definition.....	48


IV. Blank Material and Property Definition.....	50
V. Symmetry-plane Definition	52
VI. Tools Definition.....	54
VII. Tools Positioning.....	59
VIII. Process Definition	61
IX. Animation.....	64
X. Submit Job.....	66
POST PROCESSING (with eta/POST)	69
I. Reading the Results File into the Post Processor	69
II. Animating Deformation.....	71
III. Animating Deformation, Thickness and FLD.....	72
IV. Plotting Single Frames	75
V. Writing an AVI and E3D File.....	75
Example 3. Tubular Hydro-forming.....	78
DATABASE MANIPULATION	79
Creating an eta/DYNAFORM Database and Analysis Setup.....	79
AUTO SETUP.....	82
I. New Simulation.....	82
II. General	83
III. Tube Definition	83
IV. Tools Definition.....	87
V. Tools Positioning	94
VI. Process Definition	97
VII. Animation.....	100
VIII. Submit Job.....	102
POST PROCESSING (with eta/POST)	105
I. Reading the Results File into the Post Processor	105
II. Animating Deformation.....	107
III. Animating Deformation, Thickness and FLD.....	108

IV. Plotting Single Frames	110
V. Writing an AVI and E3D File.....	111
Example 4. Gravity Loading	114
DATABASE MANIPULATION	115
Creating an eta/DYNAFORM Database and Analysis Setup.....	115
AUTO SETUP.....	117
I. New Simulation.....	117
II. General.....	118
III. Blank Definition.....	119
IV. Blank Material and Property Definition.....	121
V. Tools Definition.....	123
VI. Tools Positioning.....	126
VII. Process Definition	129
VIII. Animation.....	130
IX. Submit Job.....	131
POST PROCESSING (with eta/POST).....	134
I. Reading the Results File into the Post Processor.....	134
II. Animating Deformation.....	136
III. Animating Deformation, Thickness and FLD.....	137
IV. Plotting Single Frames	138
V. Writing an AVI and E3D File.....	139
Example 5. Single Action - Tailor Welded Blank.....	142
DATABASE MANIPULATION	143
Creating an eta/DYNAFORM Database and Analysis Setup.....	143
MESHING.....	147
I. Blank Meshing	147
II. Surface Meshing.....	149
III. Mesh Checking.....	152

AUTO SETUP	157
I. New Simulation	157
II. General	158
III. Blank Definition	159
IV. Blank Material and Weld Definition	162
V. Tools Definition	168
VI. Tools Positioning	181
VII. Process Definition	184
VIII. Animation	188
IX. Submit Job	189
POST PROCESSING (with eta/POST)	193
Example 6. U-channel springback simulation	194
DATABASE MANIPULATION	195
Creating an eta/DYNAFORM Database and Analysis Setup	195
AUTO SETUP	198
I. Creation of a New Simulation	198
II. General	199
IV. Blank Material and Property Definition	200
V. Process Definition	201
VI. Submit Job	202
POST PROCESSING (with eta/POST)	204
I. Reading d3plot file into the Post Processor	204
II. Springback analysis	205
III. Summary	208
Example 7. Sheet Metal Hydro-forming	209
DATABASE MANIPULATION	210
Creating an eta/DYNAFORM Database and Analysis Setup	210
AUTO SETUP	212

I. New Simulation	212
II. General	213
III. Blank Definition	214
IV. Blank Material and Property Definition.....	217
V. Tool Definition	219
VI. Drawbead Definition	226
VII. Tools Positioning	230
VIII. Process Definition	233
IX. Animation.....	239
X. Submit Job.....	239
POST PROCESSING (with eta/POST)	242
MORE ABOUT eta/DYNAFORM 5.5.....	243
CONCLUSION	244

Example 1. Single Action

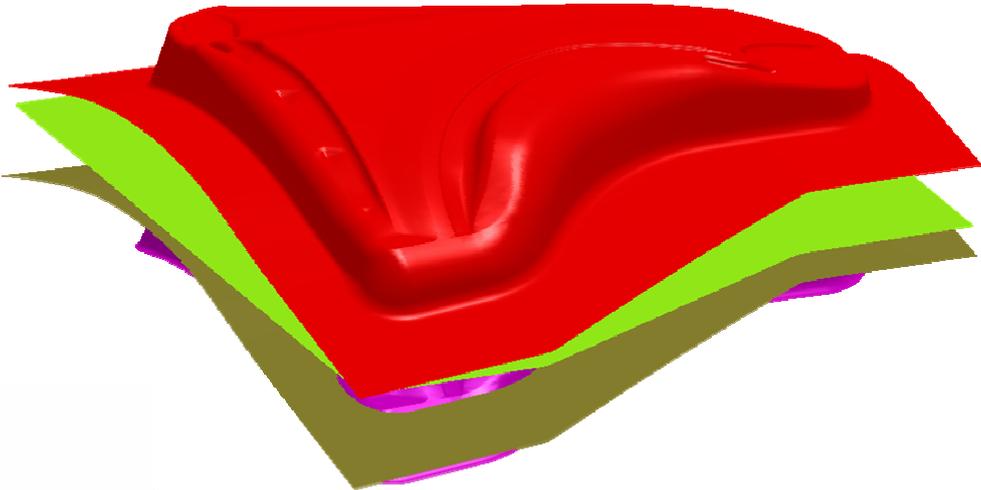

DATABASE MANIPULATION

Creating an eta/DYNAFORM Database and Analysis Setup

Start eta/DYNAFORM 5.5

For workstation/Linux users, enter the command “**df55**” (default) from a UNIX shell. For PC users, double click the **eta/DYNAFORM 5.5 (DF55)** icon from the desktop.

After starting **eta/DYNAFORM**, a default database **Untitled.df** is created.

The example only demonstrates the application of **AutoSetup**, hence you open the database that has been created.

Open the database

1. From the menu bar, select **File→Open...** to open the OPEN FILE dialog box, as illustrated in Figure 1.1.

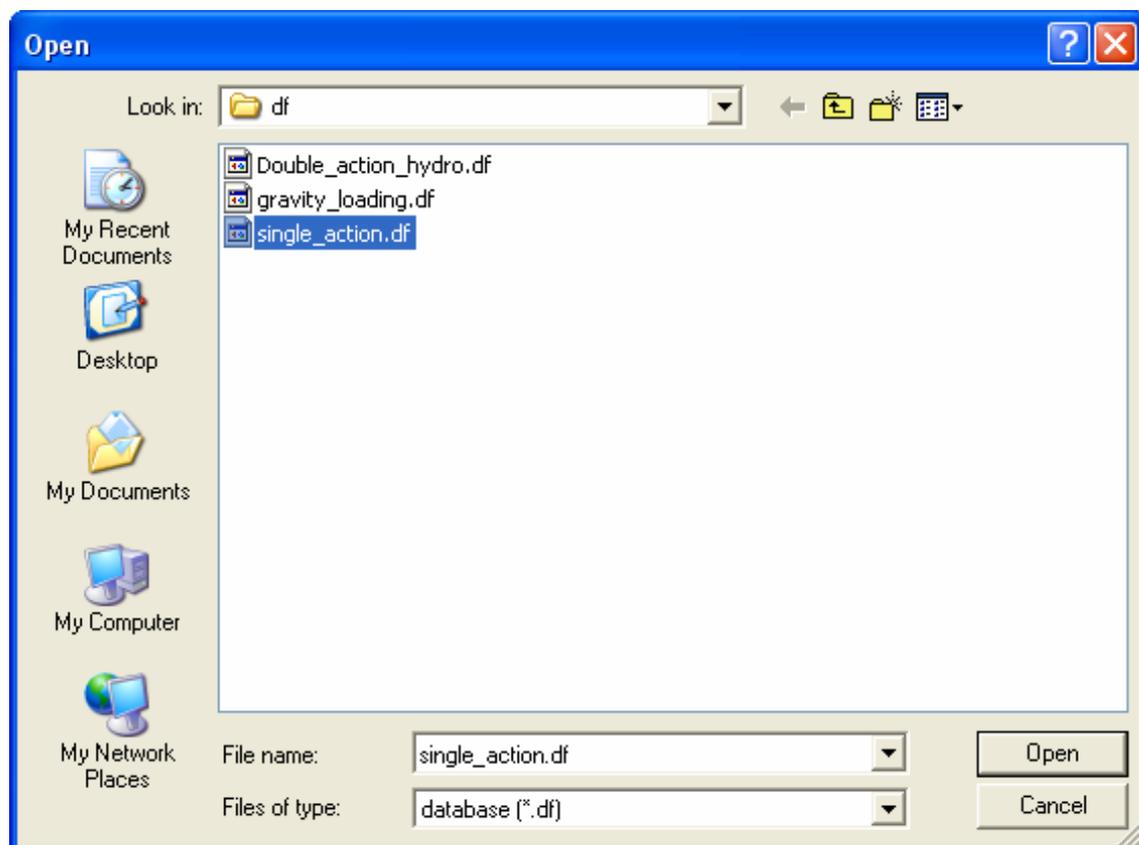


Figure 1.1 Open file dialog box

2. Go to the training input files located in the CD provided along with the eta/DYNAFORM installation, and open the data file named **single_action.df**. The parts, as illustrated in Figure 1.2, is displayed in isometric view on the display area.

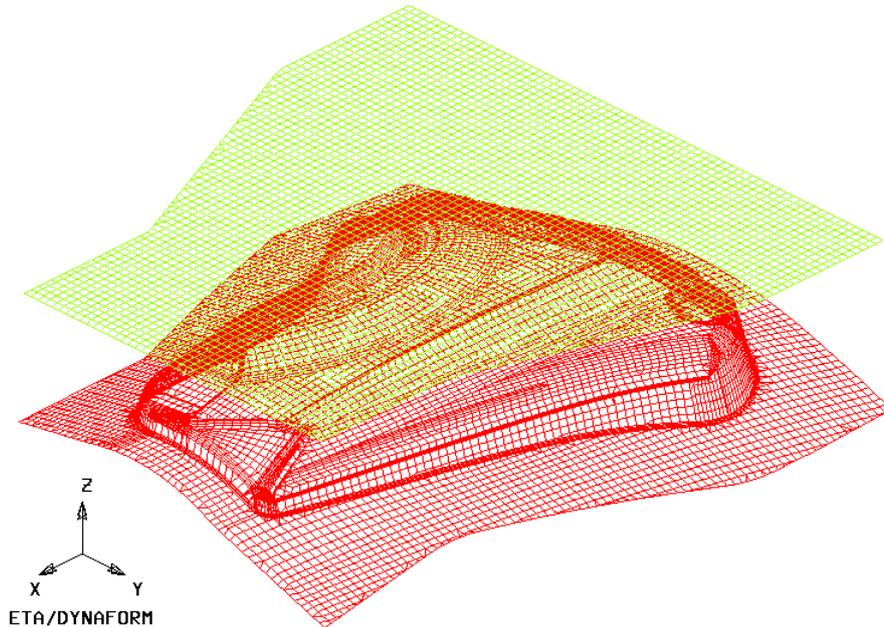


Figure 1.2 Illustration of fender model

***Note:** The Icons bar may appear different depending on type of platform. Other functions on the **Toolbar** are further discussed in next section. You can also refer to the **eta/DYNAFORM User's Manual** for information about the **Toolbar** functions.*

Database Unit

From the menu bar, select **Tools**→**Analysis Setup**. The default unit system for a new eta/DYNAFORM database is **mm, Newton, second, and Ton**.

AUTO SETUP

Prior to entering **AUTOSETUP** interface, upper/lower tool meshes are required. The other operation can be carried out in AutoSetup interface, such as **PHYSICAL OFFSET** of element, selection of **CONTACT OFFSET**. As illustrated in Figure 1.3, you can select **AUTOSETUP** option from the **SETUP** menu to display the **AUTOSETUP** interface.



Figure 1.3 AutoSetup menu

I. New Simulation

Click **AutoSetup** in the menu bar to display the **NEW SIMULATION** dialog box illustrated in Figure 1.4. You continue with defining basic parameters such as blank thickness, type of process, etc from the dialog box.


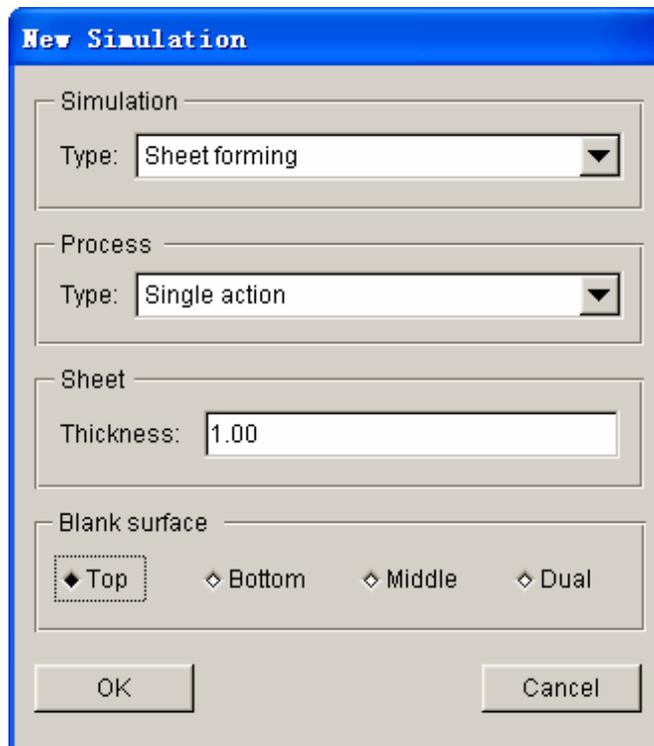



Figure 1.4 New simulation dialog box

1. Select simulation type: **Sheet forming**.
2. Select process type: **Single Action**.


- 3. Input blank thickness: 1.0 (mm).
- 4. Select tools reference: **Top**. See Figure 1.5a.
- 5. Click **OK** to display the main **AutoSetup** interface.

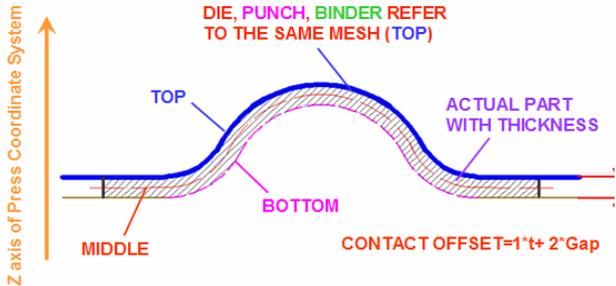


a) Top surface of part

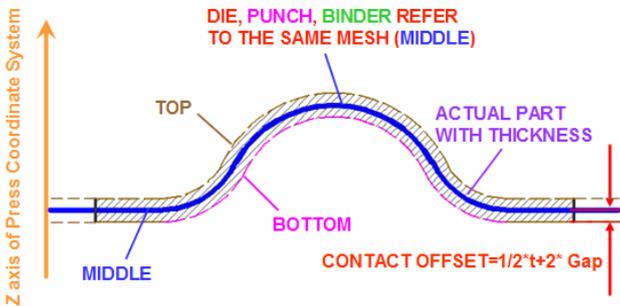

b) Middle surface of part

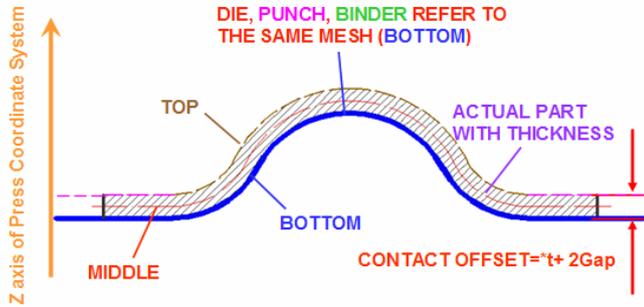

c) Bottom surface of part

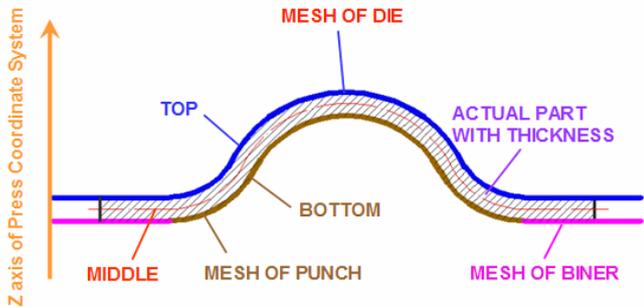

d) Different surface referred by Die and Punch

Figure 1.5 Tools reference surface

II. General

After entering **General** interface, you do not need to modify any parameters except for changing the **Title** into **single_action**. In addition, you can type in some comments about the setting/process in the **Comment** input field illustrated in Figure 1.6.

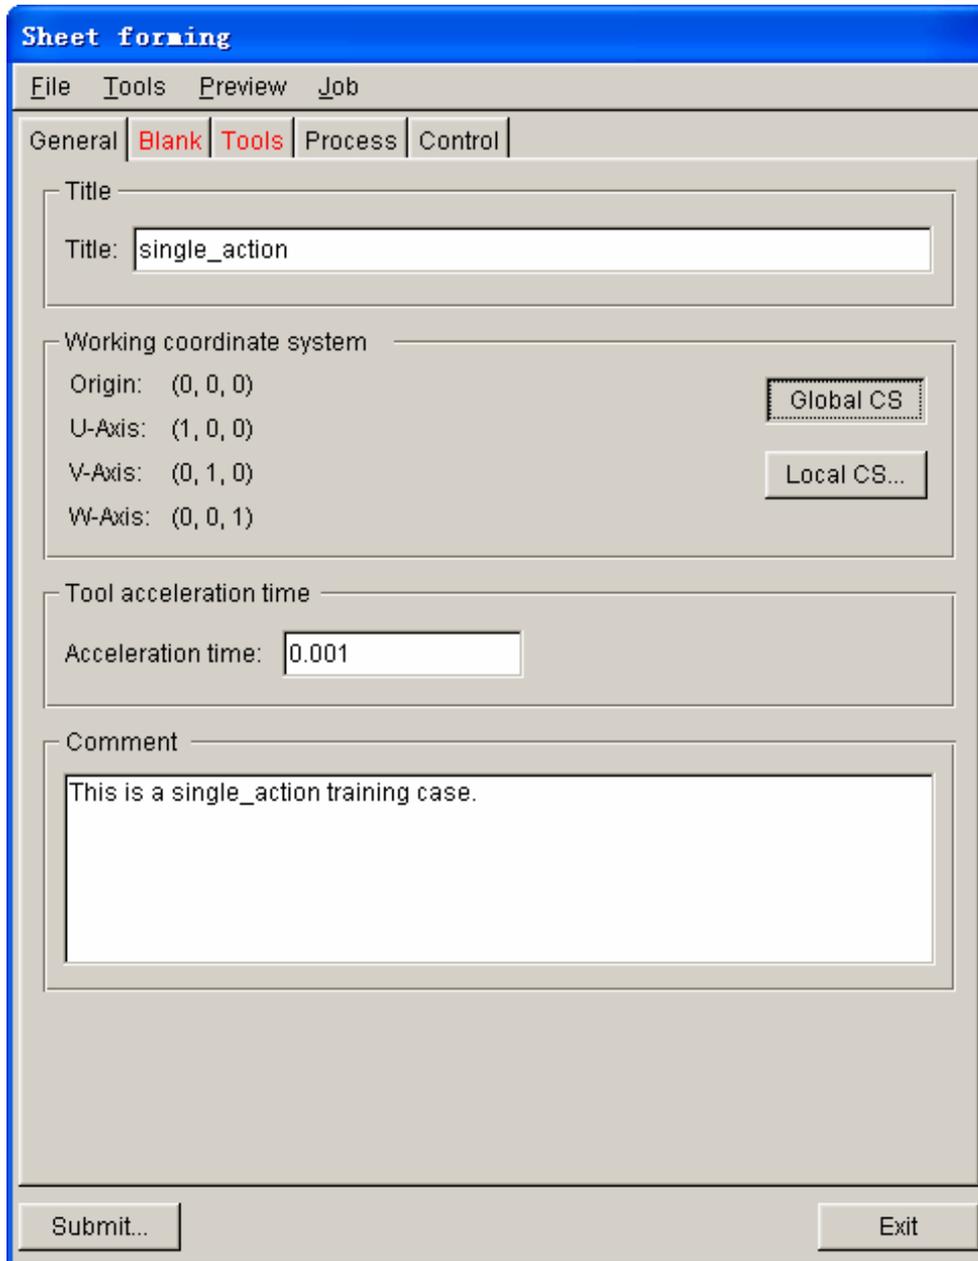


Figure 1.6 General interface

III. Blank Definition

1. First, use mouse cursor to click on **Blank** tab to display the blank definition interface.

- Then, click **Parts...** button from **Geometry** field in the blank definition interface. See Figure 1.7.

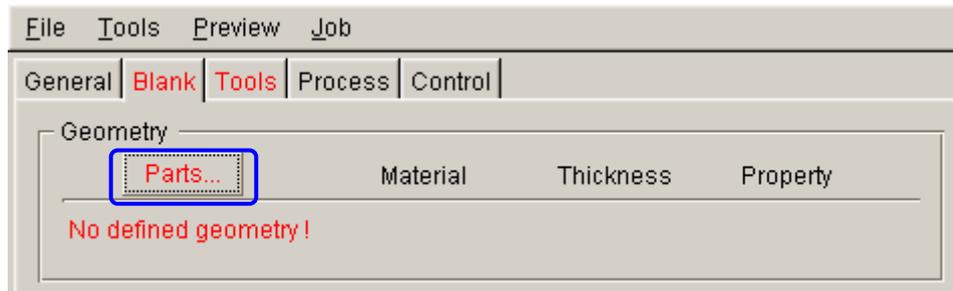


Figure 1.7 Define blank

- The DEFINE GEOMETRY dialog box illustrated in Figure 1.8 is displayed.

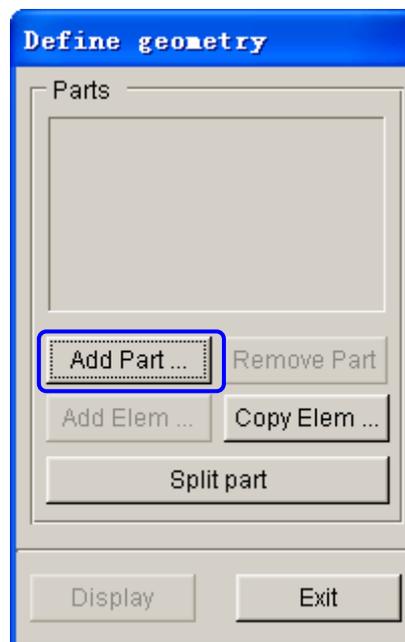


Figure 1.8 Define Geometry dialog box

- Click **Add Part...** button. Use your mouse cursor to select the **BLANK** part from the **SELECT PART** dialog box illustrated in Figure 1.9.



Figure 1.9 Select Part dialog box

5. After selecting the part, click on **OK** button to return to DEFINE GEOMETRY dialog box. The **BLANK** part is added to the parts list. See Figure 1.10.

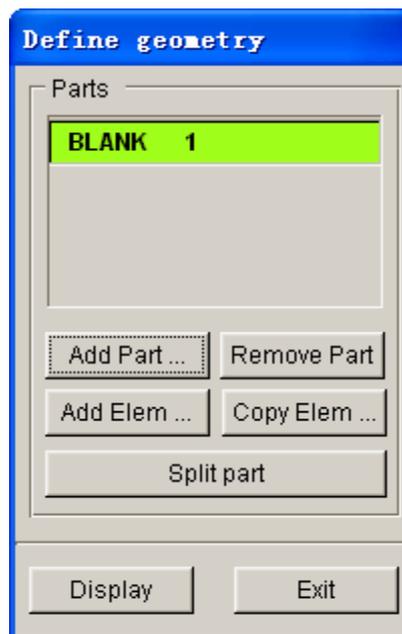


Figure 1.10 Blank geometry list

- Click the **Exit** button to return the blank definition interface. Now, the color of Blank tab is changed to from RED to BLACK. See Figure 1.11.

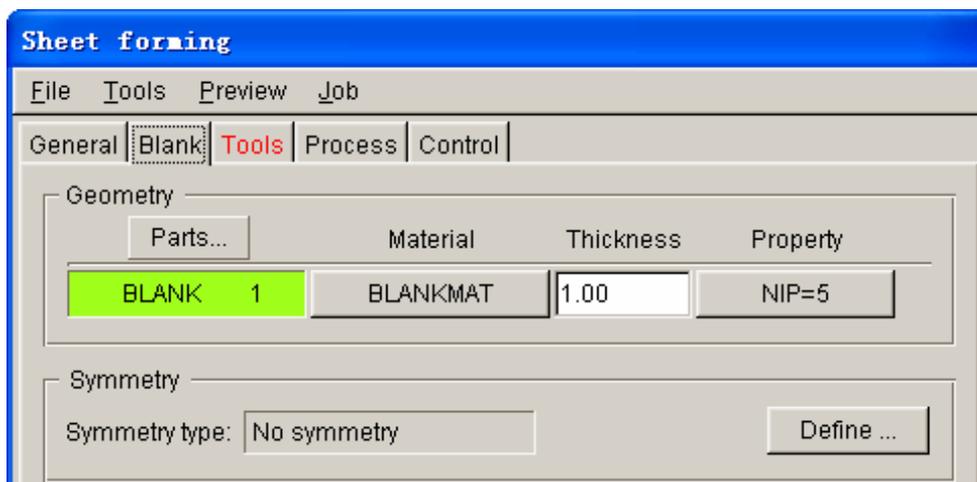


Figure 1.11 Blank definition interface

IV. Blank Material and Property Definition

Once the **BLANK** part is defined, the program automatically assigns a default blank material and relative property. You can also press the **BLANKMAT** button illustrated in Figure 1.11 to edit material definition.

After clicking the **BLANKMAT** button, the **MATERIAL** dialog box illustrated in Figure 1.12 is displayed. You can create, edit or import material into the database. Moreover, you can press the **Material Library...** button to select generic material database provided by eta/DYNAFORM. Click on the **Material Library...** button to select the United States material library illustrated in Figure 1.12.

Now, you continue to select a material from the material library, as shown in Figure 1.13. After select the material, click **Exit** to return to the AutoSetup interface.

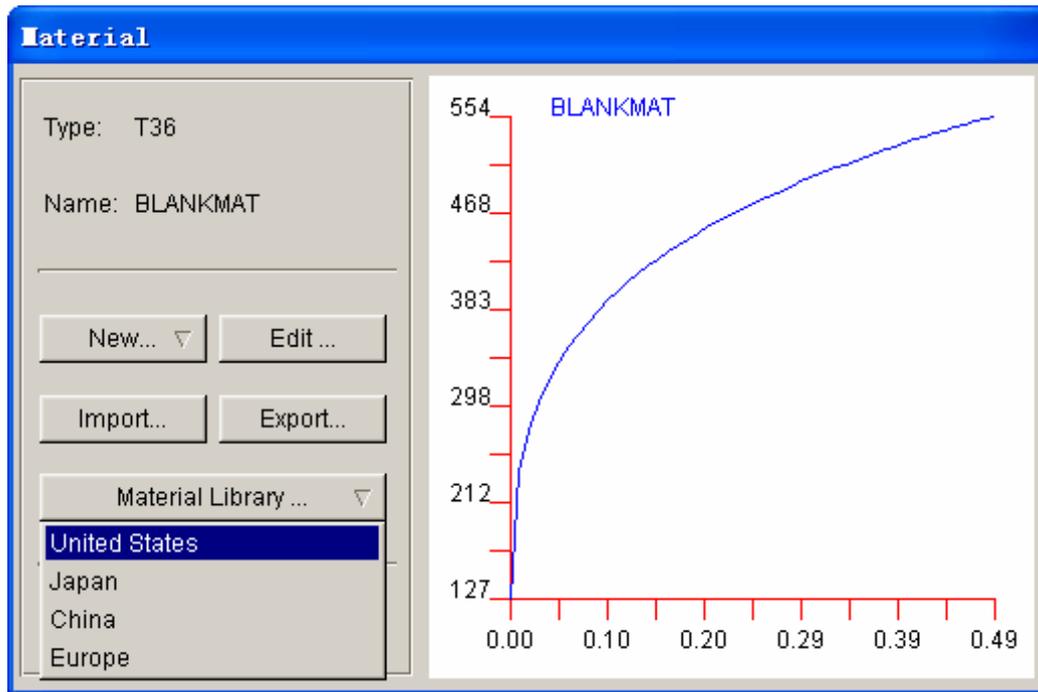


Figure 1.12 Material dialog box

Dynaform Material Library

	Strength Level	Material Name	Type 1	Type 18	Type 24	Type 36	Type 37	Type 39	Type 64
			ELASTIC	POWER	LINEAR	3-PARAM	ANISOTR	FLD_TRA	RATE_SEN
STEEL	Mild	CQ	+	+	+	+	+	-	-
		DQ	+	+	+	+	+	-	-
		DQSK	+	+	+	+	+	-	-
		DDQ	+	+	+	+	+	-	-
	Medium	BH180	+	+	+	+	+	+	-
		BH210	+	+	+	+	+	+	-
		BH250	+	+	+	+	+	+	-
		BH280	+	+	+	+	+	+	-
	High	HSLA250	+	+	+	+	+	+	-
		HSLA300	+	+	+	+	+	-	-
		HSLA350	+	+	+	+	+	+	-
		HSLA420	+	+	+	+	+	-	-
	Advanced High	DP500	+	+	+	+	+	-	-
		DP600	+	+	+	+	+	-	-
	Hot Rolled	CQ	+	+	+	+	+	-	-
		DQSK	+	+	+	+	+	-	-
		DDQIF	+	+	+	+	+	-	-
		HSLA400	+	+	+	+	+	-	-
	Stainless	SS11CrCb	+	+	+	+	+	-	-
		SS18CrCb	+	+	+	+	+	-	-
SS304		+	+	+	+	+	-	-	
SS409Ni		+	+	+	+	+	-	-	
ALUMINUM	AA5182	+	+	+	+	+	-	-	
	AA5454	+	+	+	+	+	-	-	
	AA5754	+	+	+	+	+	-	-	
	AA6009	+	+	+	+	+	-	-	

OK Help

Figure 1.13 United States generic material library

V. Tools Definition

1. Click on **Tools** tab to display tool definition interface.
2. Click  icon from the **Icon bar**, and turn off the **BLANK** part.
3. Click **OK** button to return tool definition interface. Based on the defined process, three standard tools: die, punch and binder, are listed at the left side of the tool definition interface. You can continue with definition of each tool. By default, the **die** interface is displayed.
4. Press the **Parts...** button to assign a part as die. See Figure 1.14.

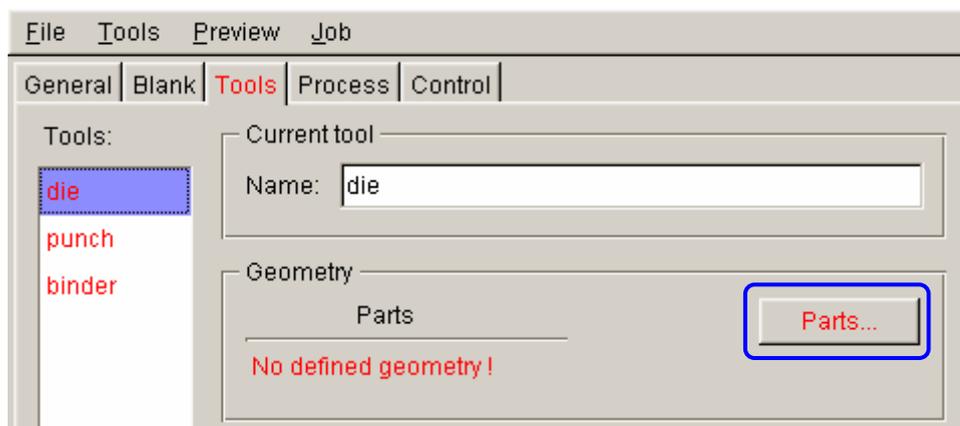


Figure 1.14 Die definition

5. The DEFINE GEOMETRY dialog box illustrated in Figure 1.15 is displayed. Next, click the **Add Part...** button in the dialog box.

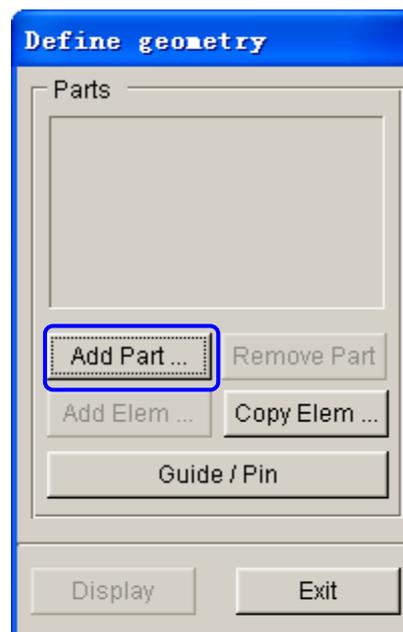


Figure 1.15 Define Geometry dialog box

6. Select **DIE** part from the SELECT PART dialog box illustrated in Figure 1.16.

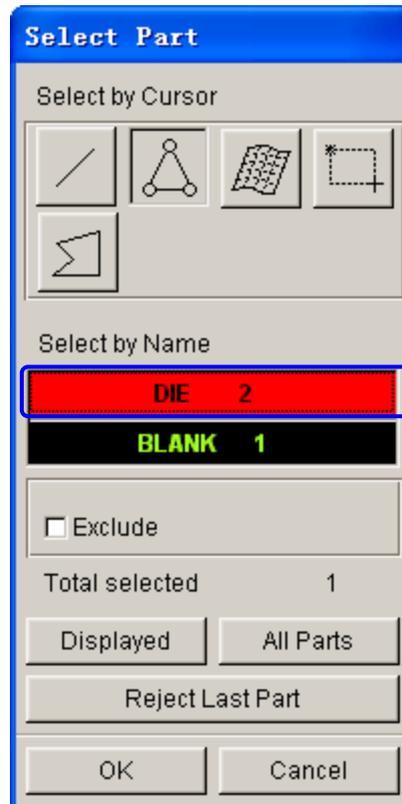


Figure 1.16 Select part dialog box

7. Click **OK** button to return to the DEFINE GEOMETRY dialog box. **DIE** part is added to the list of die. See Figure 1.17.

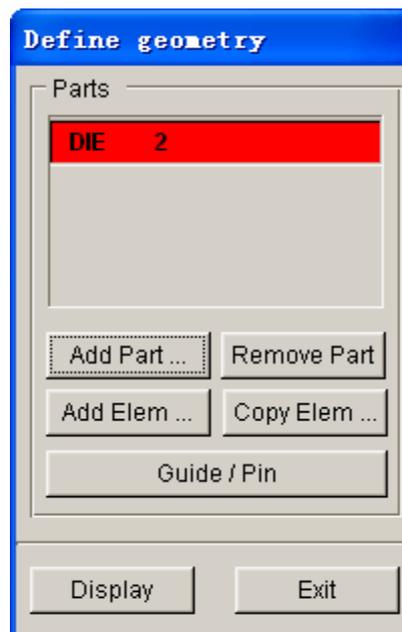


Figure 1.17 Die geometry list

- Click **Exit** button to return to tool definition interface. Now, you can observe the font color of **die** is changed to BLACK. See Figure 1.18.

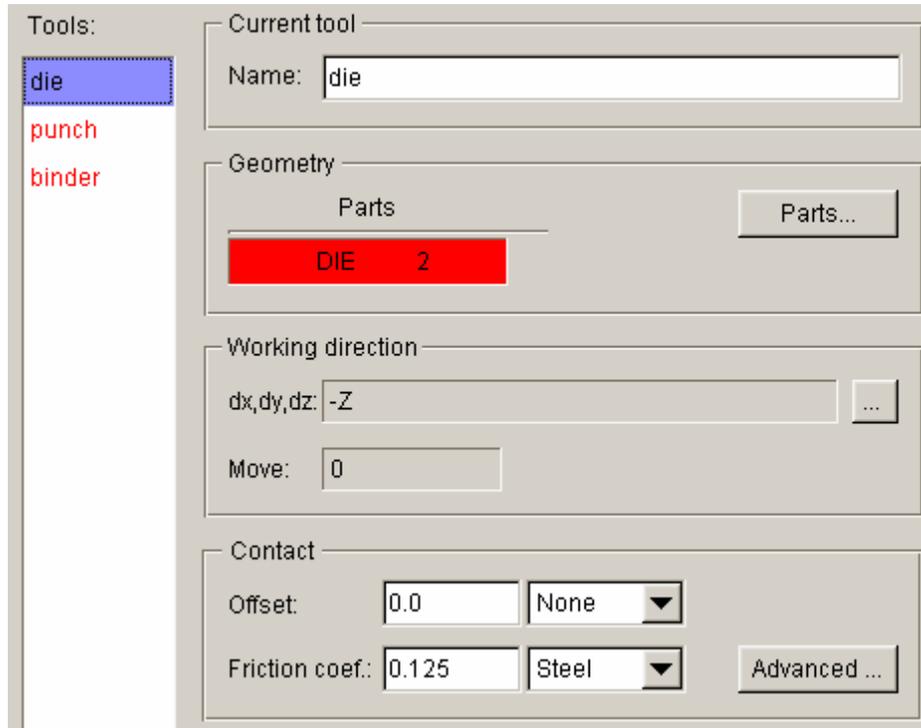


Figure 1.18 Die definition interface

- Select **punch** located at the left side of tools list to display **punch** definition interface.
- Click **Parts...** button to display the DEFINE GEOMETRY dialog box illustrated in Figure 1.19.
- Then, click **Copy Elem...** button from the dialog box to display the COPY ELEMENTS dialog box illustrated in Figure 1.20.

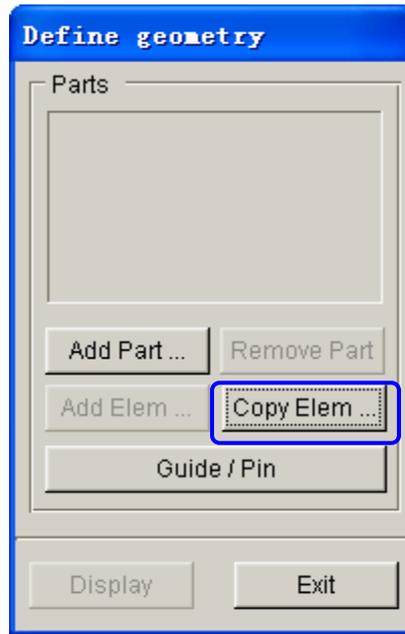


Figure 1.19 Define Geometry dialog box

12. Press **Select...** button to select copied element.

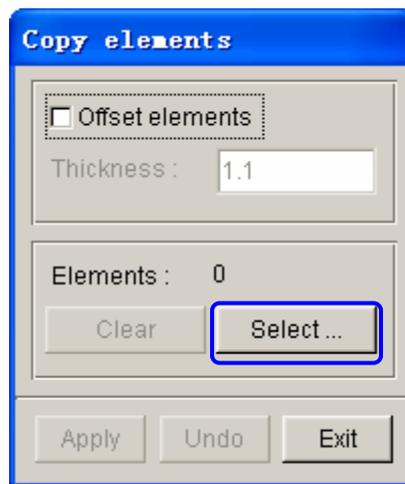


Figure 1.20 Copy Elements dialog box

13. Select some elements to define **punch** from the current database. The program will copy these elements into a default part, and automatically add the part to the list of **punch**. Click the **DISPLAYED** button in the **SELECT ELEMENTS** dialog box to select all elements. Toggle on the **Exclude** option and select the elements on binder surface using the **Spread** function with 2° spread angle, as illustrated in Figure 1.21. The program prompts that 15089 elements have been selected. As illustrated in Figure 1.22, the elements on binder surface is excluded.

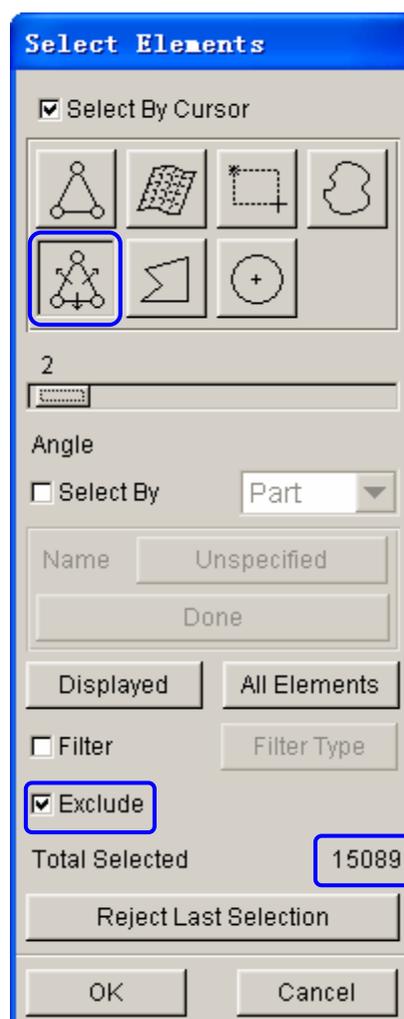


Figure 1.21 Select elements

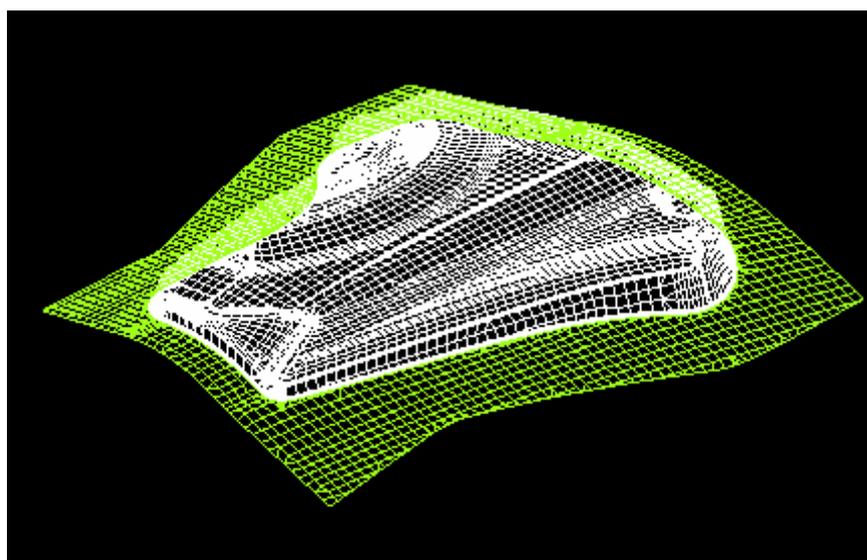


Figure 1.22 Highlighted elements

14. Click **OK** button to return COPY ELEMENTS dialog box. Now, the

APPLY button is activated. See Figure 1.23.

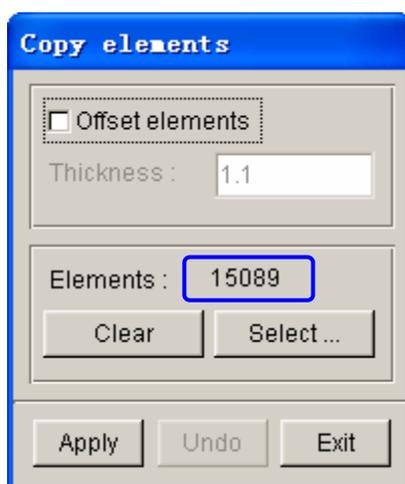


Figure 1.23 Copy Elements dialog box

15. Click **Apply** button to copy selected elements to a new part. See Figure 1.24.

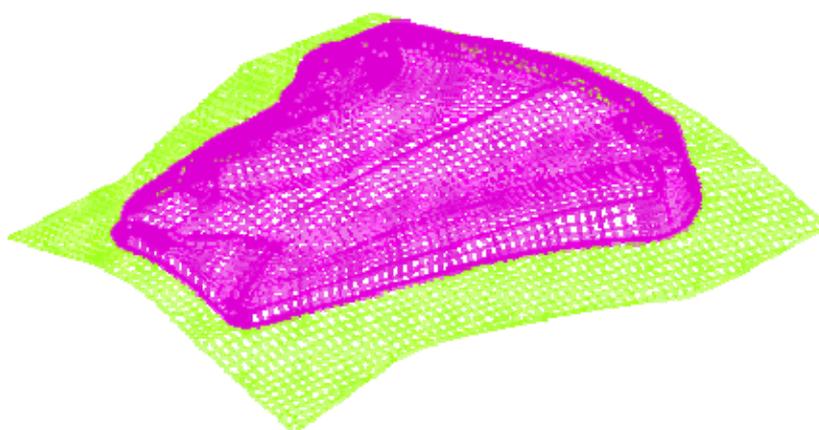


Figure 1.24 Copied elements

16. A new part named **OFFSET00** is created and added to the list of punch. See Figure 1.25.



Figure 1.25 Punch geometry list

17. Click **Exit** button to return to the tool definition interface. The font color of **punch** is also changed to BLACK, as illustrated in Figure 1.26. It means the **punch** has been defined.

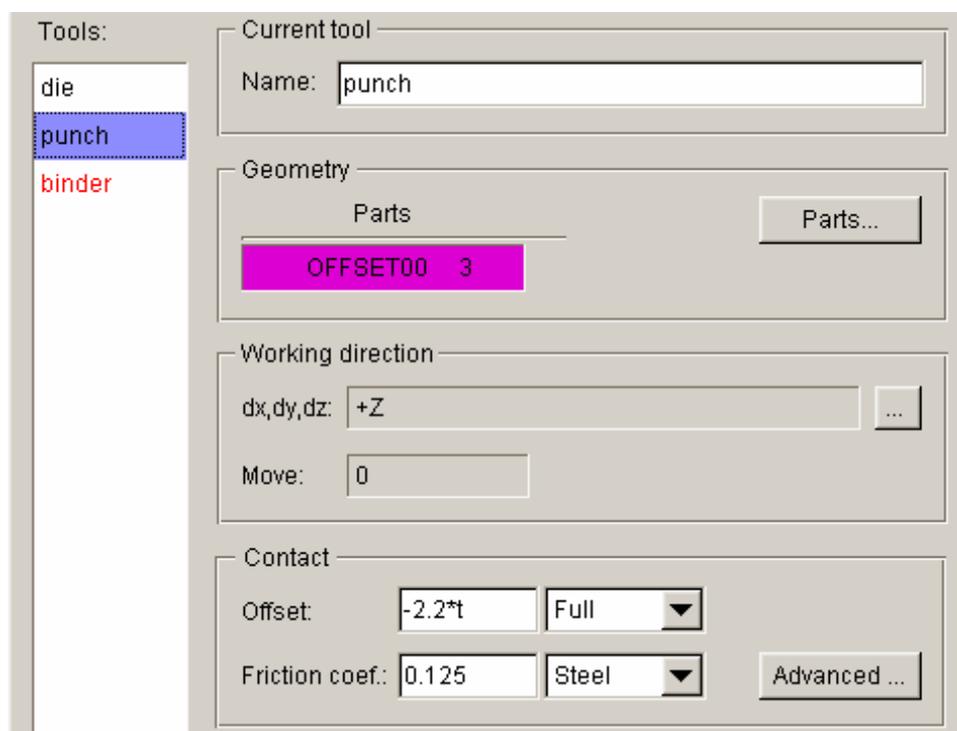


Figure 1.26 Punch definition interface

18. Click **binder** located at the left side of tool definition interface to display the binder definition interface. Next, press the **Parts...** button to display the DEFINE GEOMETRY dialog box.

19. Click **Copy Elem...** button, following by pressing the **Select...** button to select the elements using the **Spread** function provided in SELECT ELEMENTS dialog box.
20. Click the **Spread** icon illustrated in Figure 1.27. Then, move the slider bar to set the spread angle as **3°**. Next, use the mouse cursor to pick an element on the binder surface. The elements on binder surface are highlighted, as illustrated in Figure 1.28. As illustrated in Figure 1.27, 1590 elements have been selected.

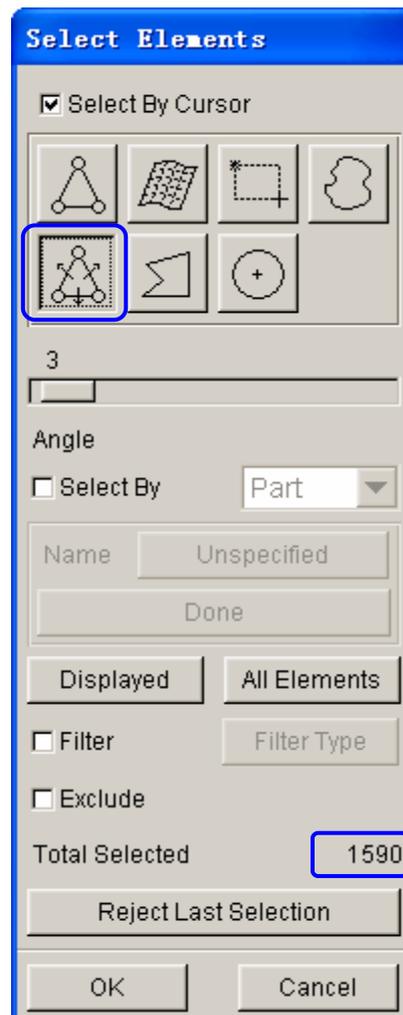


Figure 1.27 Select binder elements

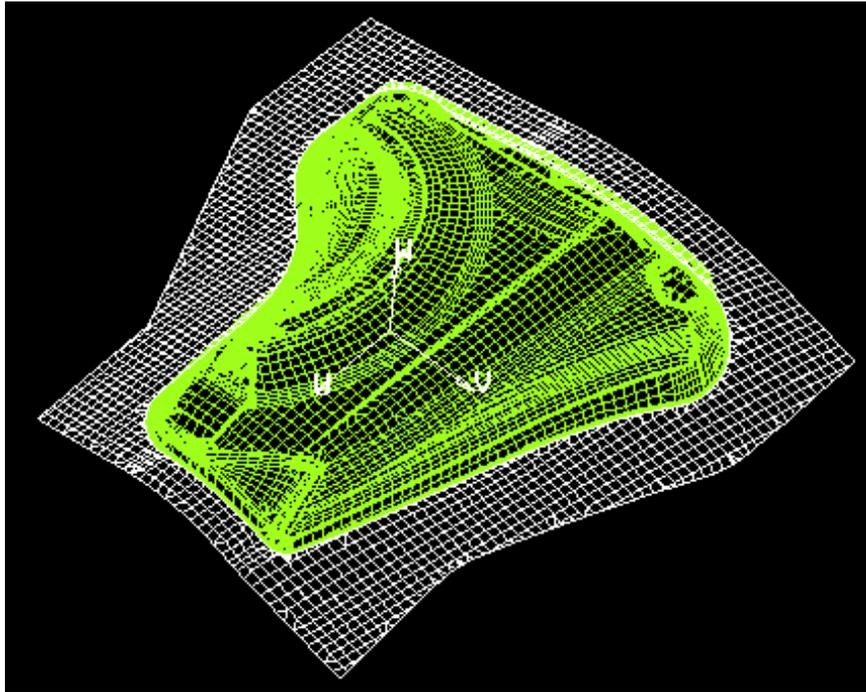


Figure 1.28 selected elements

21. Click **OK** button to exit the SELECT ELEMENTS dialog box. Press **Apply** button to copy elements in the COPY ELEMENTS dialog box. All selected elements are automatically copied to a new part. As illustrated in Figure 1.29, the new created part named OFFSET01 is added to the list of **binder**.



Figure 1.29 Binder geometry list

22. Click **Exit** button to return the main tool definition interface. The font color of all tools has been changed red into black. It means that all tools have been defined.

VI. Tools Positioning

After defining all tools, the user needs to position the relative position of tools for the stamping operation. The tool positioning operation must be carried out each time the user sets up a stamping simulation model. Otherwise, the user may not obtain correct stamping simulation setup.

The tool position is related to the working direction of each tool. Therefore, you need to carefully check the working direction prior to positioning the tools. If the process template is chosen, the default working direction is selected. You can also define special working direction.

1. Click the **Positioning...** button located at the lower right corner of the tool definition interface to display the POSITIONING dialog box illustrated in Figure 1.30. Alternatively, you can select **Tools→Positioning...** from the menu bar.

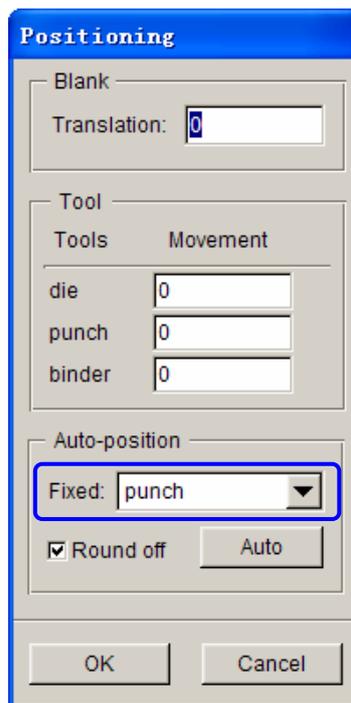


Figure 1.30 Before tools positioning

2. Select the **punch** as fixed tool and use it as the referenced tool. The tool is stationary during automatic positioning.
3. Then, click the **Auto** button to position all tools and blanks. The result is illustrated in Figure 1.31.
4. Now, all tools and blank(s) are moved to a preset location. The movement of each tool is listed in the input data field of corresponding tool. The value

of each tool is listed in the input data field of corresponding tool. The value is the measurement from the home/final position to the current position.

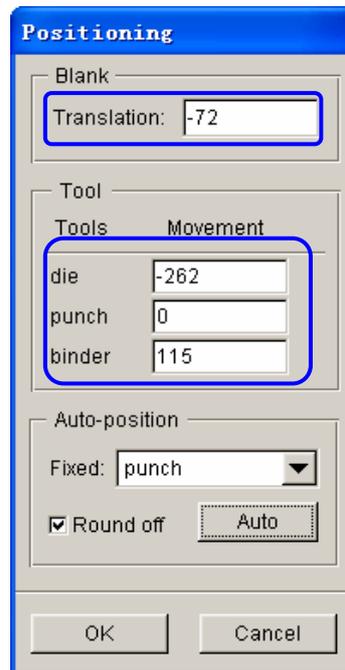


Figure 1.31 After tools auto positioning

5. Toggle off the checkbox of **Lines** and **Surfaces** in **Display Options** located at the lower right side of screen. See Figure 1.32.



Figure 1.32 Display options

6. Click  and  icon on the **Icon bar** to display the relative position of tools and blank(s), as shown in Figure 1.33.
7. Click **OK** button to save the current position of tools and blank(s), and return to the tool definition interface.

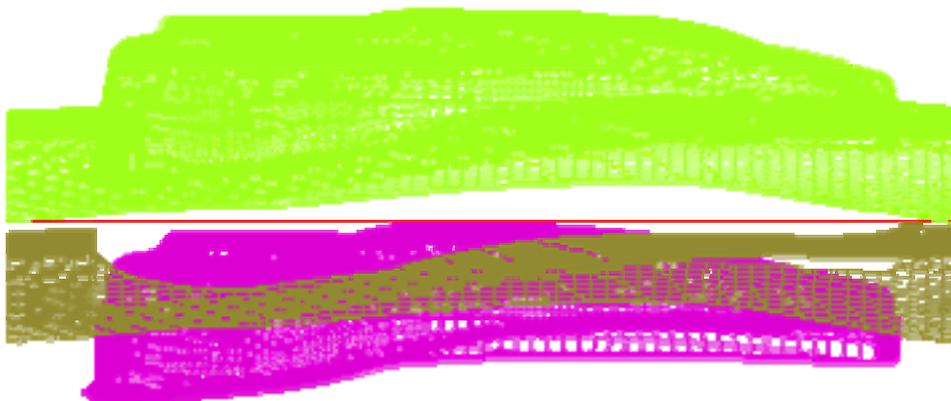


Figure 1.33 The relative position of tools and blank after positioning

Note: After autopositioning, the relative position of tools and blanks is displayed on the screen. However, you may select **Tools → Positioning...** from the Auto Setup menu bar, following by pressing the **Reset** button in the POSITIONING dialog box to set the tools and blank(s) back to its original position. Moreover, you can move the tools using the **Home...** function provided in the **Tools** menu.

Now, you can continue with the next process which is definition of process parameters. In Auto Setup application, the definition and positioning of blank(s) and tools and definition of process are not required in strict order. Therefore, you can randomly modify each operation. However, you are recommended to accordingly set up the blank(s) definition, tools definition and process parameters.

VII. Process Definition

The Process definition is utilized to set up process parameters of the current simulation such as time required for every process, tooling speed, binder force and so on. The parameters listed in process definition interface depend on the pre-selected process template, including type of simulation and process.

In this example, the type of simulation and process is **Sheet Forming** and **Single Action**, respectively. Therefore, two default processes are listed in the process definition interface: closing and drawing process.

You can press **Process** tab of the main interface to enter process definition interface. Next, follow the steps listed below:

1. Select **closing** process from the list located at left side of the interface as the current process. See Figure 1.34.
2. Verify the default setting of **closing** stage is similar to Figure 1.34.
3. Select **drawing** process from the list located at left side of the interface as the current process. See Figure 1.35.
4. Verify the default setting of **drawing** stage is similar to Figure 1.35.

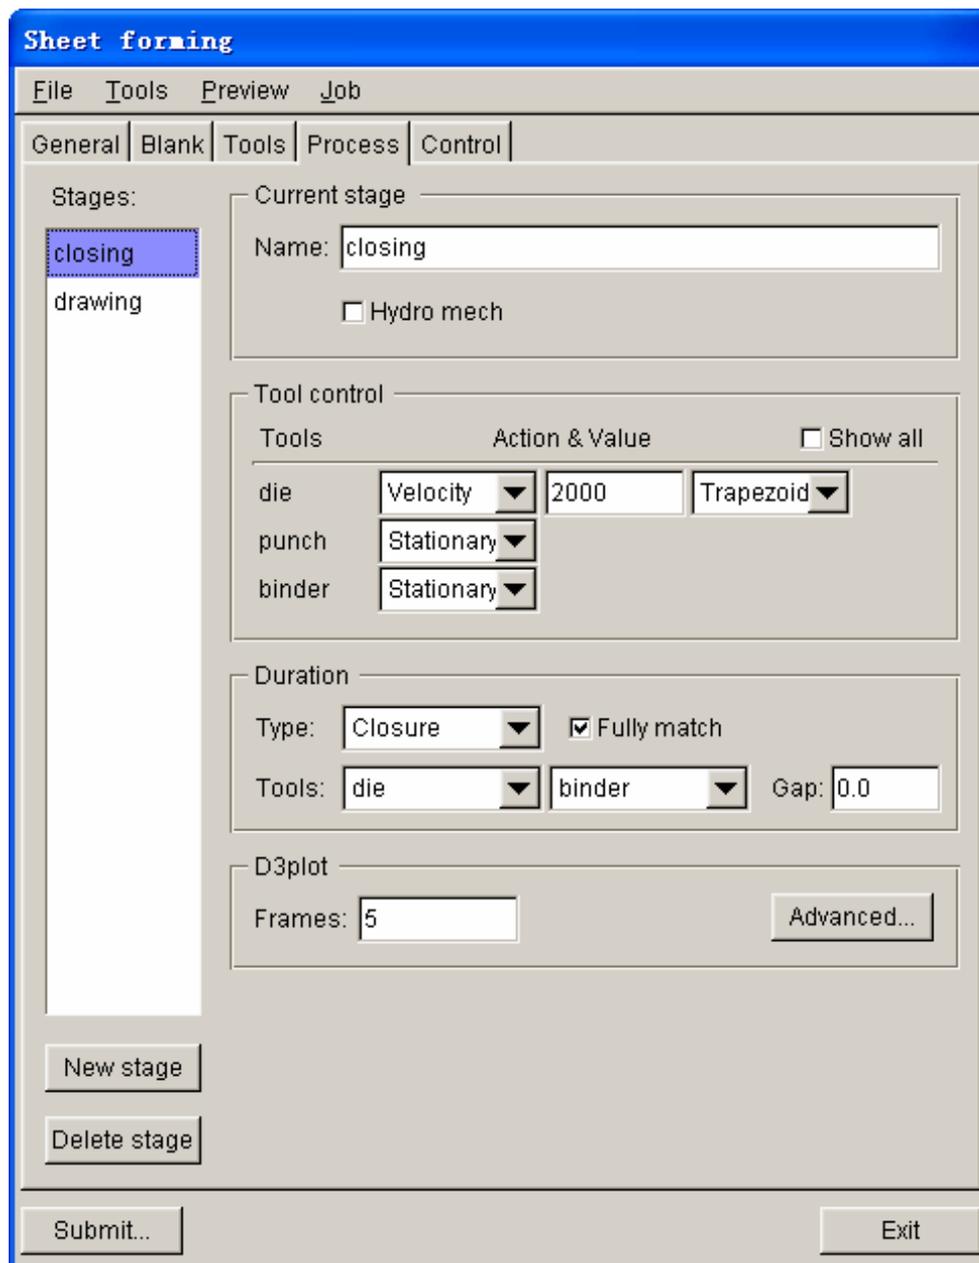


Figure 1.34 Closing process interface

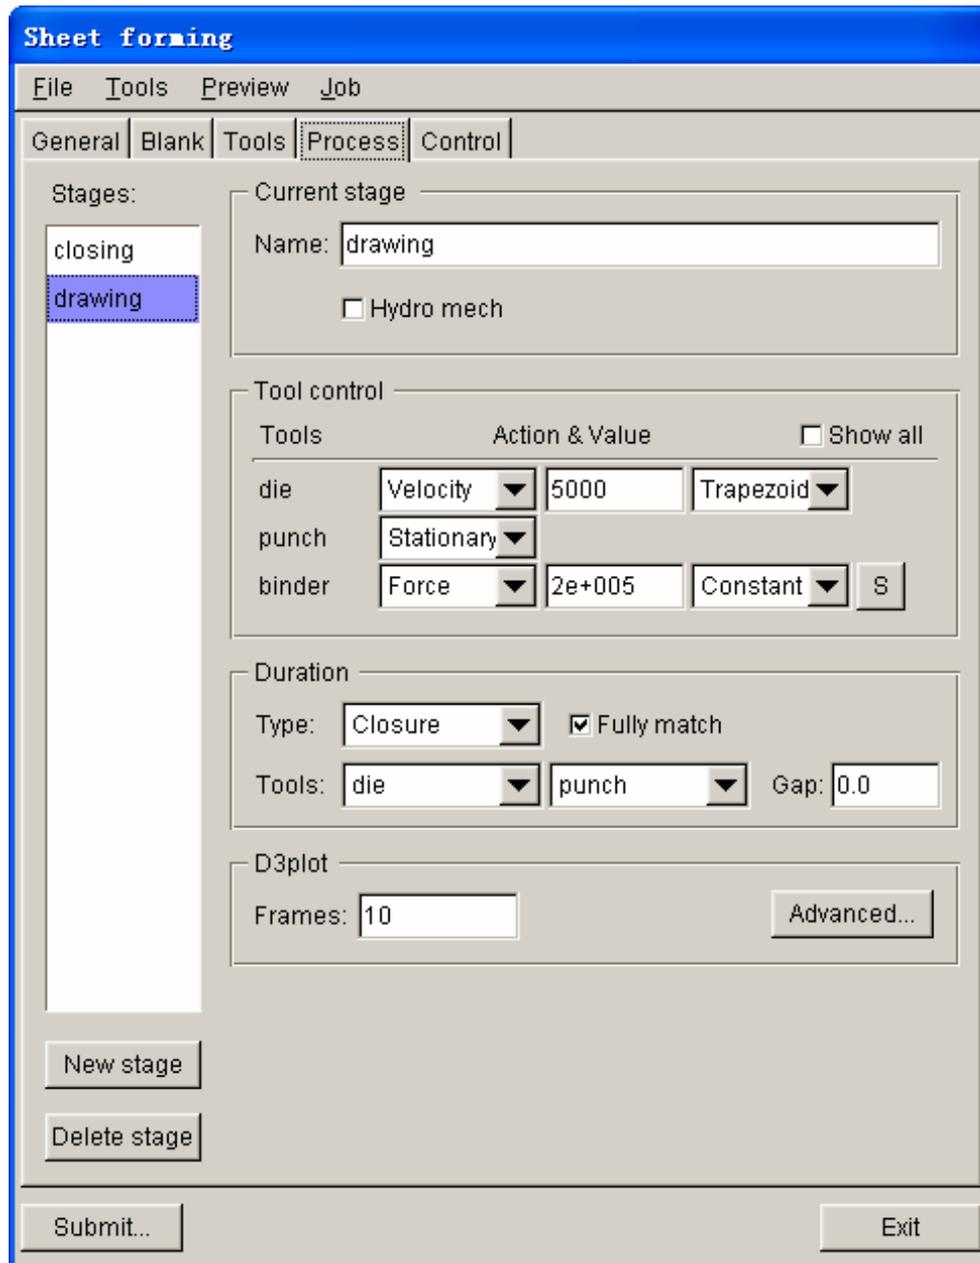


Figure 1.35 Drawing process interface

Note: We suggest the new user not to modify the default parameters in the Control interface.

VIII. Animation

Prior to submitting a simulation job, you shall validate the process setting by viewing the animation of tool movement. The procedure to conduct animation is listed as the following:

1. Select **Preview**→**Animation...** in the menu bar. See Figure 1.36.

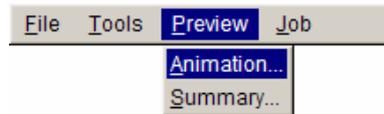


Figure 1.36 Animation menu

3. The animation of tool movement is shown on the display area.
4. You can select the **INDIVIDUAL FRAMES** option from the ANIMATE dialog box illustrated in Figure 1.37 to display the incremental tool movement.

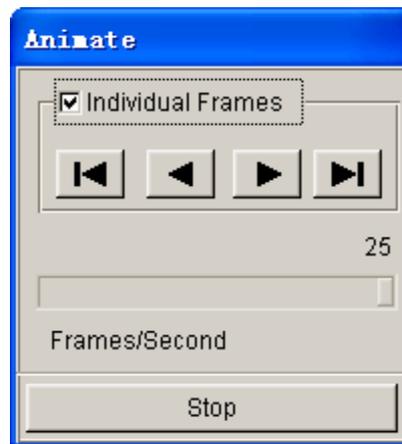


Figure 1.37 Animate dialog box

5. Click  icon to display the tool movement step by step.
6. The time step and displacement of tools are printed on the upper left hand corner of the display area. See Figure 1.38.
7. Click **Exit** button to return the main interface.

```

STEP 3   TIME = 3.000000E-002
DIE      POSI = 59.000000
PUNCH   POSI = 0.000000
BINDER  POSI = 0.000000
    
```

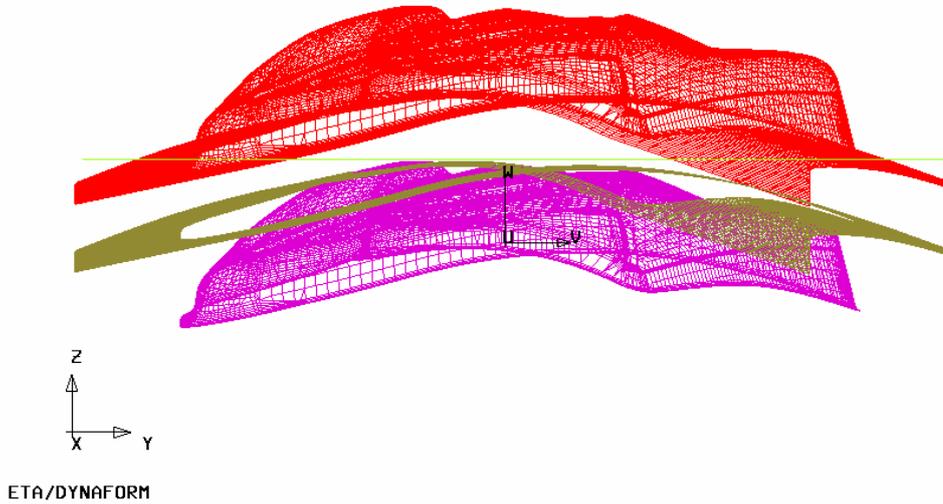


Figure 1.38 Animation of tool movement

IX. Submit Job

After validating the tools movement, you may continue with submitting the stamping simulation through the steps listed below:

1. Click **Job**→**Job Submitter...** in the menu bar. See Figure 1.39.

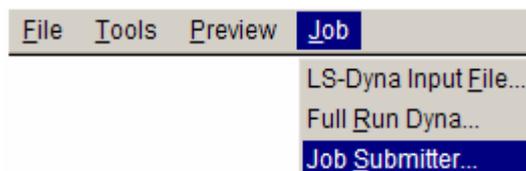


Figure 1.39 Job Submitter menu

2. The SUBMIT JOB dialog box illustrated in Figure 1.40 is displayed.

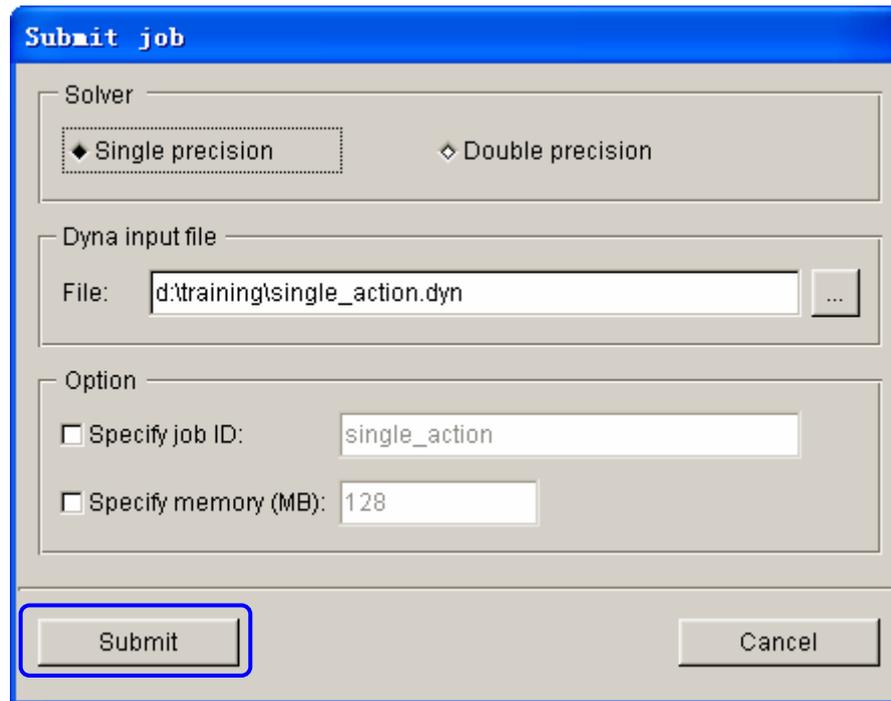


Figure 1.40 Submit job dialog box

3. Click **Submit** button from the SUBMIT JOB dialog box to display the Job Submitter interface illustrated in Figure 1.41.

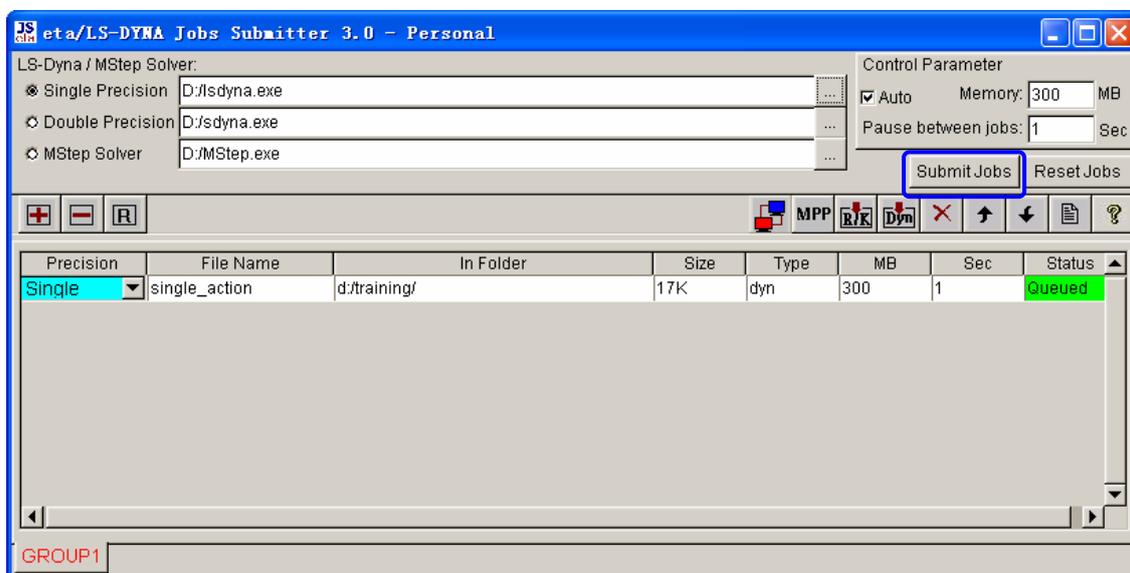


Figure 1.41 Submit job interface

4. Click **Submit Jobs** button, as shown in Figure 1.41 to activate the LS-DYNA solver for running the stamping simulation. The LS-DYNA window illustrated in Figure 1.42 is displayed and the simulation is in progress.

```

LS-DYNA - G:\Training\DF_TRA~1.DYN
total energy / initial energy.. 1.00000E+00
energy ratio w/o eroded energy. 1.00000E+00
global x velocity..... 0.00000E+00
global y velocity..... 0.00000E+00
global z velocity..... 0.00000E+00

number of shell elements that
reached the minimum time step.. 0
cpu time per zone cycle..... 0 nanoseconds
average cpu time per zone cycle... 0 nanoseconds
average clock time per zone cycle.. 401714 nanoseconds

estimated total cpu time      =      5 sec <      0 hrs  0 mins>
estimated cpu time to complete =      0 sec <      0 hrs  0 mins>
estimated total clock time    =    5863 sec <      1 hrs 37 mins>
estimated clock time to complete =    5858 sec <      1 hrs 37 mins>

added mass      =  0.0000E+00
percentage increase =  0.0000E+00

  1 t 0.0000E+00 dt 1.32E-06 flush i/o buffers
  1 t 0.0000E+00 dt 1.32E-06 write d3plot file
209 t 2.7588E-04 dt 1.32E-06 write adaptivity stress file
209 t 2.7588E-04 dt 1.32E-06 increase shells from 1750 to 2113

```

Figure 1.42 LS-DYNA Solver window

The status of in-progress stamping simulation can be determined by using the sense switch. The user can press the **Ctrl + C** key to interrupt the in-progress simulation. This operation will momentarily pause the solver and prompt the user to input the sense switch code at **“.enter sense switch:”** line. There are nine terminal sense switch codes provided in LS-DYNA. The common sense switch codes are listed below:

- sw1** – A restart file is written and solver terminates.
- sw2** – Solver responds with estimated time and cycle numbers.
- sw3** – Creates a d3dump restart file and solver continues
- sw4** – Creates a d3plot file and solver continues.

***Note:** These switches are case sensitive and must be all lower case when entered. For information about other sense switch codes, refer to LS-DYNA User’s Manual.*

Type in **sw2** and press **Enter**. Notice the estimated time has changed. You can use these switches anytime while the solver is running.

When you submit a job from eta/DYNAFORM, an input deck is automatically created. The input deck is adopted by the solver, LS-DYNA, to process the stamping simulation. The default input deck names are **single_action.dyn** and

single_action.mod. In addition, an index file named **single_action.idx** is generated for the reference in eta/POST. The **.dyn** file contains all of the keyword control cards, while the **.mod** file contains the geometry data and boundary conditions. Advanced users are encouraged to study the **.dyn** input file. For more information, refer to the *LS-DYNA User's Manual*.

Note: All files generated by either eta/DYNAFORM or LS-DYNA is stored in the directory in which the eta/DYNAFORM database has been saved. You shall ensure the folder doesn't include similar files prior to running the current job because these files will be overwritten.

POST PROCESSING (with eta/POST)

The eta/POST reads and processes all the available data in the **d3plot** and ASCII data files such as **glstat**, **rforc**, etc.. In addition to the undeformed model data, the **d3plot** file also contains all result data generated by LS-DYNA (stress, strain, time history data, deformation, etc.).

I. Reading the Results File into the Post Processor

To execute eta/POST, click **PostProcess** from **eta/DYNAFORM** menu bar illustrated in Figure 1.43. The default path for **eta/POST** is C:\Program Files\Dynaform 5.5. In this directory, you can double click on the executable file, **EtaPostProcessor.exe** to open eta/POST GUI illustrated in Figure 1.44. The **eta/POST** can also be accessed from the programs listing under the start menu of **DYNAFORM 5.5**.



Figure 1.43 PostProcess menu

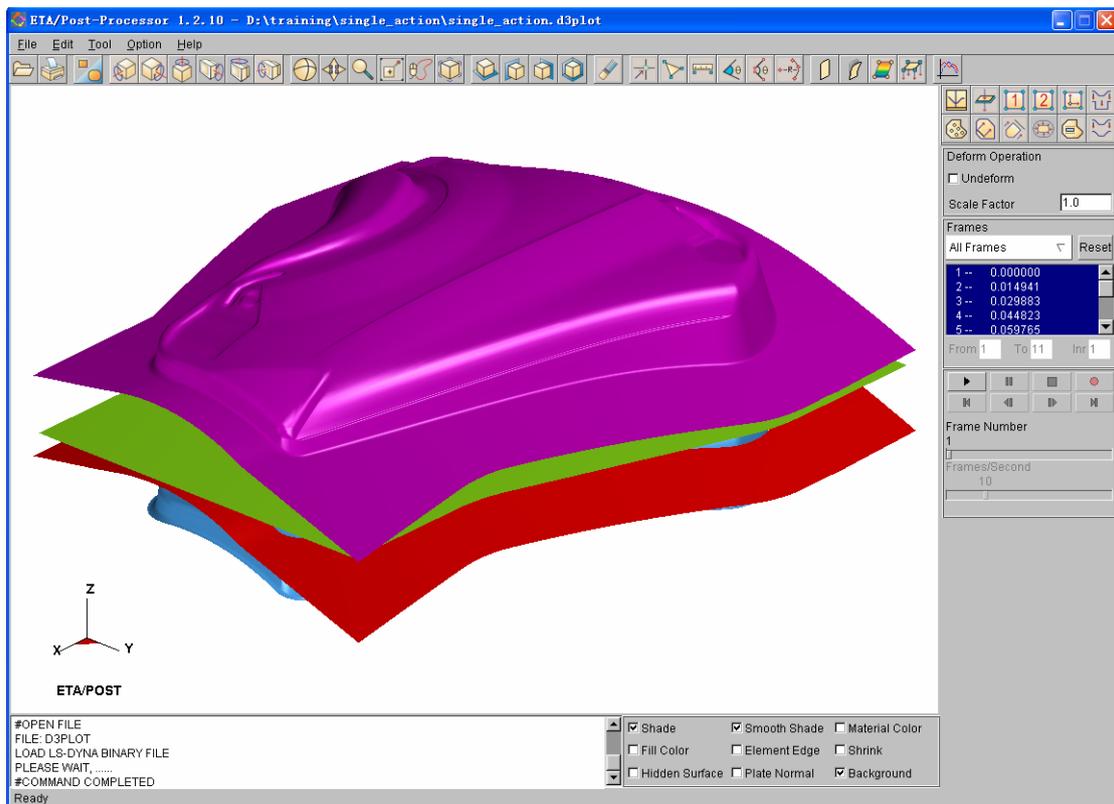


Figure 1.44 Post process GUI

1. From the **File** menu of **eta/POST**, select **Open** function illustrated in Figure 1.45. The Open File dialog box illustrated in Figure 1.46 is displayed.



Figure 1.45 File menu

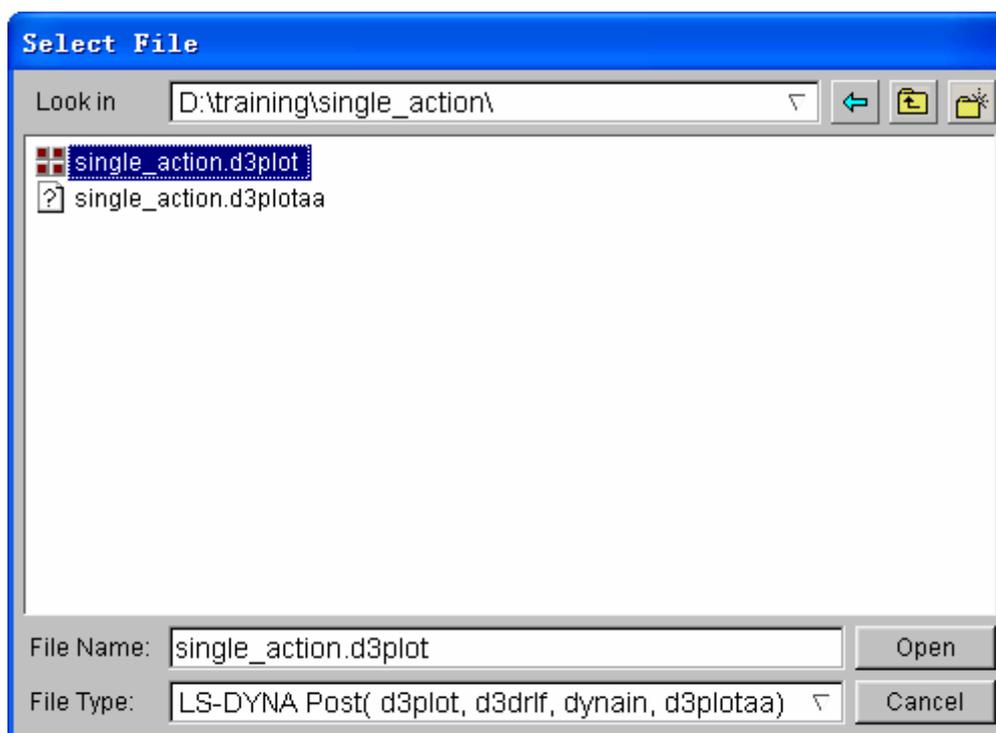


Figure 1.46 Open file dialog box

2. The default **File Type** is **LS-DYNA Post (d3plot, d3drif, dynain)**. This option enables you to read in the **d3plot**, **d3drif** or **dynain** file. The **d3plot** is output from forming simulation, such as drawing, binder wrap and springback, while **d3drif** is generated during gravity loading simulation. The **dynain** is generated at the end of each simulation. This file contains the deformed blank information.

Note: Please refer to eta/POST User's Manual for description about other file types.

3. Choose the directory of the result files. Pick the **single_action.d3plot** file illustrated in Figure 1.46, and press **Open** button.
4. The d3plot file is now completely read in. You are ready to process the results using the Special icon bar, as shown Figure 1.47.



Figure 1.47 Special icon bar for forming analysis

II. Animating Deformation

1. The default **Plot State** is **Deformation**. In the **Frame** dialog, select **All Frames** and press **Play** button to animate the results. See Figure 1.48.

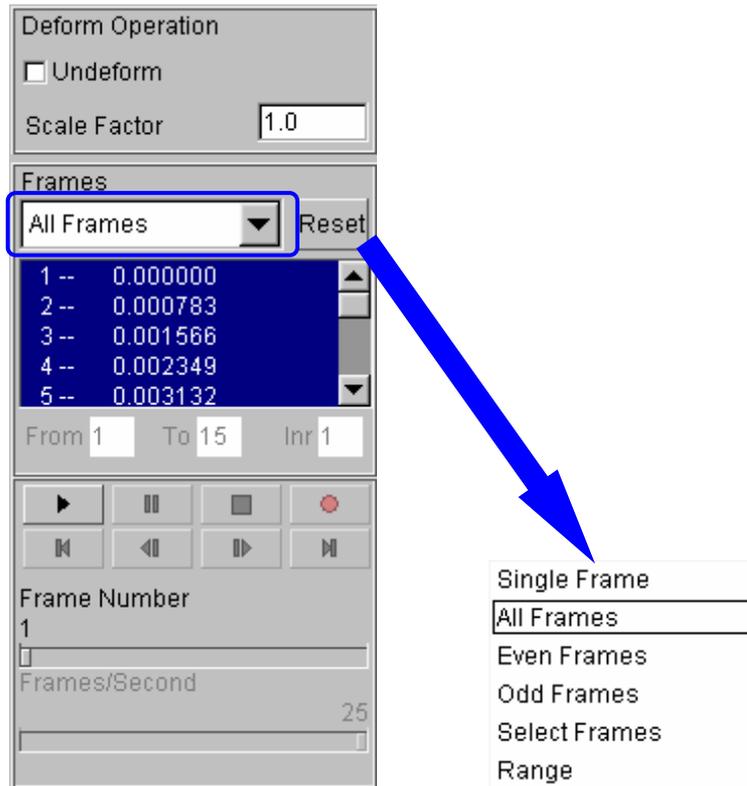


Figure 1.48 Animating deformation dialog box

2. Toggle on the **Shade** checkbox in the display options illustrated in Figure 1.49. The **Smooth Shade** option is also toggled on by default to enable smooth and continuous model display.

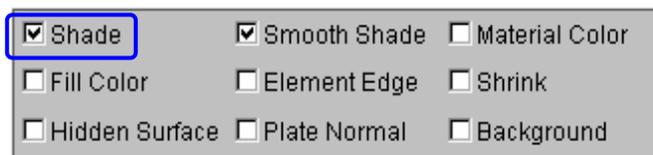


Figure 1.49 Display options

- Since it is difficult to see the Blank with all of the other tools being displayed, you can hide all the tools by pressing the  icon from **Icon bar**.
- In Part Operation dialog, use your mouse cursor to click on all the parts, excluding BLANK, as illustrated in Figure 1.50. All the tools are hidden from the display area. Then, press **Exit** button to dismiss the dialog box.

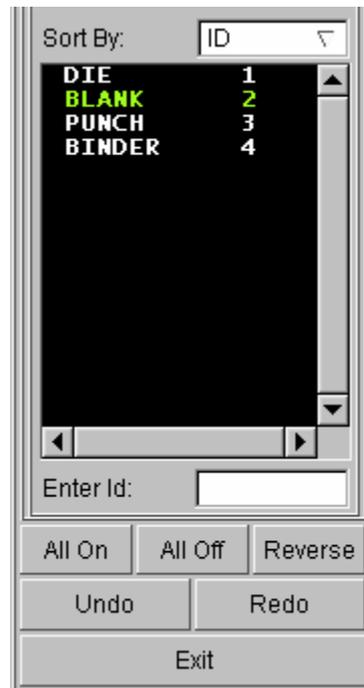


Figure 1.50 Turn parts on/off dialog box

- You can also change the displayed model using the view manipulation icons on the **Icon bar** illustrated in Figure 1.51.



Figure 1.51 Icon bar

III. Animating Deformation, Thickness and FLD

In eta/POST, you can animate deformation, thickness, FLD and various strain/stress distribution of the blank. Refer to the following examples for animation.

Thickness/Thinning

- Select  icon from the Special icon bar.

2. Select **Current Component** from combo box, either THICKNESS or THINNING. The thickness contour of deformed fender is illustrated in Figure 1.52.
3. Click **Play** button to animate the thickness contour.
4. Use your mouse cursor to move the slider to set the desired frame speed.
5. Click **Stop** button to stop the animation.

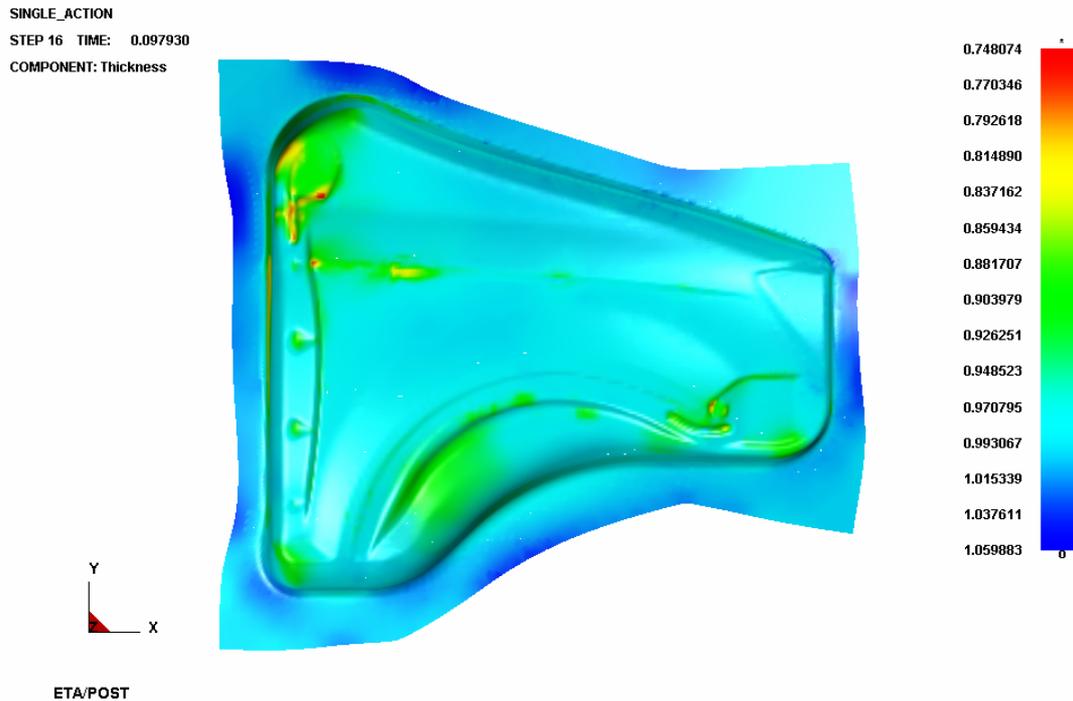


Figure 1.52 Thickness/Thinning contour

FLD

1. Pick  from the Special icon bar.
2. Select **Middle** from the **Current Component** list. The FLD contour of deformed fender is illustrated in Figure 1.53.
3. Set FLD parameters (n, t, r, etc.) by clicking on the **FLD Curve Option** button to display the FLD CURVE AND OPTION dialog box illustrated in Figure 1.54.
4. Click **OK** button to dismiss the FLD CURVE AND OPTION dialog box.
5. Select **Edit FLD Window** function to define location of FLD plot on the display window.
6. Click **Play** button to animate the FLD contour of deformed fender.
7. Click **Stop** button.

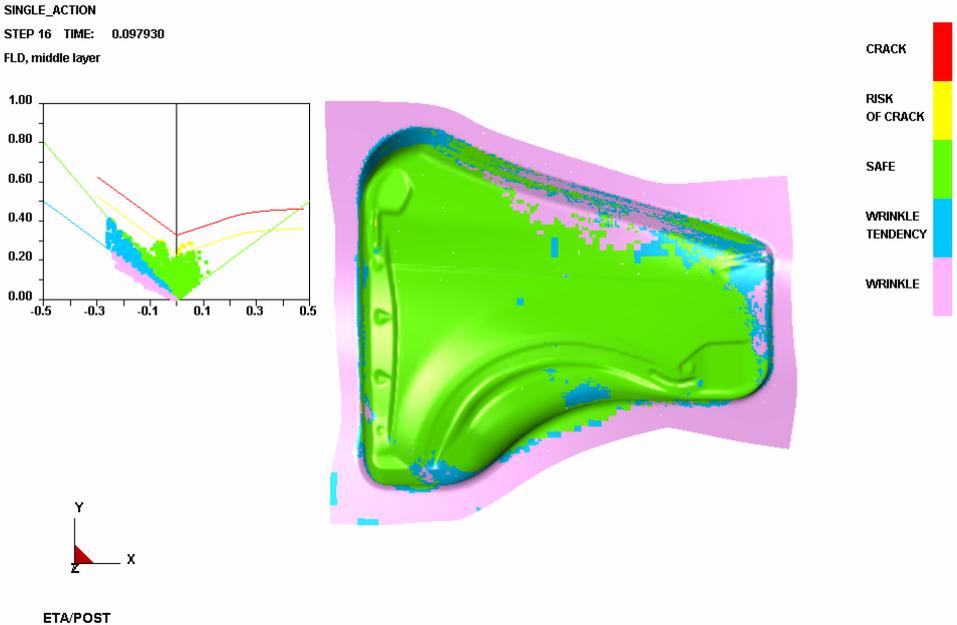


Figure 1.53 FLD contour

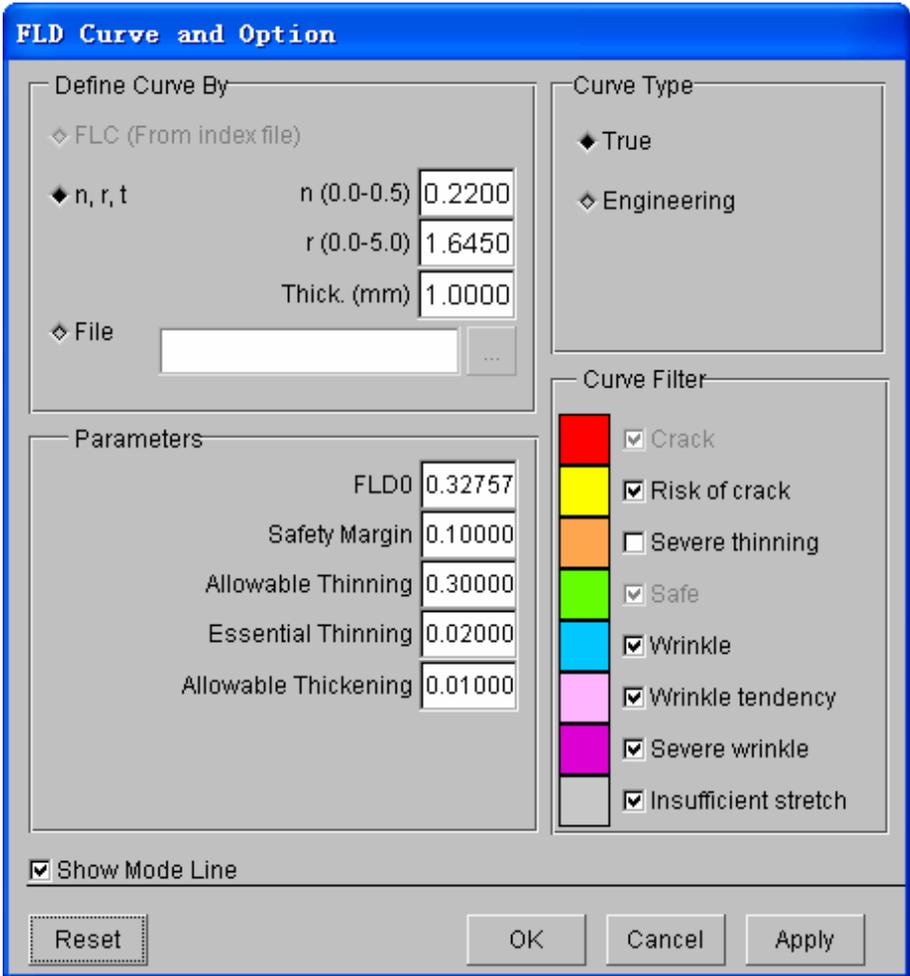


Figure 1.54 FLD Curve and Option dialog box

IV. Plotting Single Frames

Sometimes, it is much convenient to analyze the result by viewing single frames rather than the animation. To view single frame, select **Single Frame** option from the **Frames** combo box illustrated in Figure 1.55. Then, use your mouse cursor to select the desired frame from the frame list. You can also drag the slider of frame number to select the frame accordingly.

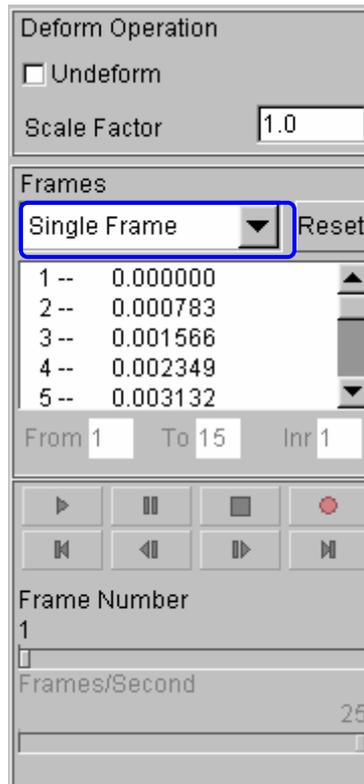


Figure 1.55 Display of single frame

V. Writing an AVI and E3D File

eta/POST provides a very useful tool that allows you to automatically create an **AVI** movie and/or **E3D** files via an animation of screen capture. The **Record** button illustrated in Figure 1.56 is commonly utilized to generate AVI movie and/or E3D files. This is the last function covered in this application example.

AVI movie

The following procedure is used to generate an AVI movie file.

1. Start a new animation (thickness, FLD, etc) using the procedure provided in Section III.
2. Display the model in isometric view.

3. Click the **Record** button.
4. The **Select File** dialog box is displayed.
5. Enter a name of the **AVI** movie file (e.g. traincase.avi) at the input data field of File Name illustrated in Figure 1.57.
6. Then, click **Save** button.
7. From the dialog box illustrated in Figure 1.58, select **Microsoft Video 1** from the **Compressor** list and click **Ok** button.
8. eta/POST will take a screen capture of the animation and write the output.

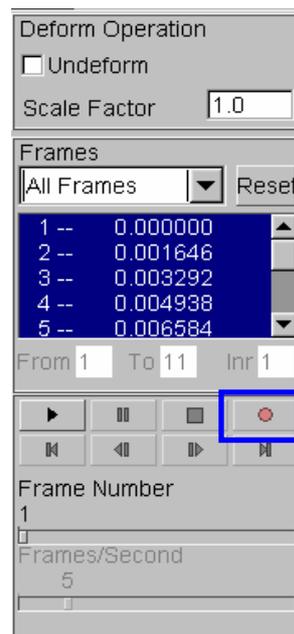


Figure 1.56 AVI dialog box

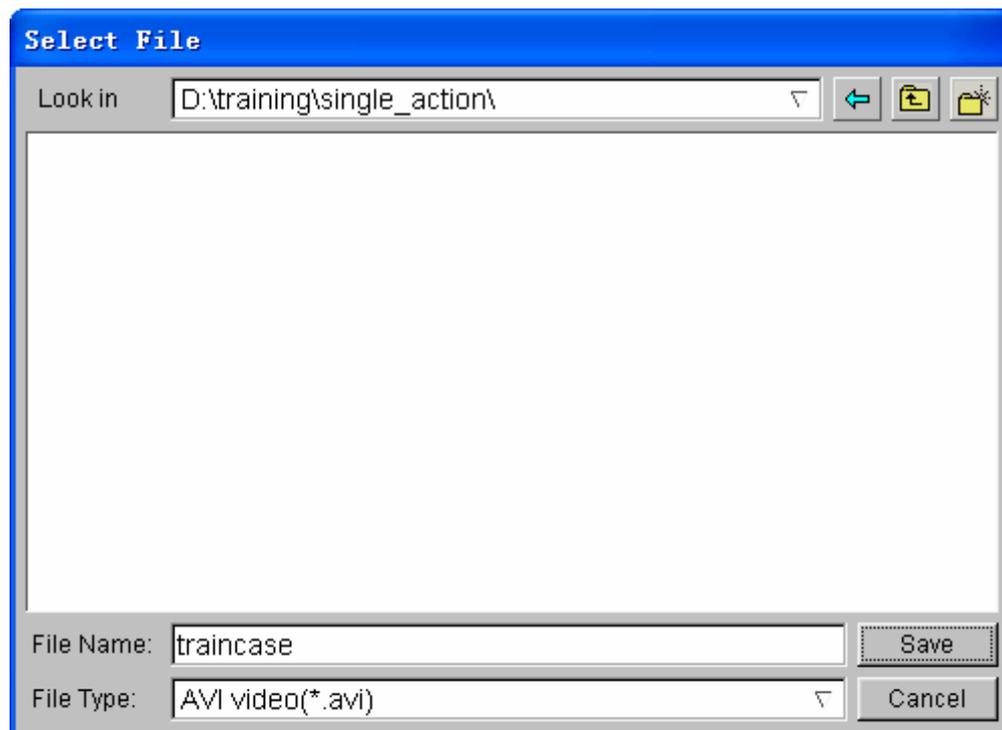


Figure 1.57 Save AVI file

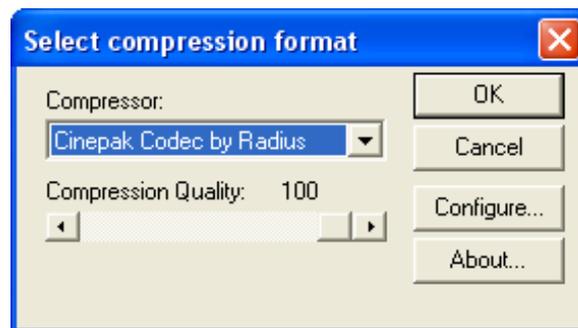


Figure 1.58 Select compression format

E3D file

You can also save simulation results in a much compact file format (*.e3d). The *.e3d file can be viewed using **eta/3DPlayer** which is provided as a free software to any users.


To create an E3D file, refer to the steps listed below:

1. Start a new animation (thickness, FLD, etc) using the procedure provided in Section III.
2. Display the model in isometric view.
3. Click the **Record** button.

4. The **Select File** dialog box is displayed.
5. Click the drop-down button of File Type to select **E3D Player file (*.e3d)**.
6. Enter a name of the **E3D** file (e.g. traincase.e3d) at the input data field of File Name.
7. Then, click **Save** button.
8. eta/POST will take a screen capture of the animation and write the output into *.e3d format.

You can view 3D simulation results using the player. To start the player, select Start→All Programs→Dynaform 5.5→Eta3DPlayer.

Example 2. Double Action

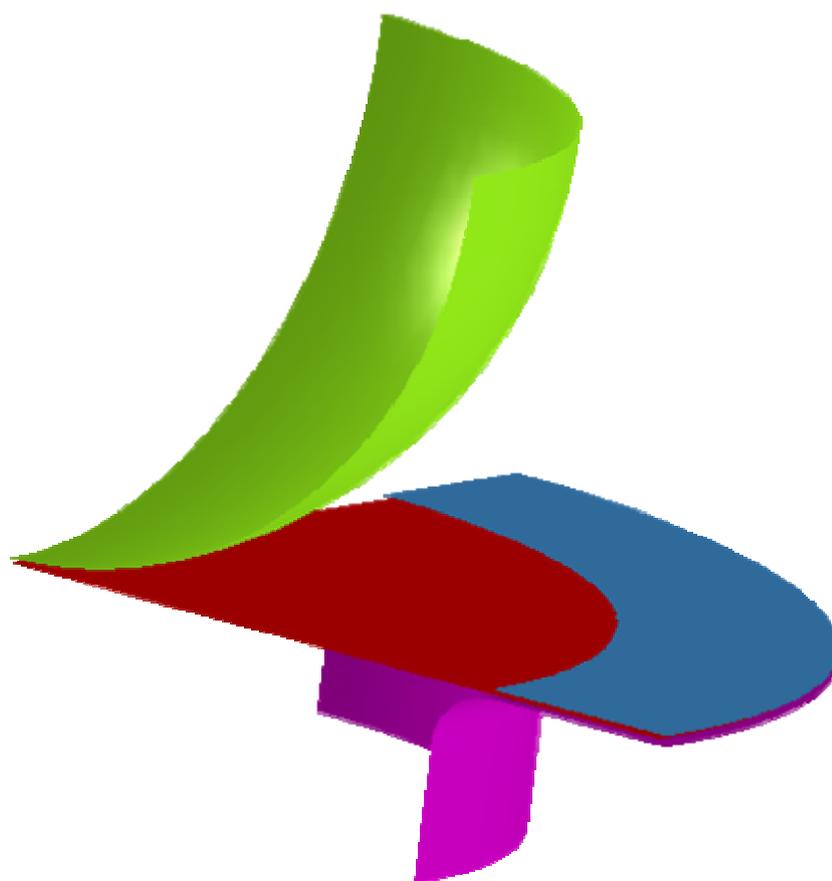

DATABASE MANIPULATION

Creating an eta/DYNAFORM Database and Analysis Setup

Start eta/DYNAFORM 5.5.

For workstation/Linux users, enter the command “**df55**” (default) from a UNIX shell.

For PC users, double click the **eta/DYNAFORM 5.5 (DF55)** icon from the desktop.

After starting **eta/DYNAFORM**, a default database **Untitled.df** is created. You begin by importing FEA data files to the current database.

Import files

1. From the menu bar, select **File→Import** to open the IMPORT file dialog box illustrated in Figure 2.1. Next, Click the drop-down button of File Type and select “**LSDYNA(*.dyn*.mod;*.k)**”. Then, go to the training input files located in the CD provided along with the eta/DYNAFORM installation. Locate the data file: **double_action.dyn**.
2. Use your mouse cursor to select the data file, following by clicking the **Import** button. Now, the model illustrated in Figure 2.2 is displayed on the display area.

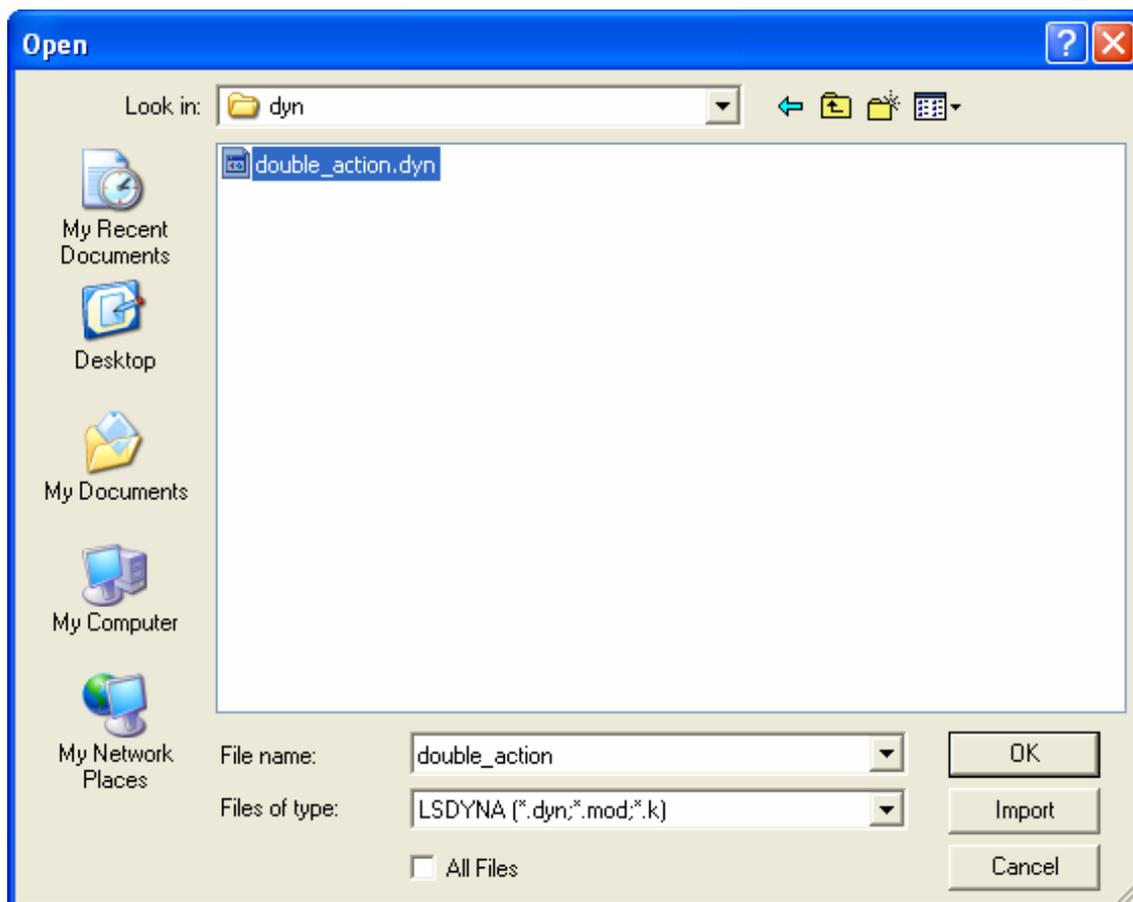


Figure 2.1 Import file dialog box

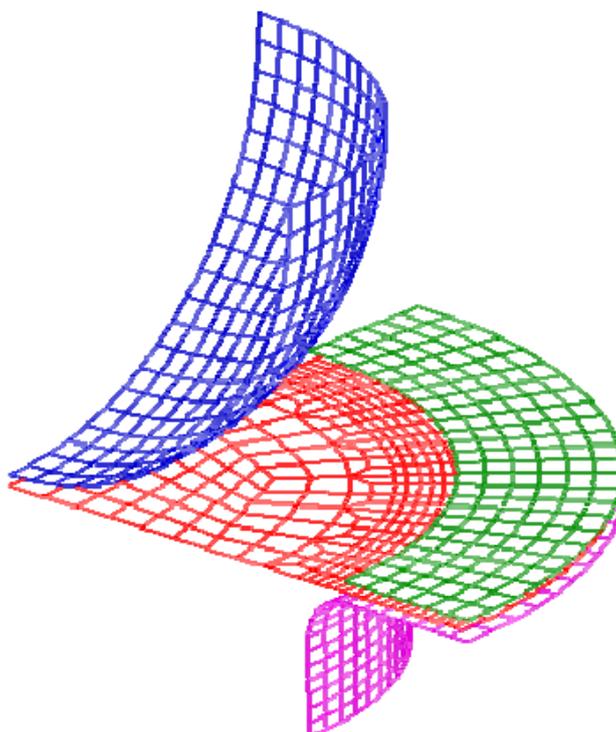


Figure 2.2 Imported model

Note: Icons may appear different depending on platform. Other functions on the **Icon bar** are further discussed in next section. You can also refer to the *eta/DYNAFORM User's Manual* for information about the **Icon bar** functions.

3. Save the database to the designated working directory. Select **File→Save as** from the menu bar. Next, type in “**double_action.df**” at the File Name data input field, as illustrated in Figure 2.3. Then, click **Save** to save the database and dismiss the dialog window.

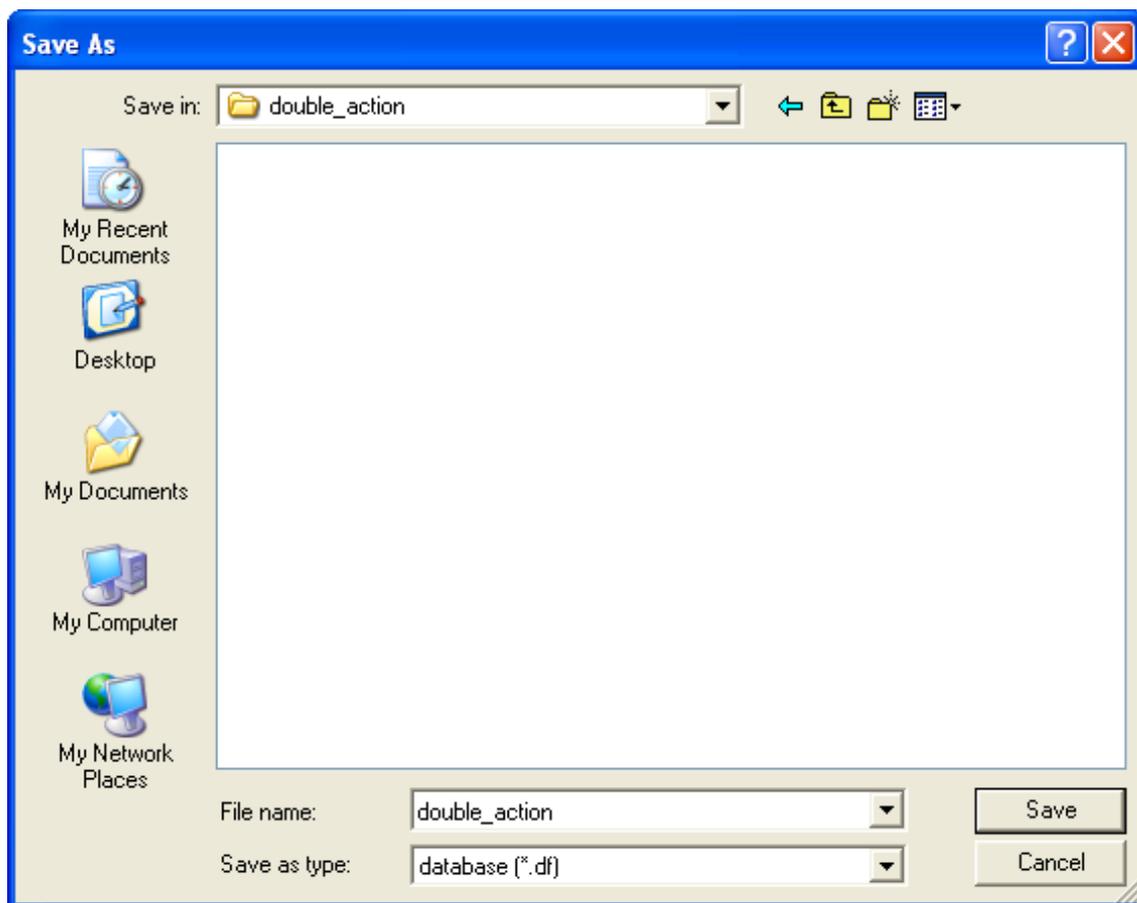


Figure 2.3 Save as file

Database Unit

From the menu bar, select **Tools→Analysis Setup**. The default unit system for a new eta/DYNAFORM database is **mm, Newton, second, and Ton**.

Edit parts

For ease of identifying each part, modify the name of each part using the Edit Part dialog box, as illustrated in Figure 2.4. Now, you have four parts, namely BLANK, PUNCH, BINDER and DIE listed in the part list.

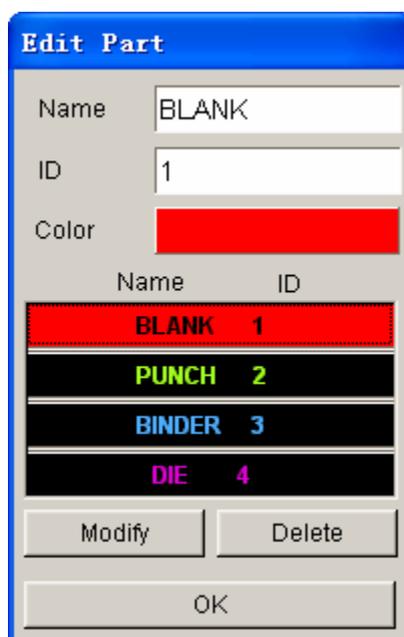


Figure 2.4 Edit part dialog box

AUTO SETUP

Prior to entering **AUTOSETUP** interface, upper/lower tool meshes are required. The other operation can be carried out in AutoSetup interface, such as **PHYSICAL OFFSET** of element, selection of **CONTACT OFFSET**. As illustrated in Figure 2.5, you can select **AUTOSETUP** option from the **SETUP** menu to display the **AUTOSETUP** interface.



Figure 2.5 Setup menu

I. New Simulation

Click **AutoSetup** in the menu bar to display the **NEW SIMULATION** dialog box, as illustrated in Figure 2.6. You continue with defining basic parameters such as blank thickness, type of process, etc from the dialog box.

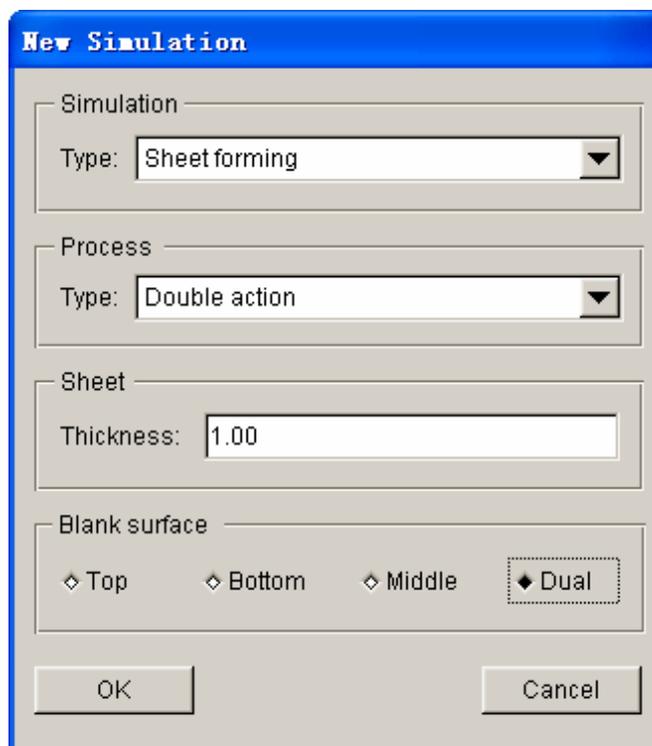


Figure 2.6 New simulation dialog box

1. Select simulation type: **Sheet forming**.
2. Select process type: **Double Action**.
3. Input blank thickness: 1.0 (mm).
4. Select tools reference: **DUAL**.
5. Click **OK** to display the main **AUTOSETUP** interface.

II. General

After entering **General** interface, you do not need to modify any parameters except for changing the **Title** into **double_action**. In addition, you can type in some comments about the setting/process in the **Comment** input field, as illustrated in Figure 2.7.

In the exercise, you will change the working coordinate into LCS. Make sure the **Y** is selected as the Degrees-of-Freedom to define the moving direction.

First, define the working coordinate by clicking the **Local CS...** button to display the WCS dialog box, as shown in Figure 2.8. Next, press the **W Axis...** button to pop up DIRECTION dialog box, as shown in Figure 2.9. Now, let's set Y-axis of global coordinate system as the W-axis of LCS by changing the input data field of X, Y and Z. As illustrated in Figure 2.9, **X=0.0**, **Y=1.0** and **Z=0.0**. Click **OK** button to exit both WCS and DIRECTION dialog boxes.

The image shows a software window titled "Sheet forming" with a menu bar containing "File", "Tools", "Preview", and "Job". Below the menu bar are four tabs: "General", "Blank", "Tools", "Process", and "Control". The "General" tab is active. The interface is divided into several sections:

- Title:** A text box containing "double_action".
- Working coordinate system:** A section with four coordinate values: Origin: (0, 0, 0), U-Axis: (1, 0, 0), V-Axis: (0, 1, 0), and W-Axis: (0, 0, 1). To the right are two buttons: "Global CS" and "Local CS...". The "Local CS..." button is highlighted with a blue border.
- Tool acceleration time:** A section with a label "Acceleration time:" and a text box containing "0.001".
- Comment:** A large empty text area for entering comments.

At the bottom of the window are two buttons: "Submit..." on the left and "Exit" on the right.

Figure 2.7 General interface

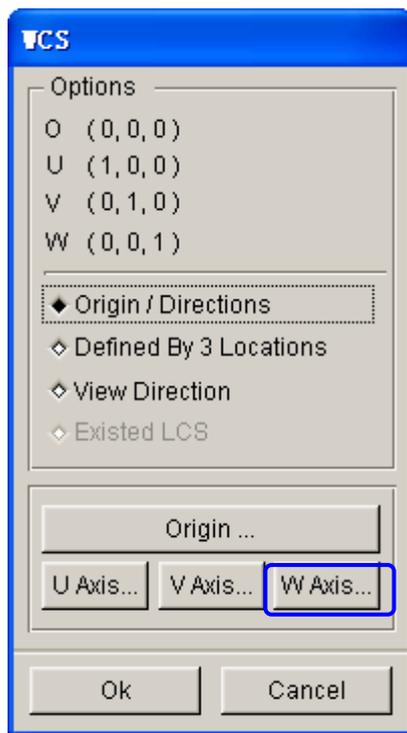


Figure 2.8 WCS dialog box

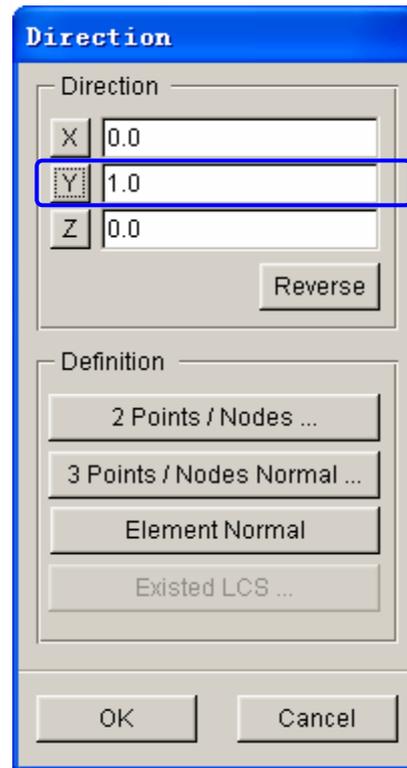


Figure 2.9 Direction dialog box

III. Blank Definition

1. Press the **Blank** tab to display the blank definition interface.
2. Then, click **Parts...** button from **Geometry** field in blank definition interface. See Figure 2.10.

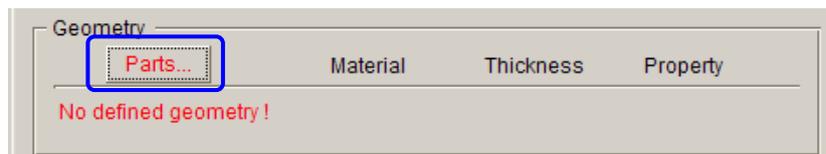


Figure 2.10 Define blank

3. The program will pop up the DEFINE GEOMETRY dialog box illustrated in Figure 2.11.
4. Click **Add Part...** button to display the SELECT PART dialog box illustrated in Figure 2.12. Let's use the mouse cursor to select **BLANK** part from the dialog box.
5. After selecting the part, you can click **OK** button to return to the DEFINE GEOMETRY dialog box. As illustrated in Figure 2.13, the **BLANK** part has been added to the list of blank.

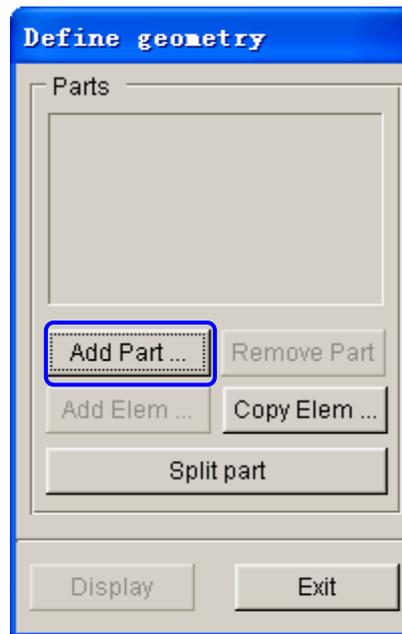


Figure 2.11 Define Geometry dialog box

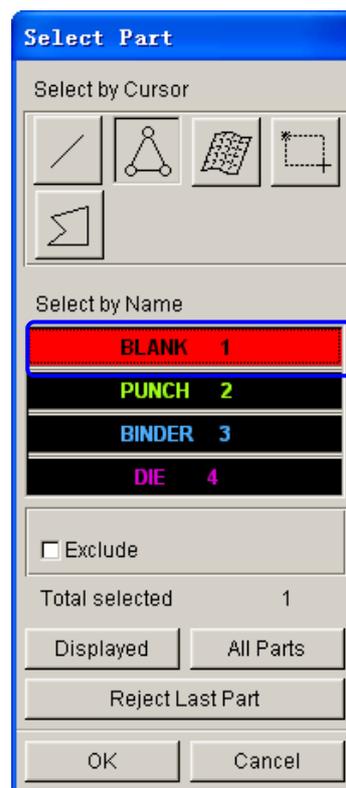


Figure 2.12 Select Part dialog box

6. Click **Exit** button to return to the blank definition interface. Now, the color of Blank tab is changed to from RED to BLACK. See Figure 2.14.



Figure 2.13 Blank geometry list

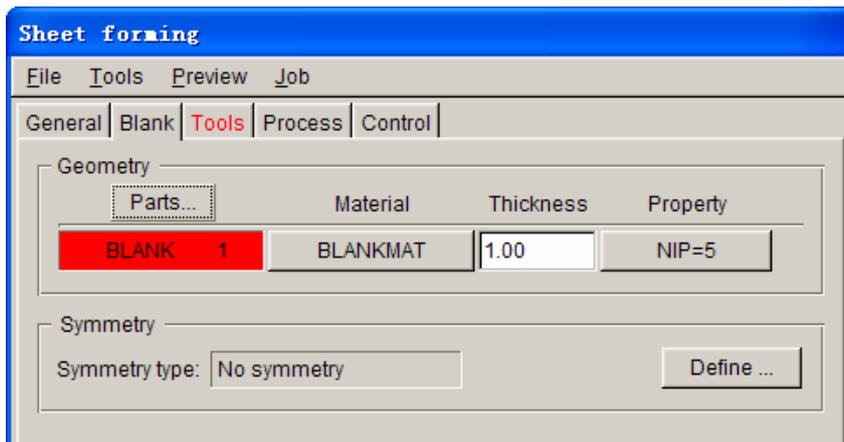


Figure 2.14 Blank definition interface

IV. Blank Material and Property Definition

Once the **BLANK** part is defined, the program automatically assigns a default blank material and relative property. You can also press the **BLANKMAT** button illustrated in Figure 2.15 to edit material definition.

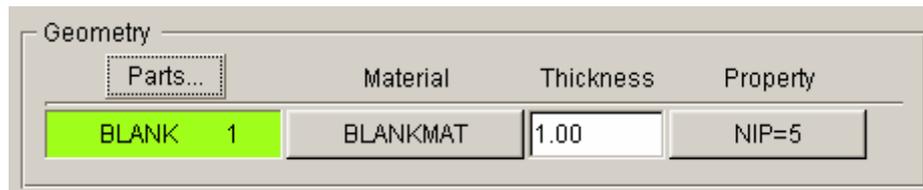


Figure 2.15 Blank geometry definition

After clicking the **BLANKMAT** button, the MATERIAL dialog box illustrated in Figure 2.16 is displayed. You can create, edit or import material into the database. Moreover, you can press the **Material Library...** button to select generic material database provided by eta/DYNAFORM. Click on the **Material Library...** button to select the United States material library illustrated in Figure 2.16.

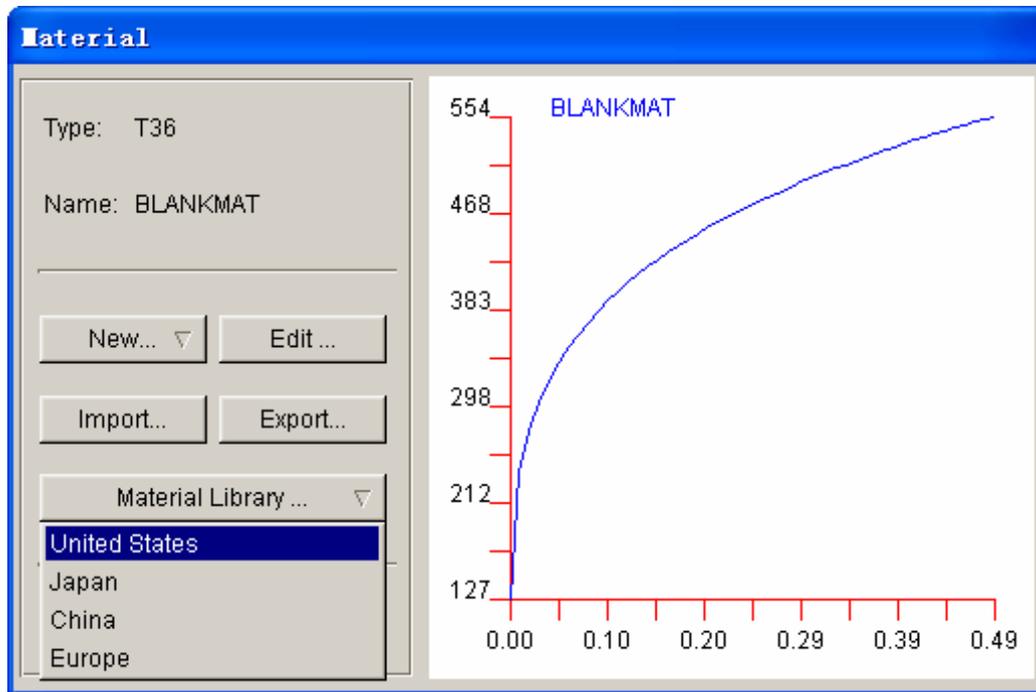


Figure 2.16 Blank material definition

Now, you continue to select a material from the material library, as shown in Figure 2.17.

Note: You can create your own material or edit the selected material using the functions provided in MATERIAL dialog box.

The screenshot shows the Material Library dialog box. It contains a table with columns for Material Type, Strength Level, Material Name, and seven strength levels: T1, T18, T24, T36, T37, T39, and T64. The table lists materials under the 'STEEL' type, categorized by 'Mild', 'Medium', 'High', and 'Advanced High' strength levels. Each cell in the table contains a '+' or '-' sign, indicating whether a material is available for that strength level. A blue box highlights the '+' sign in the T36 column for the DQSK material.

Material Type	Strength Level	Material Name	T1	T18	T24	T36	T37	T39	T64
STEEL	Mild	CQ	+	+	+	+	+	-	-
		DQ	+	+	+	+	+	-	-
		DQSK	+	+	+	+	+	-	-
	Medium	BH180	+	+	+	+	+	+	-
		BH210	+	+	+	+	+	+	-
		BH250	+	+	+	+	+	+	-
	High	HSLA250	+	+	+	+	+	+	-
		HSLA300	+	+	+	+	+	-	-
		HSLA350	+	+	+	+	+	+	-
Advanced High	DP500	+	+	+	+	+	-	-	
	DP600	+	+	+	+	+	-	-	

Figure 2.17 United States generic material library

V. Symmetry-plane Definition

This example presents a symmetrical dome shape part. Therefore, only quarter of the part is modeled in order to reduce computational time.

Click **Define...** button, as shown in Figure 2.18. The SYMMETRY-PLANE dialog box illustrated in Figure 2.19 is popped up. From the dialog box, you select the geometry type, **Quarter Symmetry**. Then, select the boundary nodes illustrated in Figure 2.20.

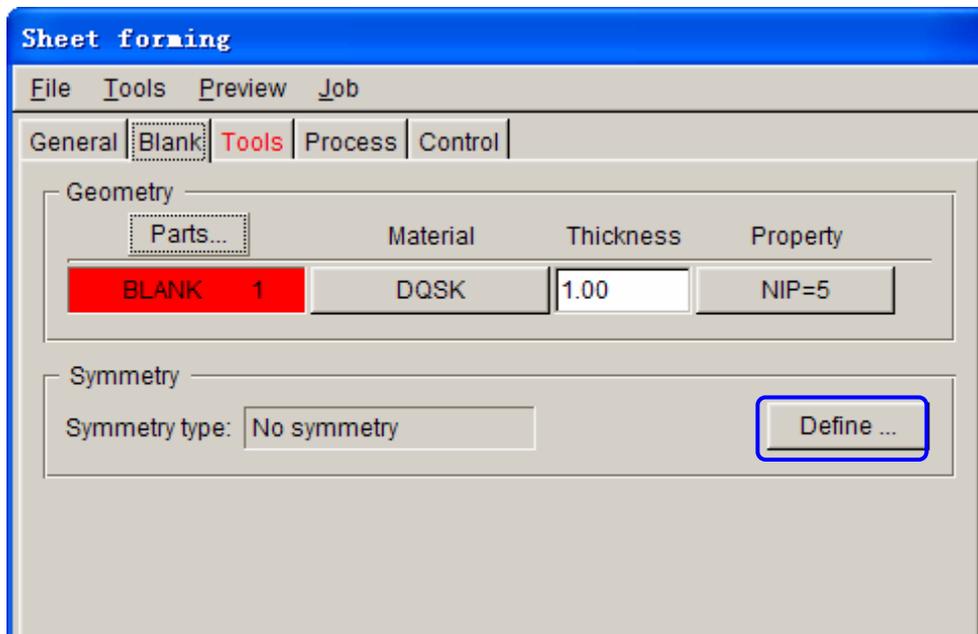


Figure 2.18 Blank definition interface

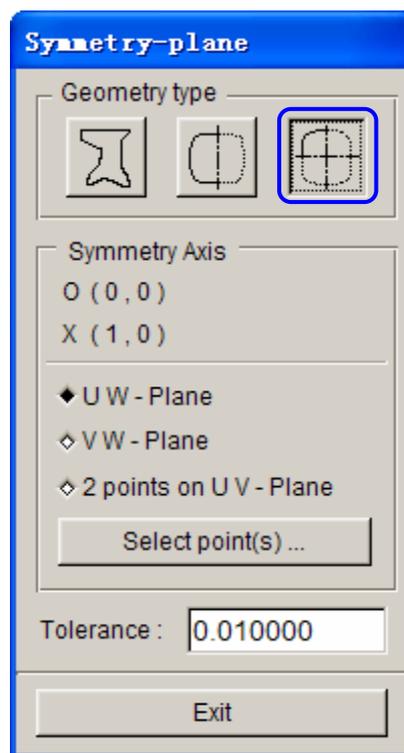


Figure 2.19 Symmetry-plane dialog box

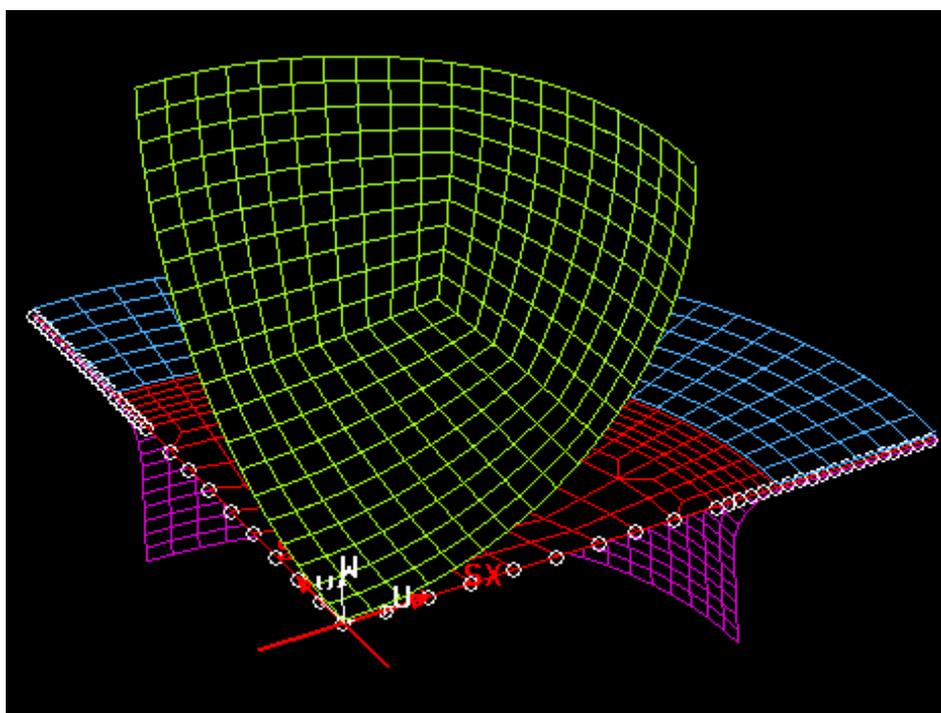


Figure 2.20 Illustration of boundary nodes for symmetry definition

VI. Tools Definition

1. Click on **Tools** tab to display tool definition interface.
2. Click  icon from the **Icon bar**, and turn off the BLANK part.
3. Click **OK** button to return tool definition interface. Based on the defined process, three standard tools: die, punch and binder, are listed at the left side of the tool definition interface. You can continue with definition of each tool. By default, the **die** interface is displayed.
4. In **punch** interface, press **Parts...** button to assign a part as punch. See Figure 2.21.

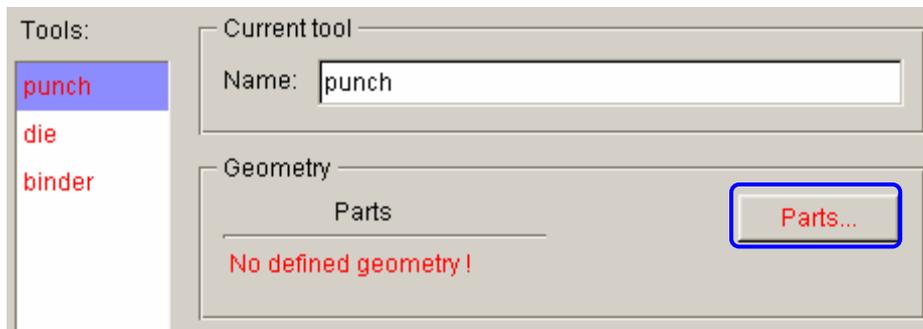


Figure 2.21 Punch definition

5. The DEFINE GEOMETRY dialog box illustrated in Figure 2.22 is displayed. Next, click the **Add Part...** button in the dialog box.

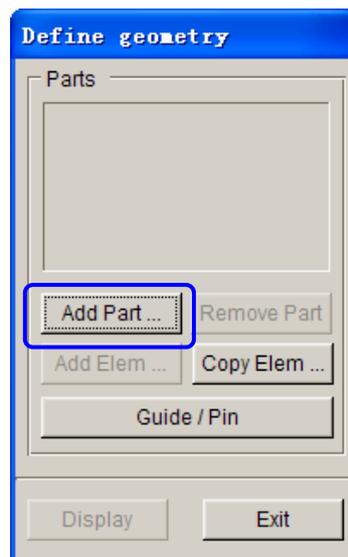


Figure 2.22 Define Geometry dialog box

6. Select **PUNCH** part from the SELECT PART dialog box illustrated in Figure 2.23.



Figure 2.23 Select part dialog box

7. Click **OK** button to return to the DEFINE GEOMETRY dialog box. **PUNCH** part is added to the list of punch. See Figure 2.24.

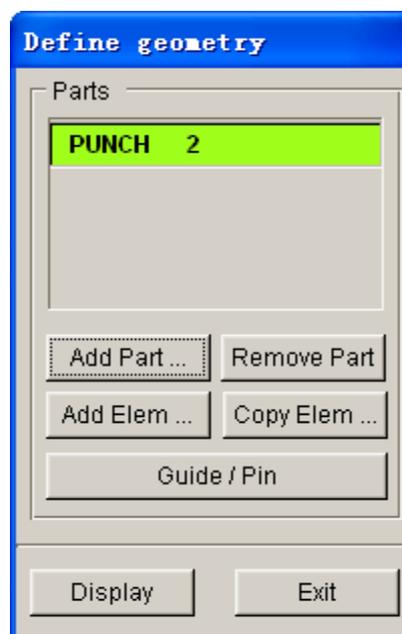


Figure 2.24 Punch geometry list

8. Click **Exit** button to return to tool definition interface. Now, you can observe the font color of **punch** is changed to BLACK. See Figure 2.25.

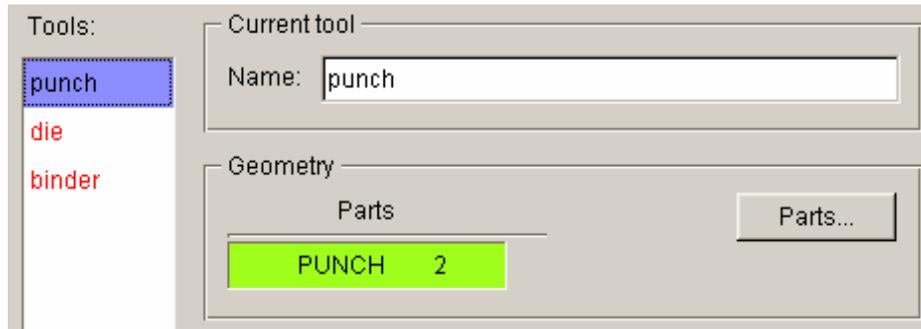


Figure 2.25 Punch definition interface

9. Select **die** located at the left side of tools list to display **die** definition interface.
10. Click **Parts...** button to display the DEFINE GEOMETRY dialog box illustrated in Figure 2.26.
11. Then, click **Add Part...** button from the dialog box.

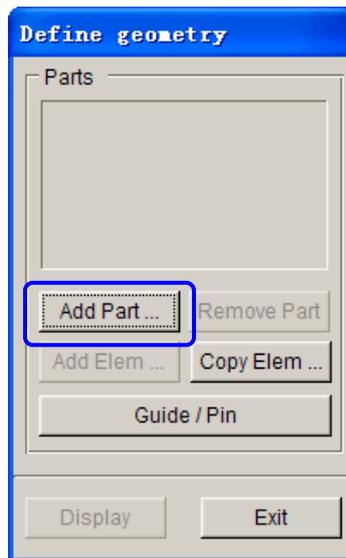


Figure 2.26 Define geometry dialog box

12. The program pops up the SELECT PART dialog box illustrated in Figure 2.27. From the list, use your mouse cursor to pick DIE part.



Figure 2.27 Select part dialog box

13. Click **OK** button to dismiss the SELECT PART dialog box. Now, the **DIE** part is added to the list of DEFINE GEOMETRY dialog box. See Figure 2.28.

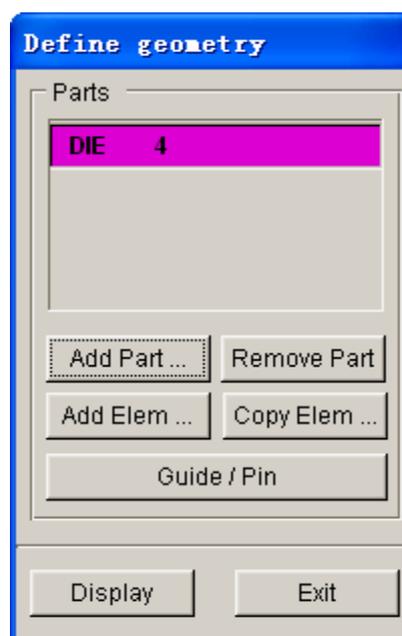


Figure 2.28 Die geometry list

14. Click **Exit** button to return to tool definition interface. Now, you can observe the font color of **die** is also changed to BLACK. See Figure 2.29.



Figure 2.29 Die definition interface

15. Click **binder** located at the left side of tool list to display binder definition interface.
16. Repeat steps 10-14 to assign the BINDER part as binder.
17. Now, you can observe the font color of **binder** is also changed to BLACK. All tools required for the stamping simulation are defined.

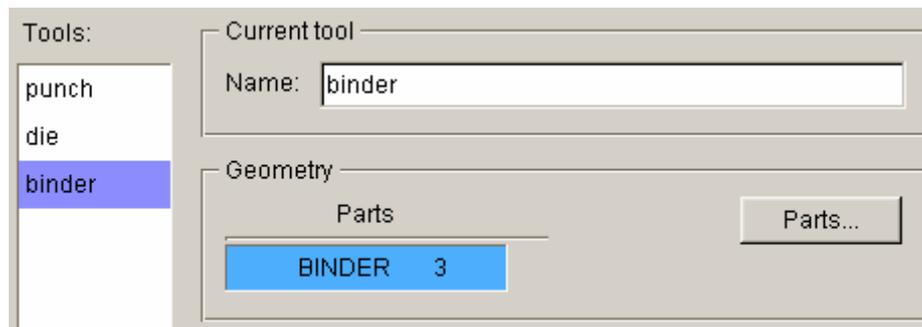


Figure 2.30 Binder definition interface

VII. Tools Positioning

After defining all tools, the user needs to position the relative position of tools for the stamping operation. The tool positioning operation must be carried out each time the user sets up a stamping simulation model. Otherwise, the user may not obtain correct stamping simulation setup.

The tool position is related to the working direction of each tool. Therefore, you need to carefully check the working direction prior to positioning the tools. If the process template is chosen, the default working direction is selected. You can also define special working direction.

1. Click the **Positioning...** button located at the lower right corner of tool definition interface to display the **POSITIONING** dialog box illustrated in Figure 2.31. Alternatively, you can select **Tools→Positioning...** from the menu bar.
2. Select **die** as fixed tool and use it as the referenced tool. The tool is stationary during automatic positioning.
3. Then, click the **Auto** button to position all tools and blanks. The result is illustrated in Figure 2.32.
4. Now, all tools and blank(s) are moved to a preset location. The movement of each tool is listed in the input data field of corresponding tool. The value is the measurement from the home/final position to the current position.

5. Click  and  on the **Icon bar**, and then the relative position of tools and blanks during die sinking will be displayed on the screen. See figure 2.33.
6. Click **OK** to save the current position of tools, and return to the main interface.

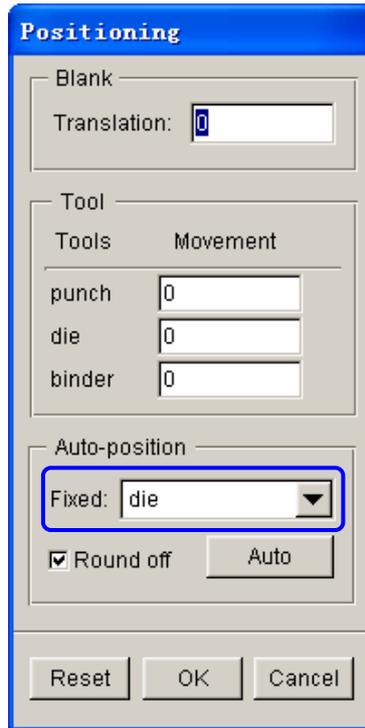


Figure 2.31 Before tools positioning

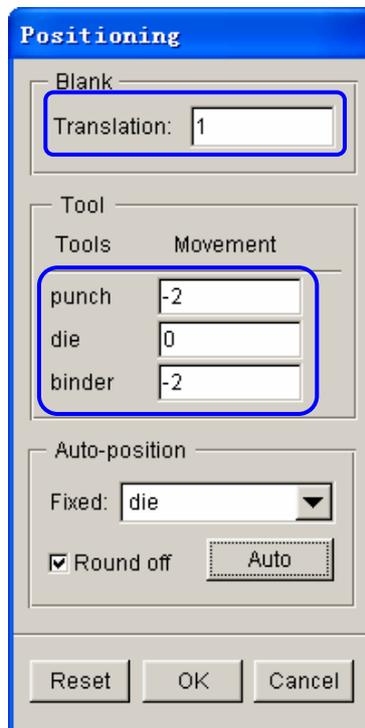


Figure 2.32 After tools auto positioning

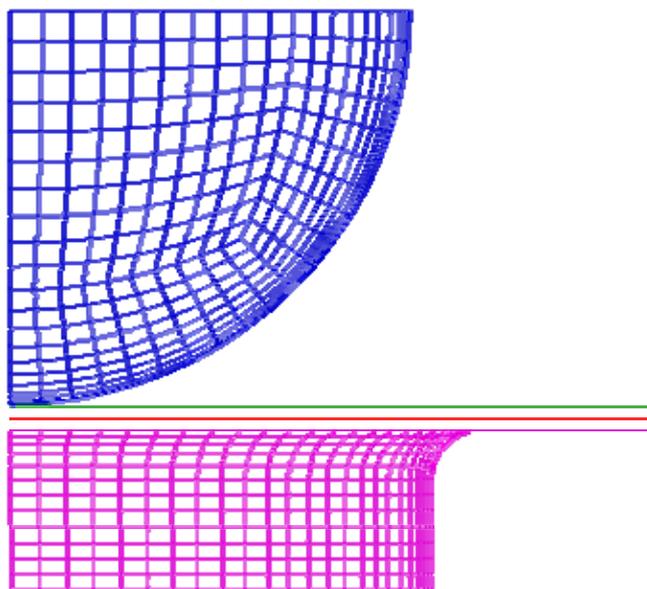


Figure 2.33 The relative position of tools and blank after positioning

Note: After autopositioning, the relative position of tools and blanks is displayed on the screen. However, you may select **Tools → Positioning...** from the Auto Setup menu bar, following by pressing the **Reset** button in the POSITIONING dialog box to set the tools and blank(s) back to its original position. Moreover, you can move the tools using the **Home...** function provided in the **Tools** menu.

Now, you can continue with the next process which is definition of process parameters. In Auto Setup application, the definition and positioning of blank(s) and tools and definition of process are not required in strict order. Therefore, you can randomly modify each operation. However, you are recommended to accordingly set up the blank(s) definition, tools definition and process parameters.

VIII. Process Definition

The Process definition is utilized to set up process parameters of the current simulation such as time required for every process, tooling speed, binder force and so on. The parameters listed in process definition interface depend on the pre-selected process template, including type of simulation and process.

In this example, the type of simulation and process is **Sheet Forming** and **Double Action**, respectively. Therefore, two default processes are listed in the process definition interface: closing and drawing process.

You can press **Process** tab of the main interface to enter process definition interface. Next, follow the steps listed below:

1. Select **closing** process from the list located at the left side of interface to be the current process. See Figure 2.34.
2. Verify the default setting of **closing** stage is similar to Figure 2.34.
3. Select **drawing** process from the list located at the left side of interface to be the current process. See Figure 2.35.
4. Verify the default setting of **closing** stage is similar to Figure 2.35.

***Note:** In this exercise, DUAL option is selected as Blank Reference Surface. Therefore, we should toggle off **Fully Match** option in Duration field to ensure the tool travel and process time is correctly calculated. When binder is closed, the default gap between binder and die is set as 1.1*blank thickness. We suggest the new user not to modify the default parameters in Control interface.*

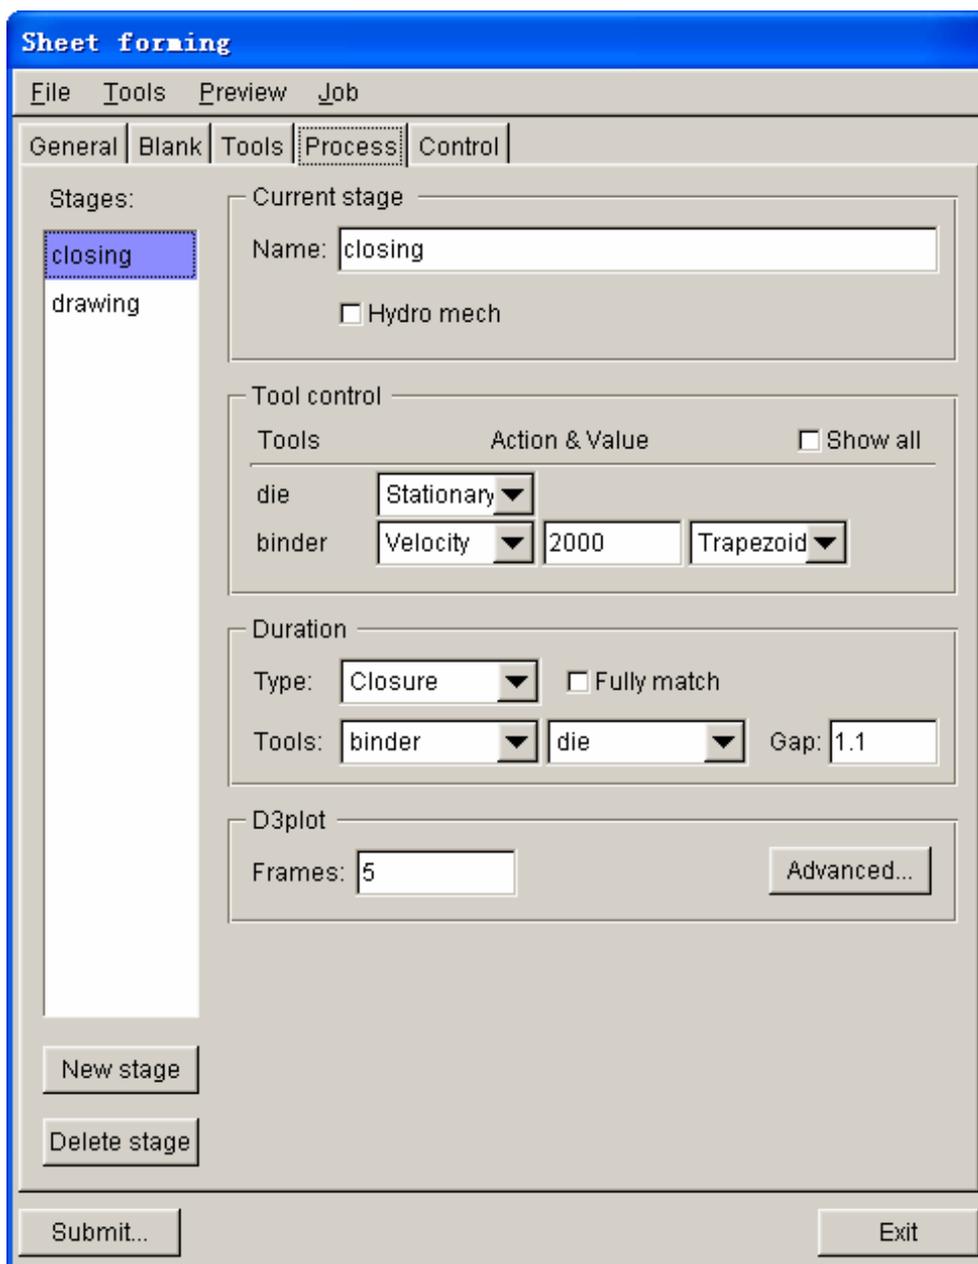


Figure 2.34 Closing definition interface

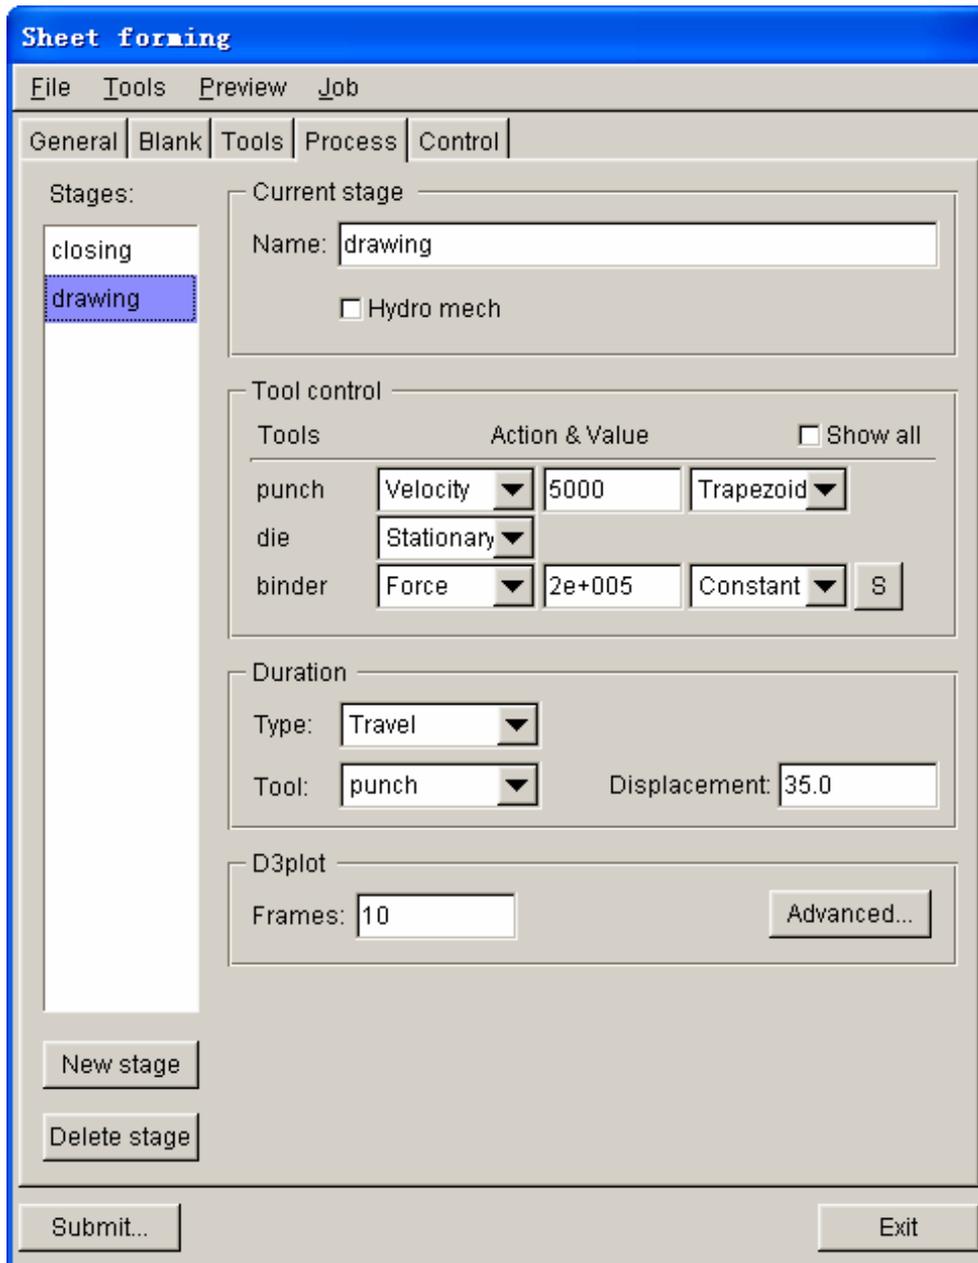


Figure 2.35 Drawing definition interface

IX. Animation

Prior to submitting a simulation job, you shall validate the process setting by viewing the animation of tool movement. The procedure to conduct animation is listed as the following:

1. Select **Preview→Animation...** in the menu bar. See Figure 2.36.

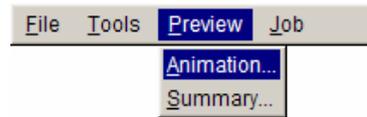


Figure 2.36 Animation menu

2. The animation of tool movement is shown on the display area.
3. You can select **INDIVIDUAL FRAMES** option from the ANIMATE dialog box illustrated in Figure 2.37 to display incremental tool movement.

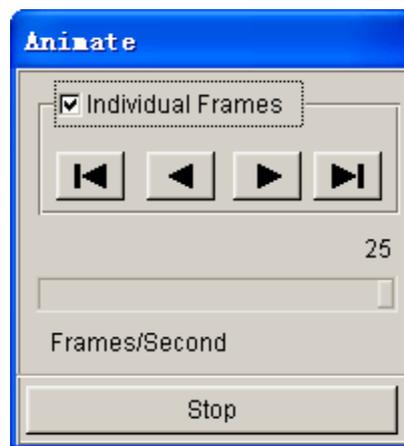


Figure 2.37 Animate control dialogue box

4. Click  icon to display the tool movement step by step.
5. The time step and displacement of tools are printed on the upper left hand corner of the display area. See Figure 2.38.
6. Click **Exit** button to return to the main interface.

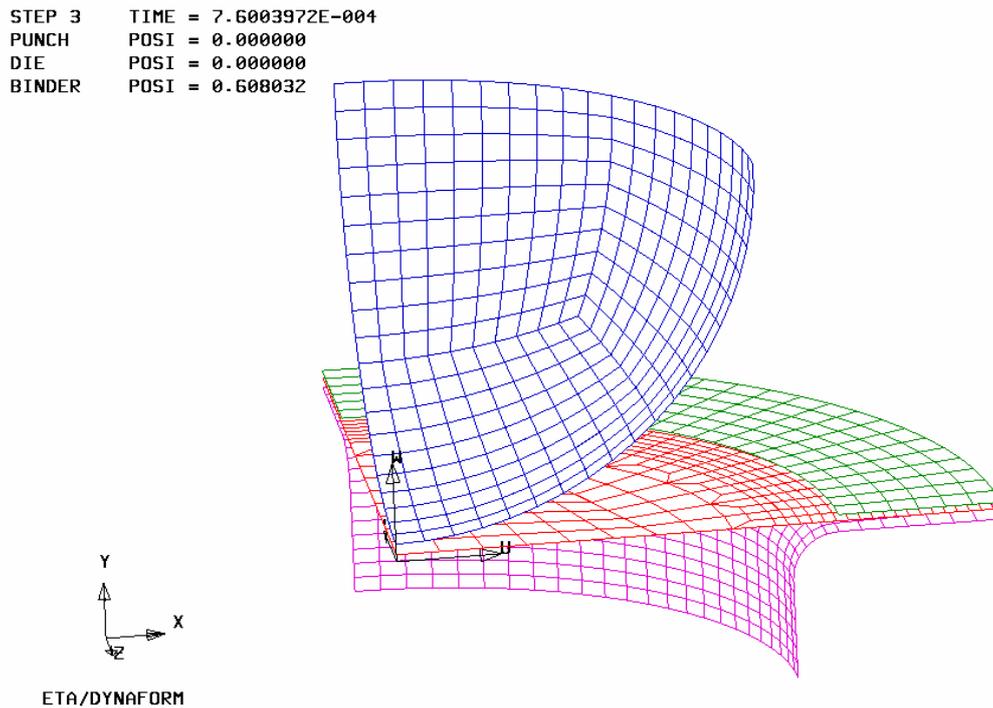


Figure 2.38 Animation of tool movement

X. Submit Job

After validating the tools movement, you may continue with submitting the stamping simulation through the steps listed below:

1. Select **Job**→**Full Run Dyna...** in the menu bar. See Figure 2.39.

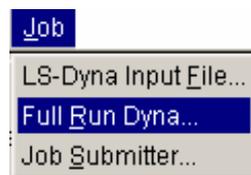


Figure 2.39 Job menu

2. The program pops up the SUBMIT JOB dialog box illustrated in Figure 2.40. You can select type of solver (either single or double precision), location of Dyna input file, specify job ID and memory allocation.

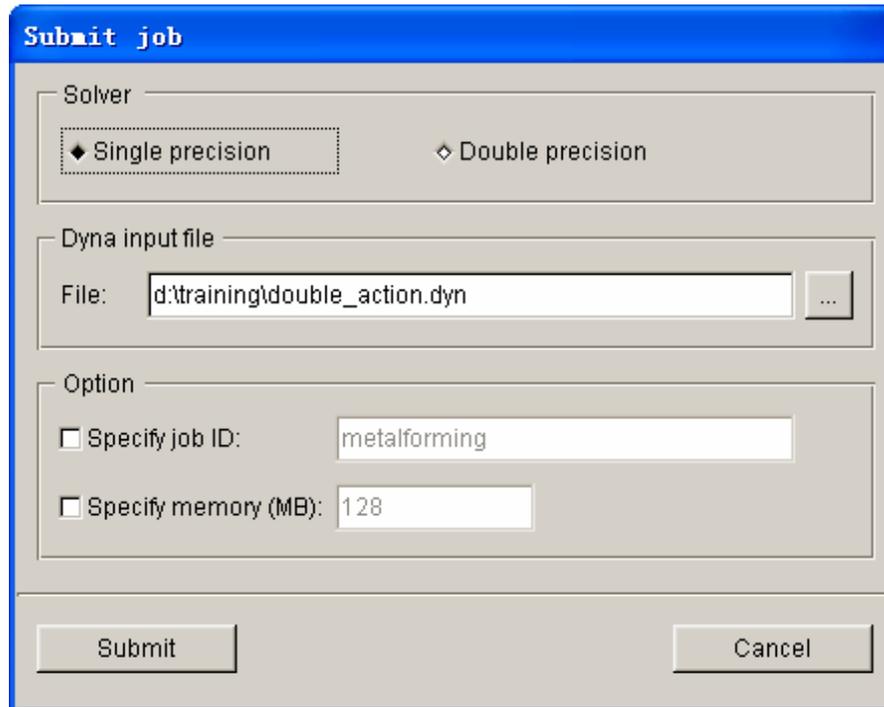


Figure 2.40 Submit job dialog box

3. Toggle on the checkbox of **Specify job ID** option and type in **metalforming**.
4. Click **Submit** button from the SUBMIT JOB dialog box to display LS-DYNA Solver window illustrated in Figure 2.41.

```

LS-DYNA - G:\Training\DF_TRA~1.DYM
total energy / initial energy.. 1.00000E+00
energy ratio w/o eroded energy. 1.00000E+00
global x velocity..... 0.00000E+00
global y velocity..... 0.00000E+00
global z velocity..... 0.00000E+00

number of shell elements that
reached the minimum time step.. 0
cpu time per zone cycle..... 0 nanoseconds
average cpu time per zone cycle... 0 nanoseconds
average clock time per zone cycle.. 401714 nanoseconds

estimated total cpu time      =      5 sec <      0 hrs  0 mins>
estimated cpu time to complete =      0 sec <      0 hrs  0 mins>
estimated total clock time    =    5863 sec <      1 hrs 37 mins>
estimated clock time to complete =    5858 sec <      1 hrs 37 mins>

added mass      =  0.0000E+00
percentage increase =  0.0000E+00

1 t 0.0000E+00 dt 1.32E-06 flush i/o buffers
1 t 0.0000E+00 dt 1.32E-06 write d3plot file
209 t 2.7588E-04 dt 1.32E-06 write adaptivity stress file
209 t 2.7588E-04 dt 1.32E-06 increase shells from 1750 to 2113

```

Figure 2.41 LS-DYNA solver window

When you submit a job from eta/DYNAFORM, an input deck is automatically created. The input deck is adopted by the solver, LS-DYNA, to process the stamping simulation. The default input deck names are **double_action.dyn** and **double_action.mod**. In addition, an index file named **double_action.idx** is generated for the reference in eta/POST. The **.dyn** file contains all of the keyword control cards, while the **.mod** file contains the geometry data and boundary conditions. Advanced users are encouraged to study the **.dyn** input file. For more information, refer to the *LS-DYNA User's Manual*.

Note: All files generated by either eta/DYNAFORM or LS-DYNA is stored in the directory in which the eta/DYNAFORM database has been saved. You shall ensure the folder doesn't include similar files prior to running the current job because these files will be overwritten.

POST PROCESSING (with eta/POST)

The eta/POST reads and processes all the available data in the **d3plot** and ASCII data files such as glstat, rforc, etc.. In addition to the undeformed model data, the **d3plot** file also contains all result data generated by LS-DYNA (stress, strain, time history data, deformation, etc.).

I. Reading the Results File into the Post Processor

To execute eta/POST, click **PostProcess** from **eta/DYNAFORM** menu bar illustrated in Figure 2.42. The default path for **eta/POST** is C:\Program Files\Dynaform 5.5. In this directory, you can double click on the executable file, **EtaPostProcessor.exe** to open eta/POST GUI illustrated in Figure 2.43. The **eta/POST** can also be accessed from the programs listing under the start menu of **DYNAFORM 5.5**.



Figure 2.42 Post process menu

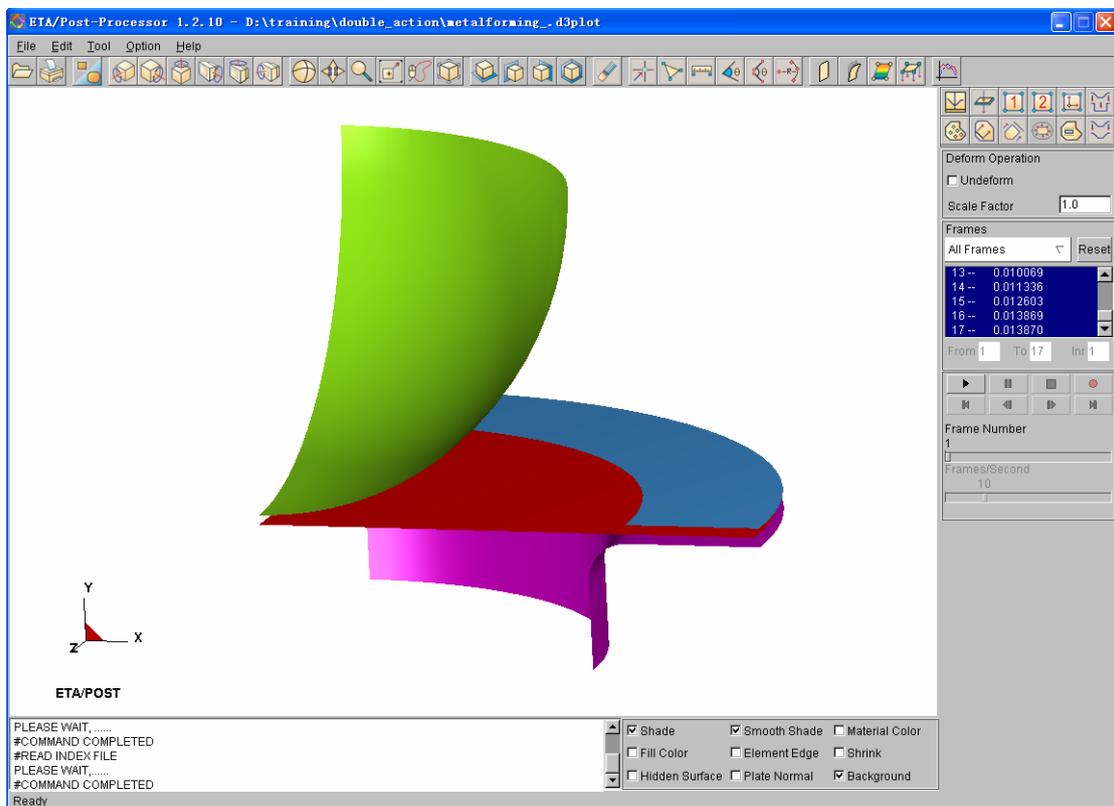


Figure 2.43 Post process GUI

1. From the **File** menu of **eta/POST**, select **Open** function. The Open File dialog box illustrated in Figure 2.44 is displayed.
2. The default **File Type** is **LS-DYNA Post (d3plot, d3drif, dynain)**. This option enables you to read in the **d3plot**, **d3drif** or **dynain** file. The **d3plot** is output from forming simulation, such as drawing, binder wrap and springback, while **d3drif** is generated during gravity loading simulation. The **dynain** is generated at the end of each simulation. This file contains the deformed blank information.

Note: Please refer to eta/POST User's Manual for description about other file types.

3. Choose the directory of the result files. Pick the **metalforming_.d3plot** file illustrated in Figure 2.44, and press **Open** button.
4. The d3plot file is now completely read in. You are ready to process the results using the Special icon bar, as shown Figure 2.45.

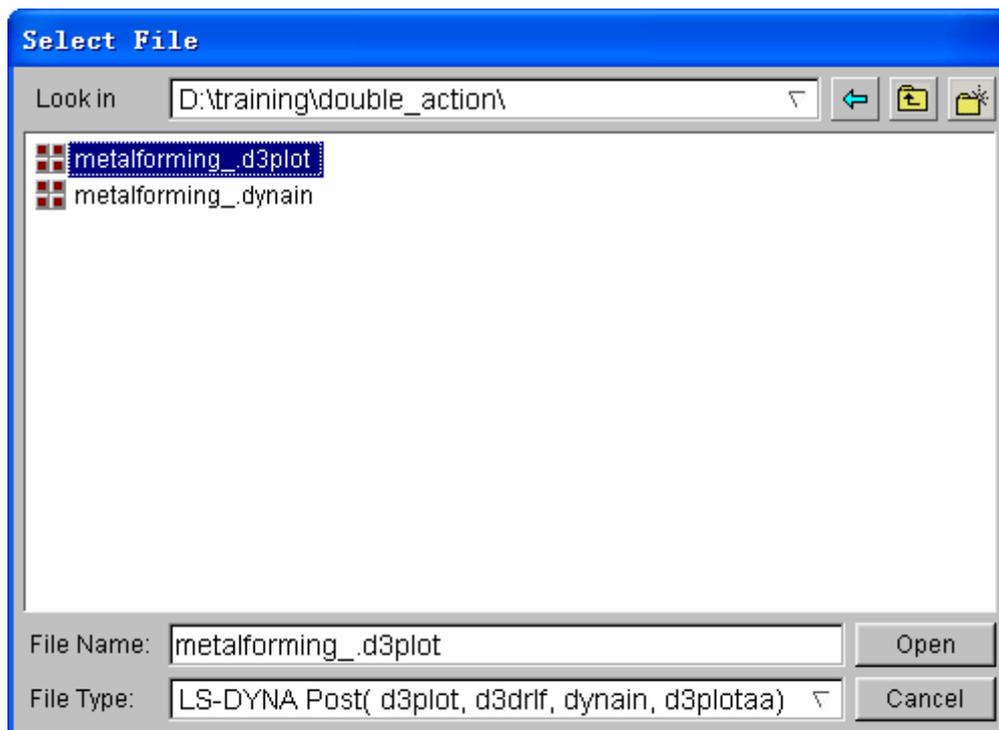


Figure 2.44 Open file dialog box



Figure 2.45 Special icon bar for forming analysis

II. Animating Deformation

1. The default **Plot State** is **Deformation**. In the **Frame** dialog, select **All Frames** and press **Play** button to animate the results. See Figure 2.46.

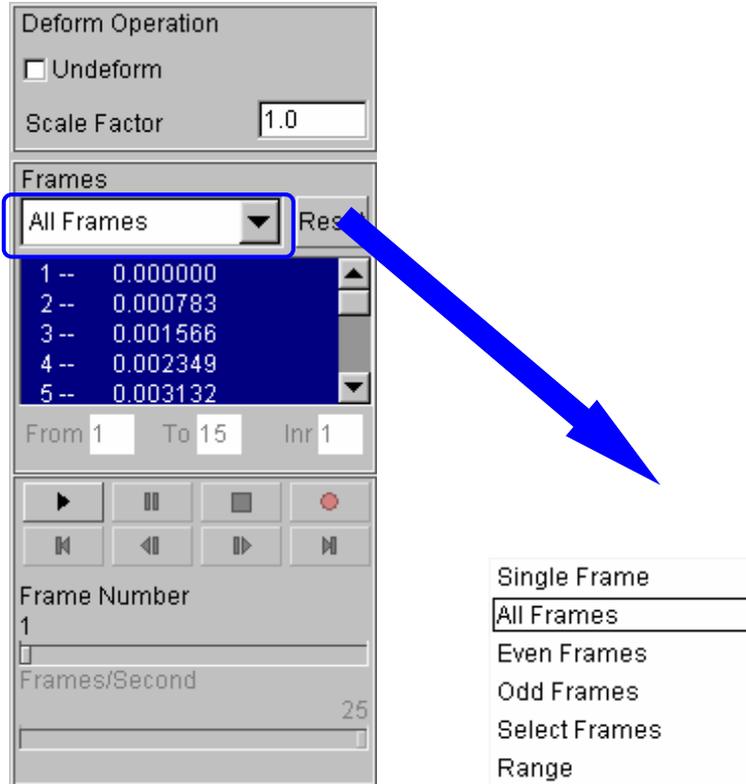


Figure 2.46 Animating deformation dialog box

2. Toggle on the **Shade** checkbox in the display options illustrated in Figure 2.47. The **Smooth Shade** option is also toggled on by default to enable smooth and continuous model display.

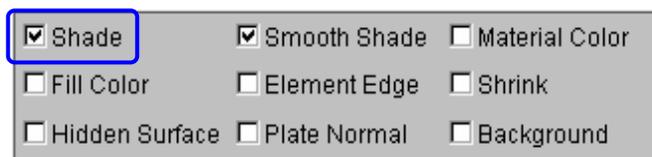


Figure 2.47 Display options

3. Since it is difficult to see the Blank with all of the other tools displayed, you can hide all of the tools by pressing the  icon from **Icon bar**.
4. In Part Operation dialog, use your mouse cursor to click on all the parts, excluding BLANK, as illustrated in Figure 2.48. All the tools are hidden from the display area. Then, press **Exit** button to dismiss the dialog box.

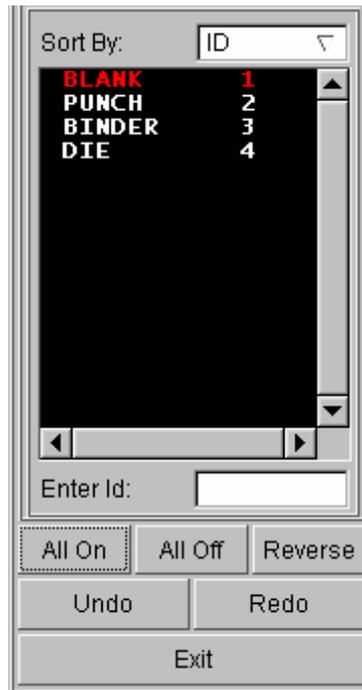


Figure 2.48 Turn parts on/off dialog box

5. You can also change the displayed model using the view manipulation icons on the **Icon bar** illustrated in Figure 2.49.



Figure 2.49 Icon bar

III. Animating Deformation, Thickness and FLD

In eta/POST, you can animate deformation, thickness, FLD and various strain/stress distribution of the blank. Refer to the following examples for animation.

Thickness/Thinning

1. Select  icon from the Special icon bar.
2. Select **Current Component** from combo box, either THICKNESS or THINNING. The thickness contour of deformed dome is illustrated in Figure 2.50.
3. Click **Play** button to animate the thickness contour.
4. Use your mouse cursor to move the slider to set the desired frame speed.
5. Click **Stop** button to stop the animation.

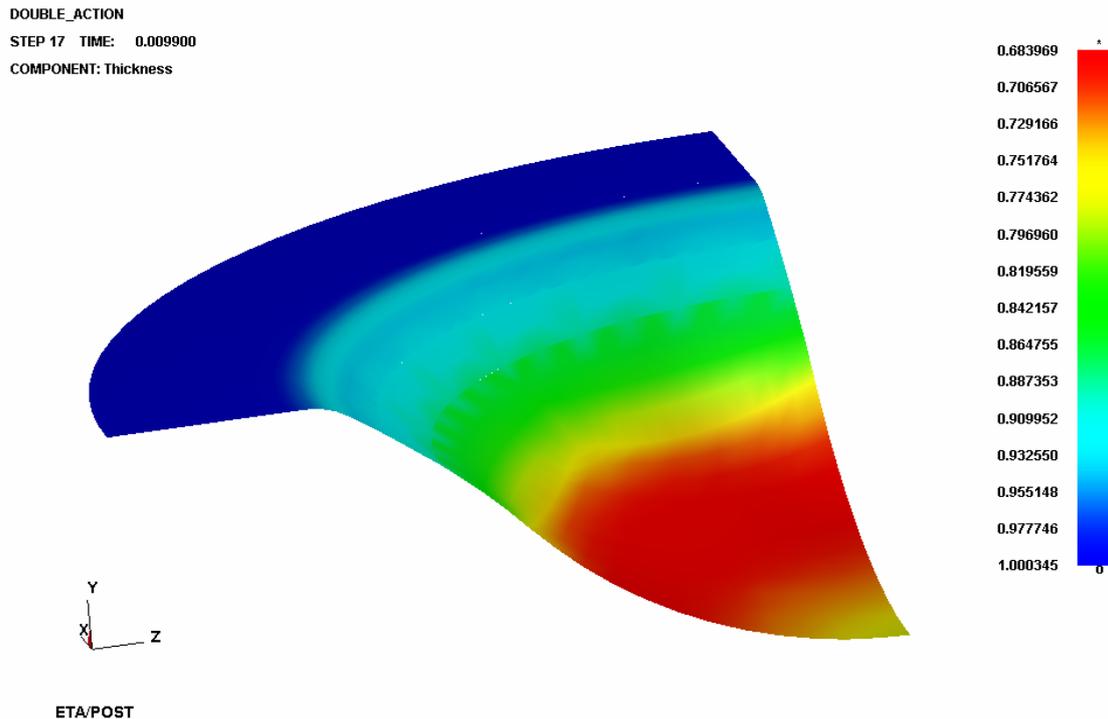


Figure 2.50 Thickness/Thinning contour

FLD

1. Pick  from the Special icon bar.
2. Select **Middle** from the **Current Component** list, as illustrated in Figure 2.51. The FLD contour of deformed dome is illustrated in Figure 2.52.
3. Set FLD parameters (n, t, r, etc.) by clicking on the **FLD Curve Option** button to display the FLD CURVE AND OPTION dialog box.
4. Click **OK** button to dismiss the FLD CURVE AND OPTION dialog box.
5. Select **Edit FLD Window** function to define location of FLD plot on the display window.
6. Click **Play** button to animate the FLD contour of deformed dome.
7. Click **Stop** button.

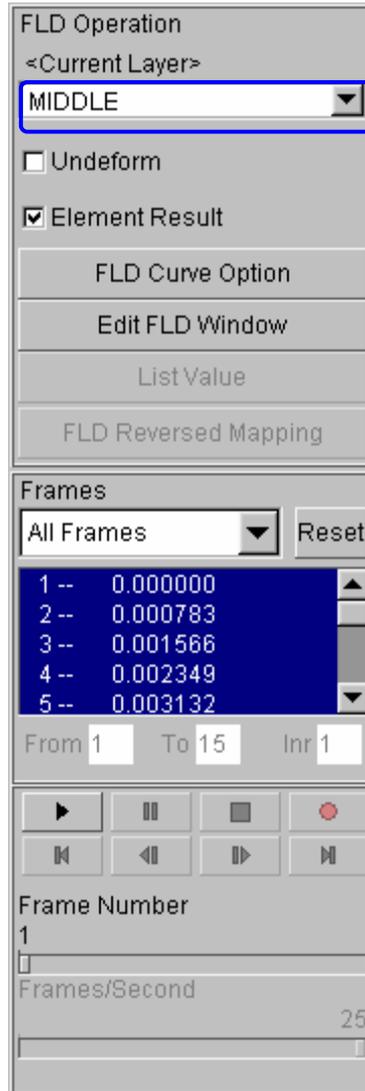


Figure 2.51 FLD display dialog box

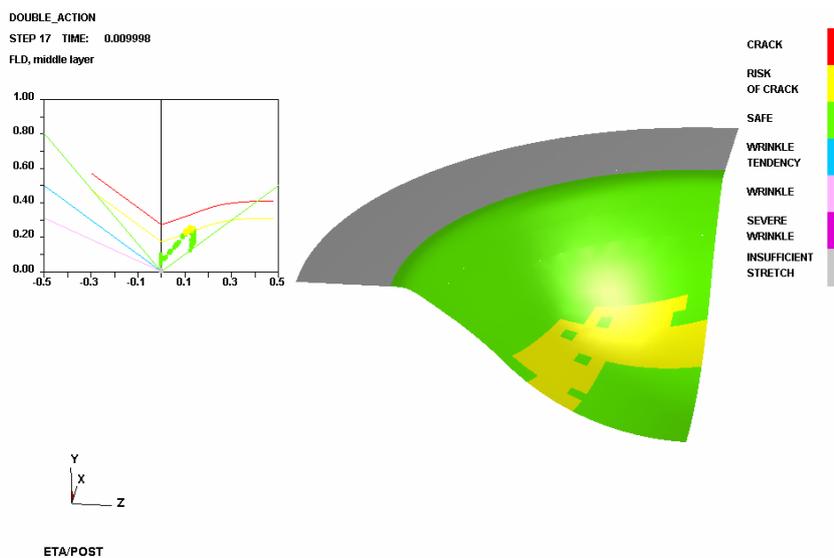


Figure 2.52 FLD contour

IV. Plotting Single Frames

Sometimes, it is much convenient to analyze the result by viewing single frames rather than the animation. To view single frame, select **Single Frame** option from the **Frames** combo box illustrated in Figure 2.53. Then, use your mouse cursor to select the desired frame from the frame list. You can also drag the slider of frame number to select the frame accordingly.

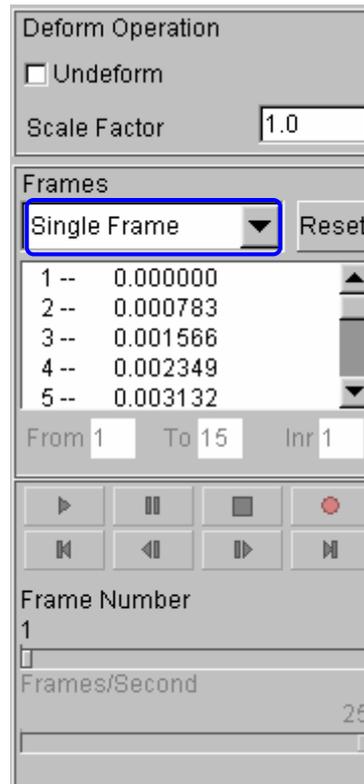


Figure 2.53 Display of single frame

V. Writing an AVI and E3D File

eta/POST provides a very useful tool that allows you to automatically create an **AVI** movie and/or **E3D** files via an animation of screen capture. The **Record** button illustrated in Figure 2.54 is commonly utilized to generate AVI movie and/or E3D files. This is the last function covered in this application example.

AVI movie

The following procedure is used to generate an AVI movie file.

1. Start a new animation using the procedure provided in Section III.
2. Display the model in isometric view.
3. Click the **Record** button.

4. The **Select File** dialog is displayed.
5. Enter a name of the **AVI** move file (e.g. traincase.avi) at the input data field of File Name illustrated in Figure 2.55
6. Then, click **Save** button.
7. From the dialog box illustrated in Figure 2.56, select **Microsoft Video 1** from the **Compressor** list and click **Ok** button.
8. eta/POST will take a screen capture of the animation and write the output.

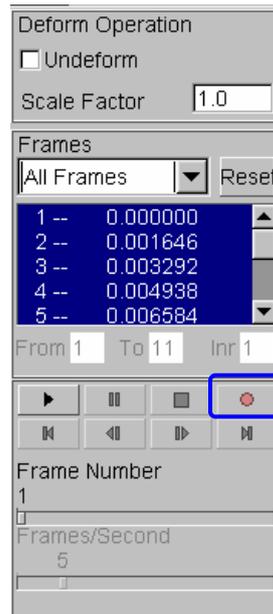


Figure 2.54 AVI dialog box

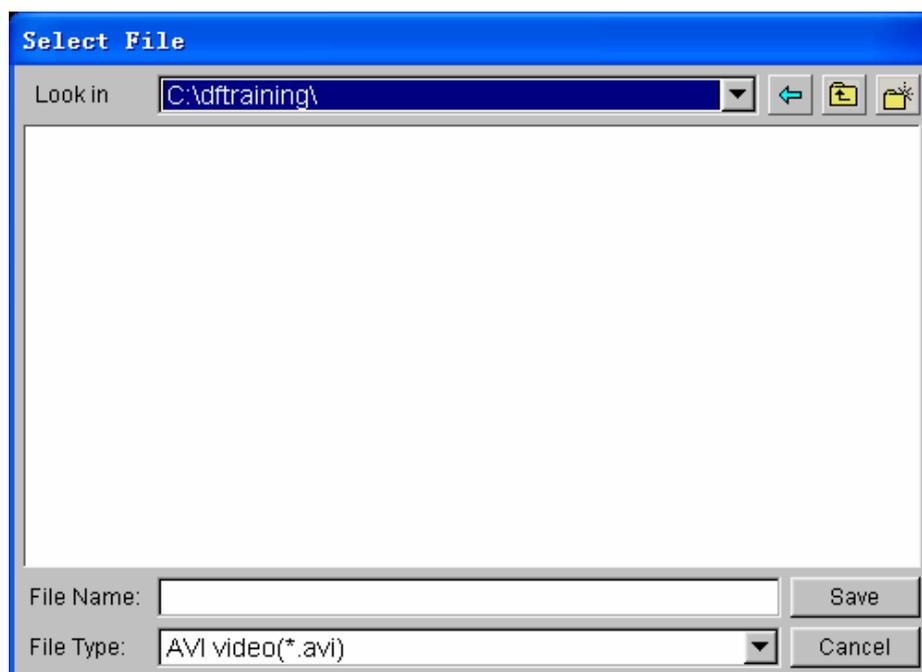


Figure 2.55 Save AVI file

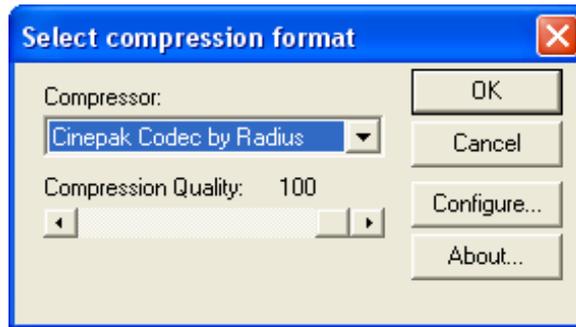


Figure 2.56 Select compression format

E3D file


You can also save simulation results in a much compact file format (*.e3d). The *.e3d file can be viewed using **eta/3DPlayer** which is provided as a free software to any users.

To create an E3D file, refer to the steps listed below:

1. Start a new animation (thickness, FLD, etc) using the procedure provided in Section III.
2. Display the model in isometric view.
3. Click the **Record** button.
4. The **Select File** dialog box is displayed.
5. Click the drop-down button of File Type to select **E3D Player file (*.e3d)**.
6. Enter a name of the **E3D** file (e.g. traincase.e3d) at the input data field of File Name.
7. Then, click **Save** button.
8. eta/POST will take a screen capture of the animation and write the output into *.e3d format.

You can view 3D simulation results using the player. To start the player, select Start→All Programs→Dynaform 5.5→Eta3DPlayer.

Example 3. Tubular Hydro-forming

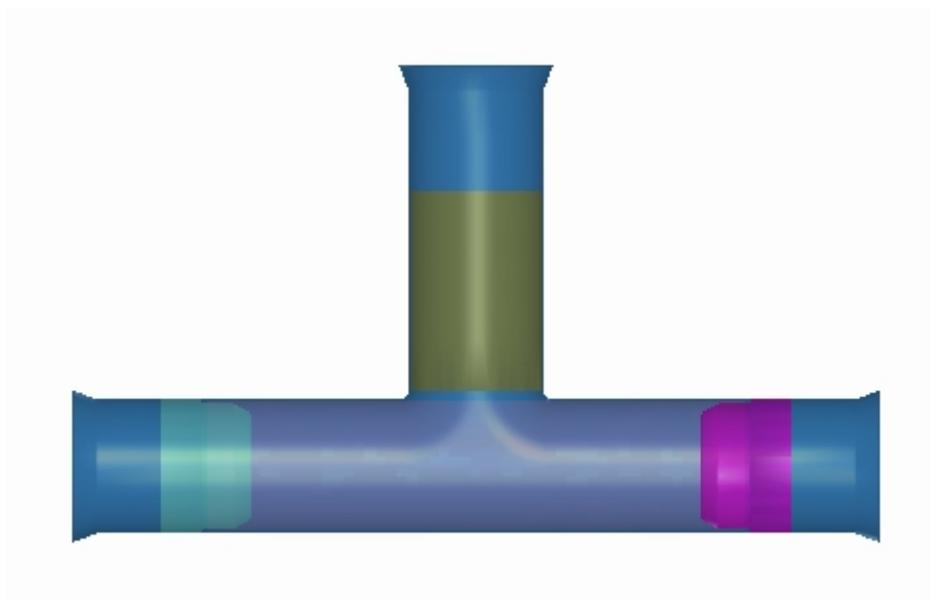

DATABASE MANIPULATION

Creating an eta/DYNAFORM Database and Analysis Setup

Start eta/DYNAFORM 5.5

For workstation/Linux users, enter the command “**df55**” (default) from a UNIX shell.

For PC users, double click the **eta/DYNAFORM 5.5 (DF55)** icon from the desktop.

After starting **eta/DYNAFORM**, a default database **Untitled.df** is created. You begin by importing FEA data files to the current database.

Import file

From the menu bar, select **File→Import** to open the IMPORT FILE dialog box illustrated in Figure 3.1.



Figure 3.1 Import file dialog box

Go to the training input files located in the CD provided along with the eta/DYNAFORM installation. Then, change the file format to “**NASTRAN** (*.dat;*.nas)”. Select **tube** file, and click **OK** button to import the file. Now, the model illustrated in Figure 3.2 is displayed on the display area.

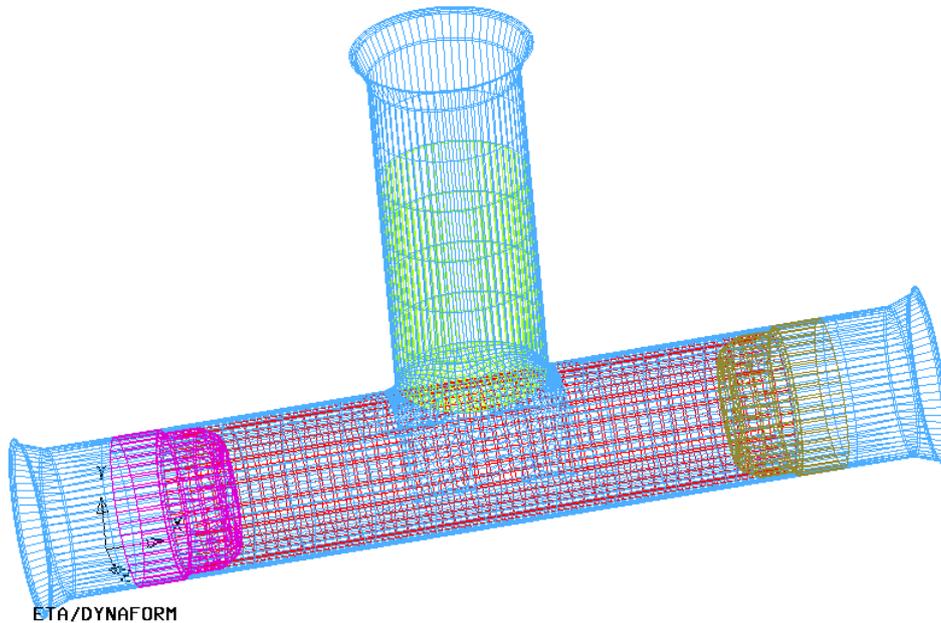


Figure 3.2 Imported model

Save the database

1. Click **Save** icon from the **Icon bar** to pop up SAVE AS dialog box illustrated in Figure 3.3.
2. Next, type in **Tubular_hydroforming** in the input data field of File Name, following by clicking **Save** button to save the database.

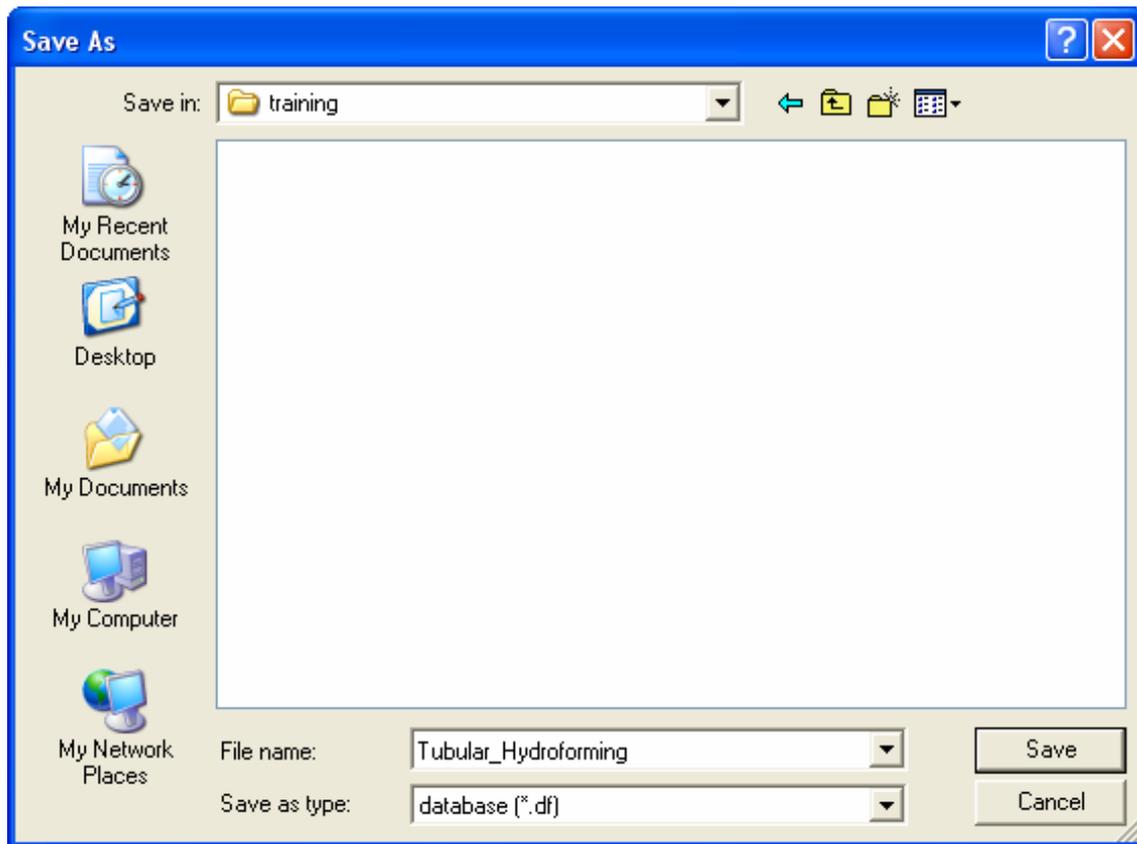


Figure 3.3 Save as dialog box

Database Unit

From the menu bar, select **Tools**→**Analysis Setup**. The default unit system for a new eta/DYNAFORM database is **mm, Newton, second, and Ton**.

AUTO SETUP

After saving the database, let's continue with setting up the model in **AUTOSETUP**. Select **AUTOSETUP** option from the **SETUP** menu illustrated in Figure 3.4.

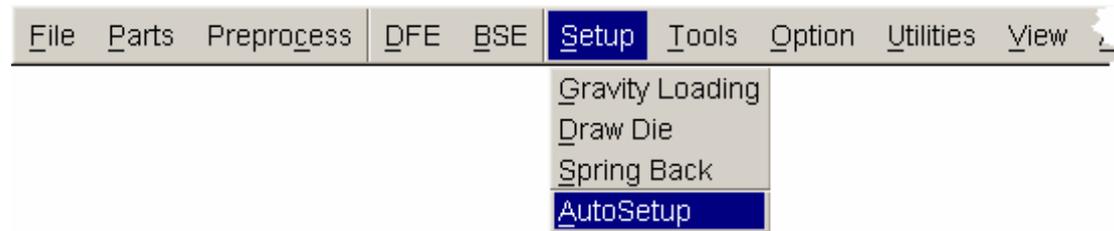


Figure 3.4 Setup menu

I. New Simulation

Click **AutoSetup** in the menu bar to display the **NEW SIMULATION** dialog box illustrated in Figure 3.5. You continue with defining basic parameters.

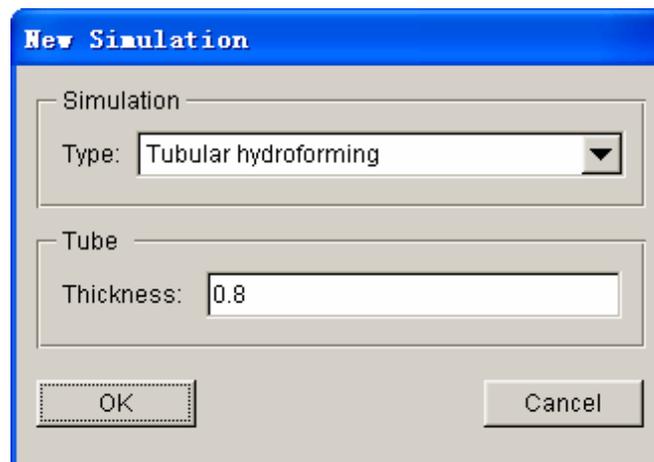


Figure 3.5 New simulation dialog box

1. Select simulation type: **Tubular hydroforming**.
2. Input tube thickness: 0.8 (mm).
3. Click **OK** button to display the main **AUTOSETUP** dialog box.

II. General

After entering **General** interface, you do not need to modify any parameters, except for changing the **Title** into **Tubular hydroforming**. You can select Global Coordinate System as the working coordinate. For information about other default parameters, refer to the **eta/DYNAFORM User's Manual**.

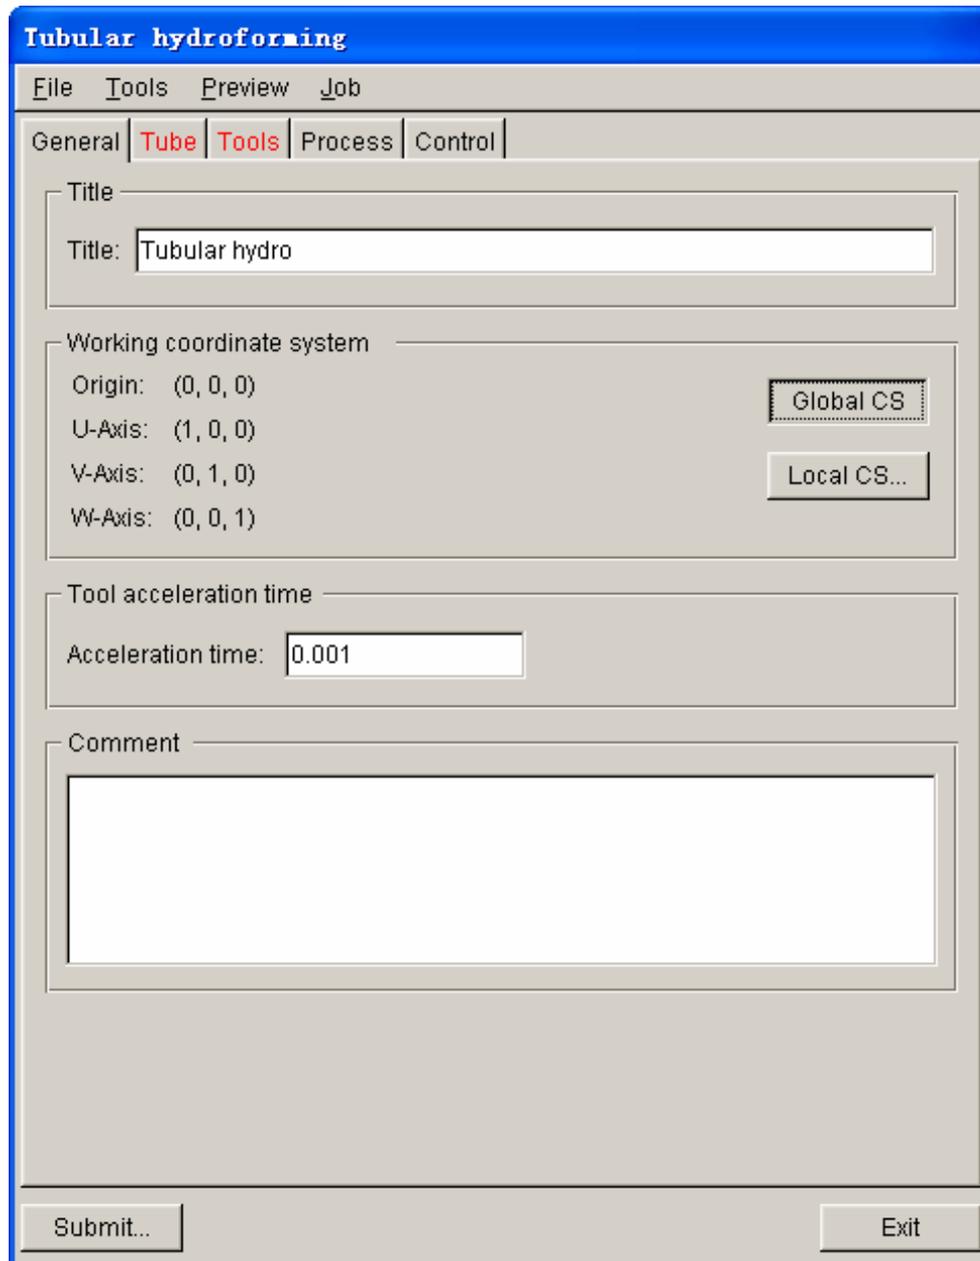


Figure 3.6 General interface

III. Tube Definition

1. Use your mouse cursor to click on **Tube** tab to display tube definition interface.

2. Then click **Parts...** button from **Geometry** field in the tube definition interface, as illustrated in Figure 3.7.

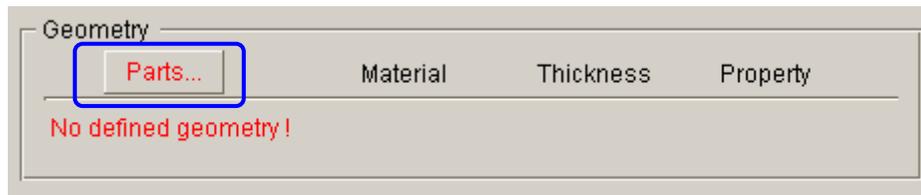


Figure 3.7 Define tube

3. The DEFINE GEOMETRY dialog box illustrated in Figure 3.8 is displayed.

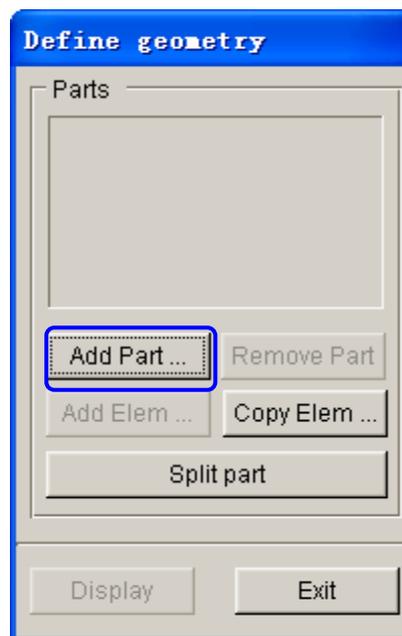


Figure 3.8 Define geometry dialog box

4. Click **Add Part...** button. Use your mouse cursor to select **TUBE** part from the **SELECT PART** dialog box illustrated in Figure 3.9.

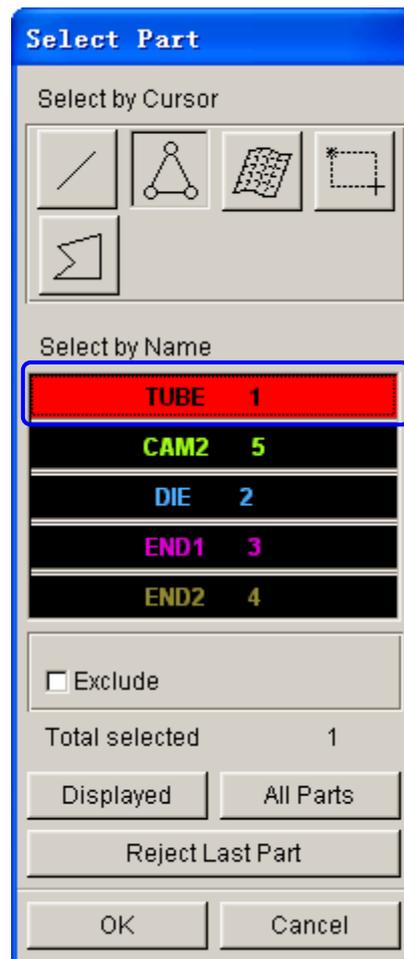


Figure 3.9 Select part dialog box

5. After selecting the part, click on **OK** button to return to DEFINE GEOMETRY dialog box. The **TUBE** part is added to the list. See Figure3.10.

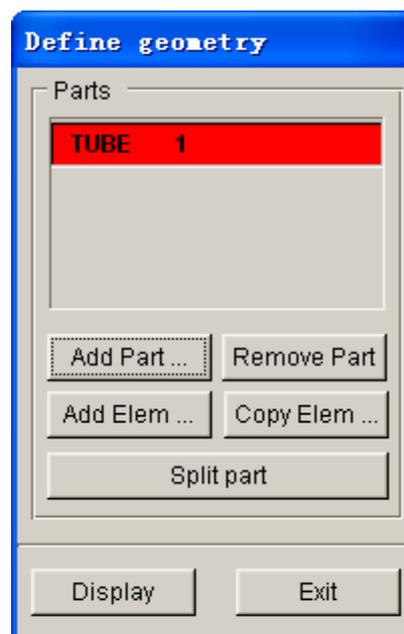


Figure 3.10 Tube geometry list

6. Click the **Exit** button to return the tube definition interface. Now, the color of Blank tab is changed to from RED to BLACK. See Figure 3.11.

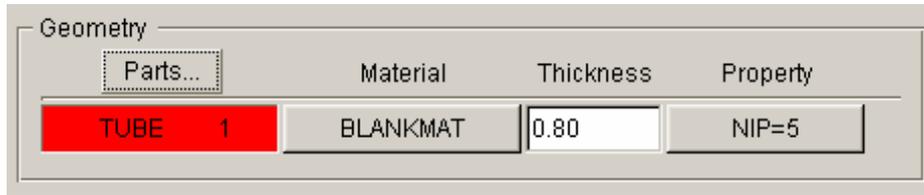


Figure 3.11 Tube definition

As illustrated in the above figure, the default material and property are assigned to the tube. Click the **BLANKMAT** button to open the **MATERIAL** dialog box illustrated in Figure 3.12.

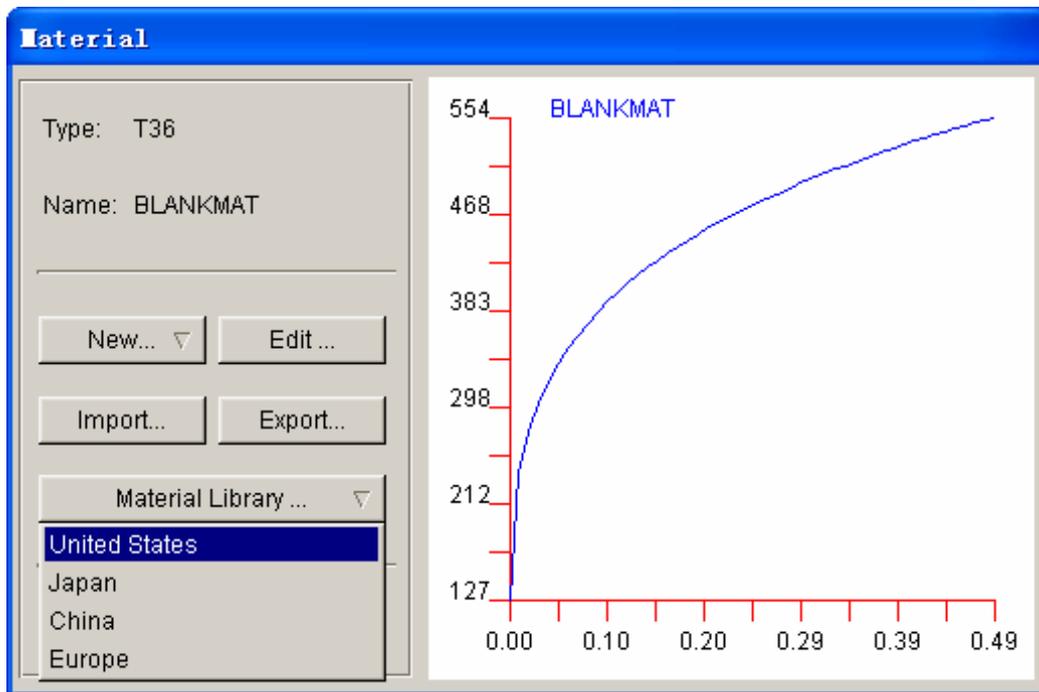


Figure 3.12 Material dialog box

In this exercise, the hot rolled DQ mild steel from United States material library is chosen. Click on the **Material Library** button, following by selecting **United States** to display the window shown in Figure 3.13. From the Material Library window illustrated in Figure 3.13, select **DQSK** from the Hot Rolled Steel category.

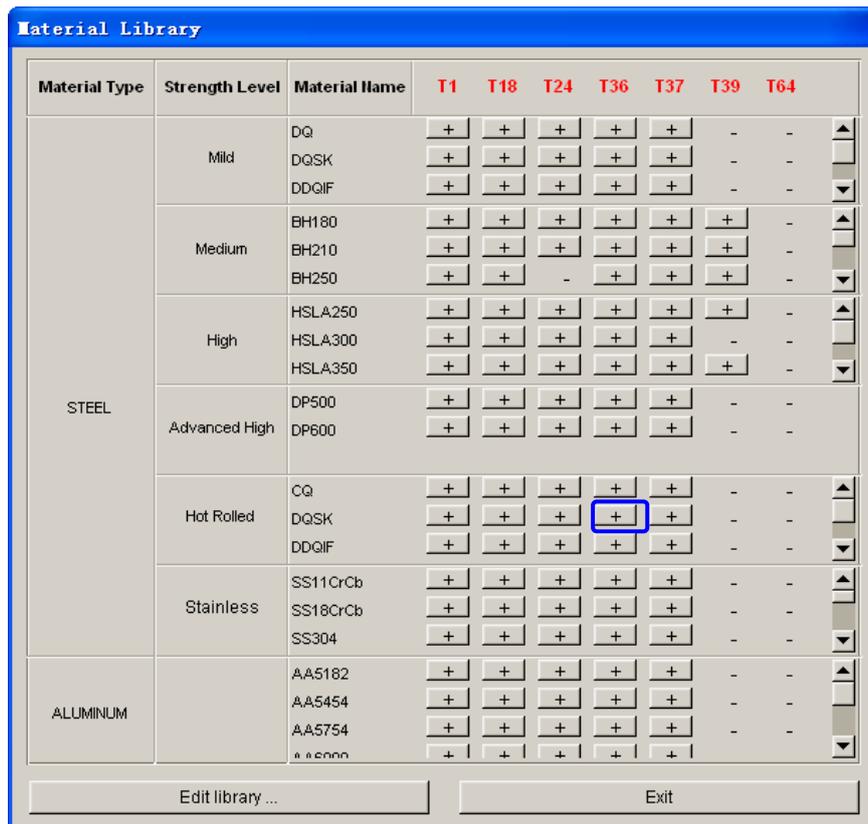


Figure 3.13 Material library window

IV. Tools Definition

1. Click on **Tools** tab to display tool definition interface.
2. Click  icon from the **Icon bar**, and turn off the TUBE part.
3. Click **OK** button to return to tool definition interface. Based on the chosen template, two standard tools are defined: up_die and lo_die, located at the left side of tool definition interface. You can continue with definition of each tool. By default, the **up_die** interface is displayed, as illustrated in Figure 3.14.
4. Press the **Parts...** button to assign a part as up_die.

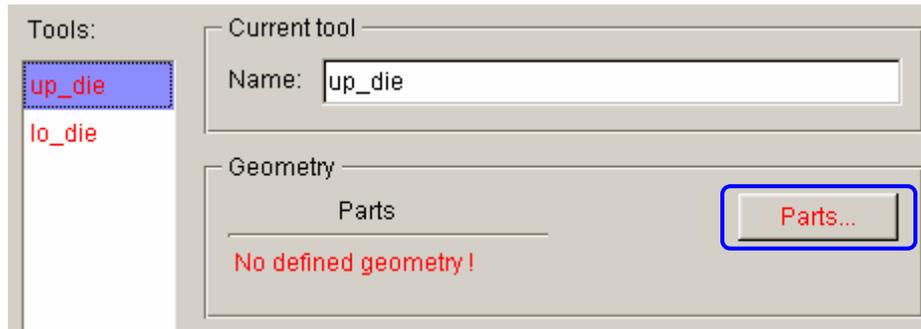


Figure 3.14 Tool definition interface

5. The DEFINE GEOMETRY dialog box illustrated in Figure 3.15 is displayed. Next, click the **Add Part...** button in the dialog box.

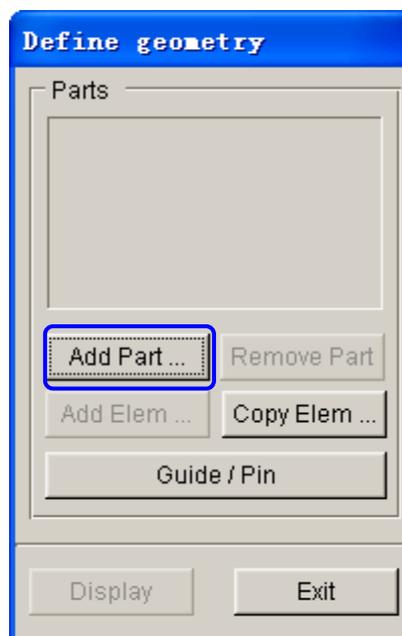


Figure 3.15 Define geometry dialog box

6. Select **CAM2** part from the SELECT PART dialog box illustrated in Figure 3.16.
7. Click **OK** button to return to the DEFINE GEOMETRY dialog box. The **CAM2** part is added to the list of up_die. See Figure 3.17.

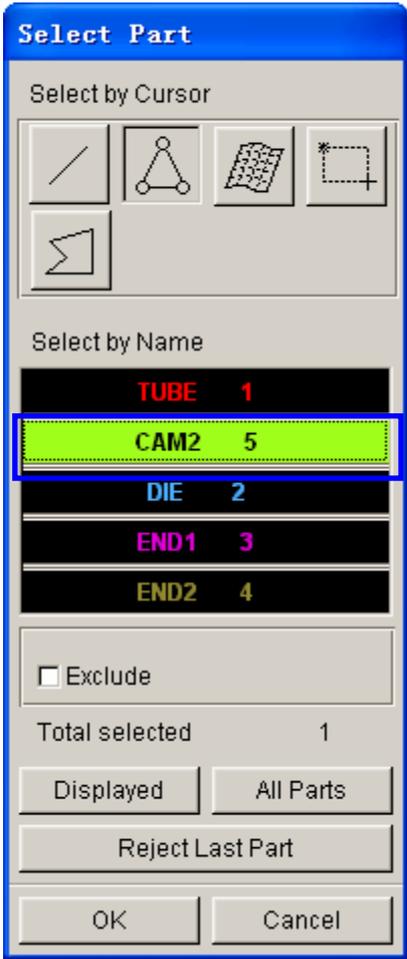


Figure 3.16 Select part dialog box

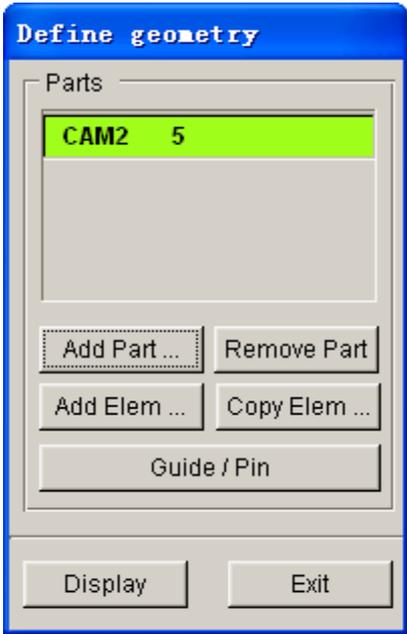


Figure 3.17 Tube geometry list

8. Click **Exit** button to return to tool definition interface. Now, you can observe the font color of **up_die** is changed to BLACK. See Figure 3.18.

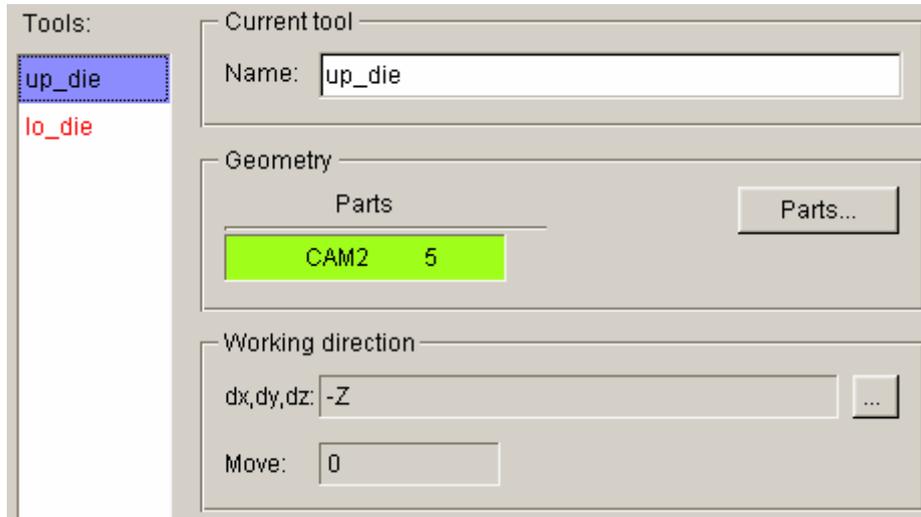


Figure 3.18 up_die definition interface

9. Now, let's define the working direction of up_die. Click **...** button of working direction field to open the DIRECTION dialog box illustrated in Figure 3.19.

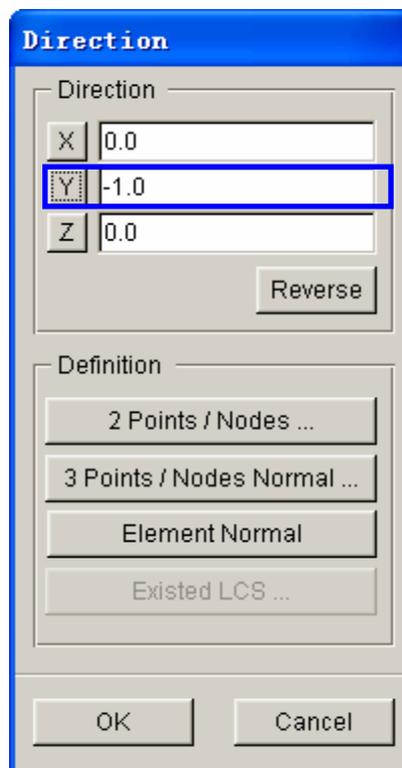


Figure 3.19 Direction dialog box

10. Click on **Y** button **twice** to set the vector of working direction as **-1**. Then,

click **OK** button to dismiss the dialog box.

- Define contact parameters. Use the default value illustrated in Figure 3.20.

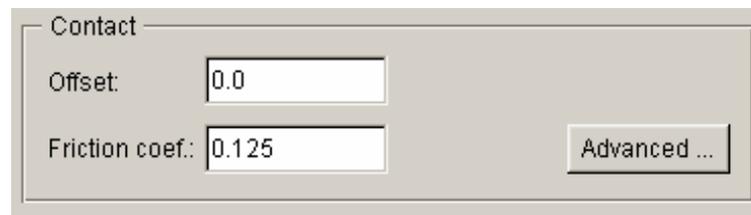


Figure 3.20 Default setting of contact parameters

- Click **lo_die** located at the left side of tools list to display lo_die definition interface.
- Click **Parts...** button to display the DEFINE GEOMETRY dialog box. Follow steps 5-7 to assign **DIE** part in the SELECT PART dialog box as lo_die.
- Click **Exit** button to return to tool definition interface. Now, you can observe the font color of **lo_die** is changed to BLACK. See Figure 3.21.
- Click **...** button of working direction field to open the DIRECTION dialog box. Then, click on **Y** button to set the vector of working direction as **+1**.

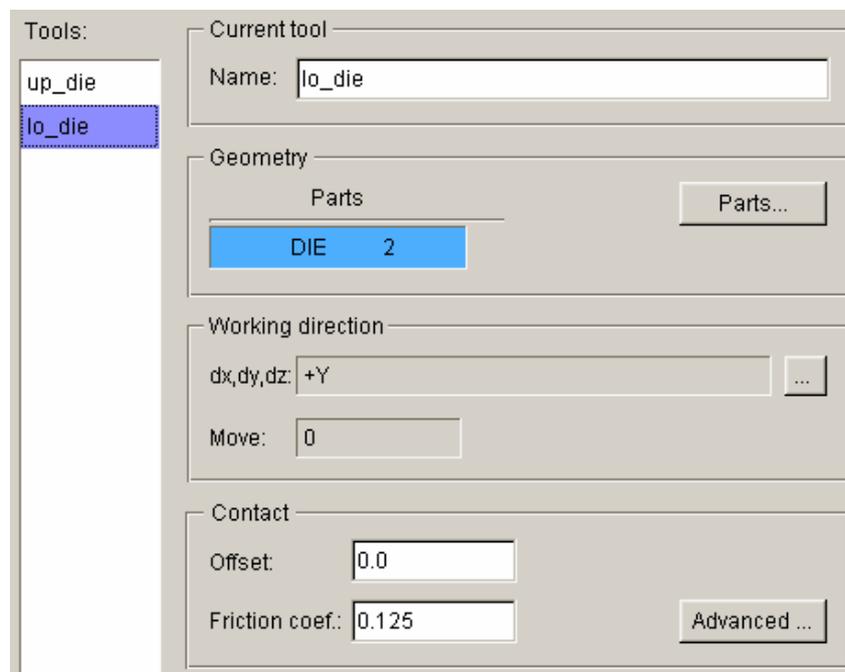


Figure 3.21 lo_die definition interface

16. Click **OK** button to dismiss the DIRECTION dialog box.
17. Click **New tool** button in the tool definition interface to display the New Tool interface illustrated in Figure 3.22. At the input data field of Name, type in **dock1**. Then, select **Use default setting** and toggle on **Side/Axial** option.

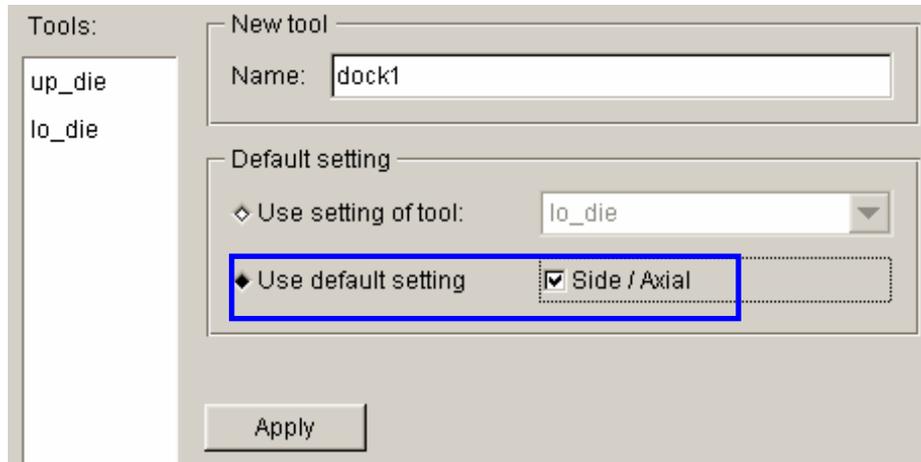


Figure 3.22 Create dock1

18. Click **Apply** button to create a new tool named **dock1**.
19. Now, you can observe the font color of **dock1** is red, as illustrated in Figure 3.23. It means the tool geometry and its associated parameters are not defined.

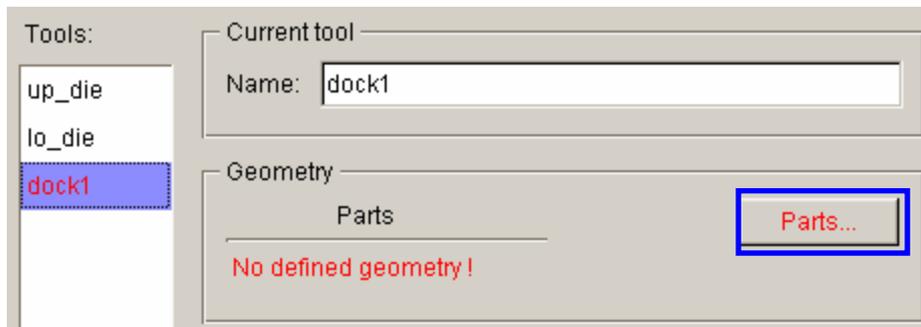


Figure 3.23 block1 definition interface

20. Repeat steps 5-7 to assign **END1** in SELECT PART dialog box as **dock1**.
21. Click **Exit** button to return to tool definition interface. Now, you can observe the font color of **dock1** is changed to BLACK. See Figure 3.24.
22. Next, let's modify the default working direction of **dock1** to **+X**. Click  button to display the DIRECTION dialog box. Click on **X** button to set the vector of working direction as **+1**, as illustrated in Figure 3.25.

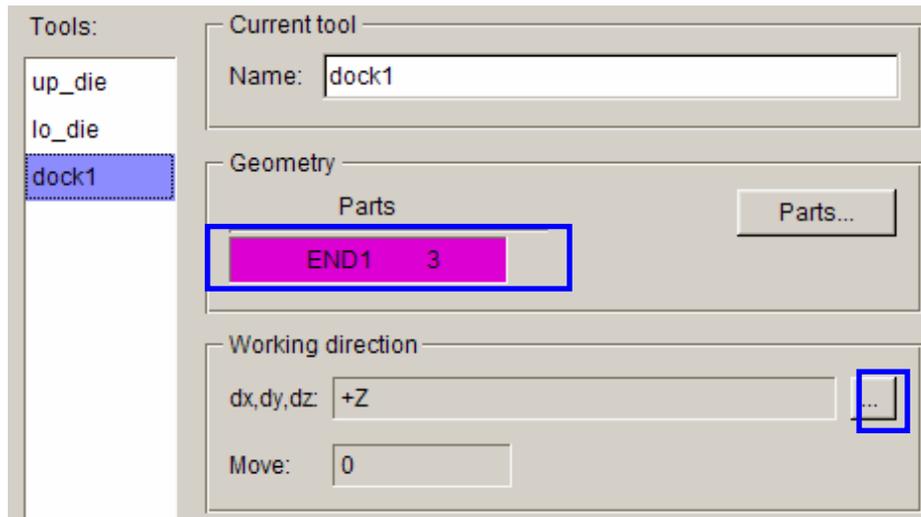


Figure 3.24 Define dock1

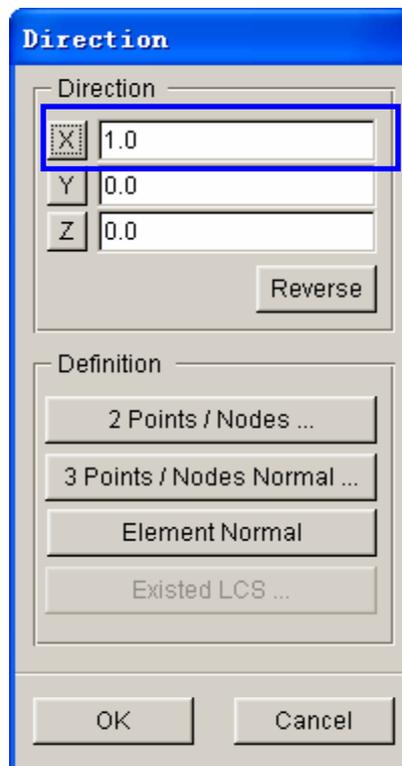


Figure 3.25 Direction dialog box

23. Click **OK** button to dismiss the DIRECTION dialog box.
24. Now, let's define the docking rod on the right hand side by repeating steps 17-21. The new tool name is **dock2**. Select **Use setting of tool** option illustrated in Figure 3.26.

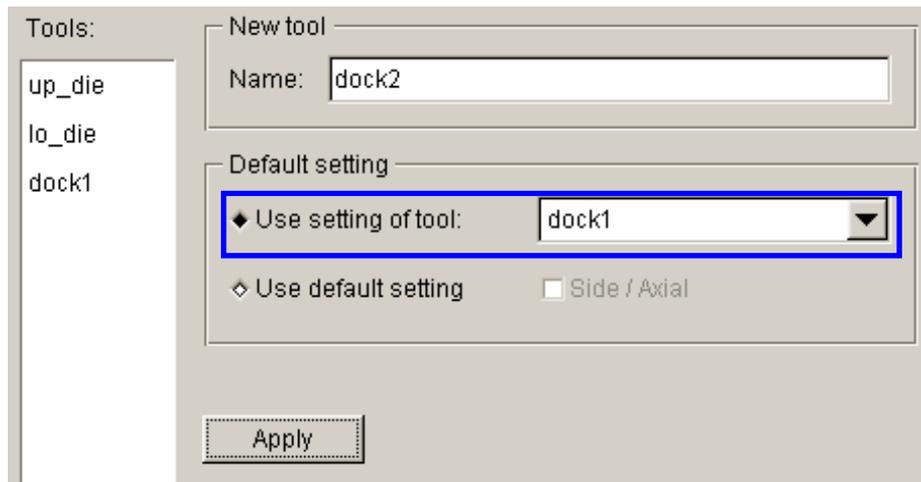


Figure 3.26 Create dock2

25. Next, click  button to display the DIRECTION dialog box.
26. Click on **X** button **twice** to set the vector of working direction as **-1**. See Figure 3.27.

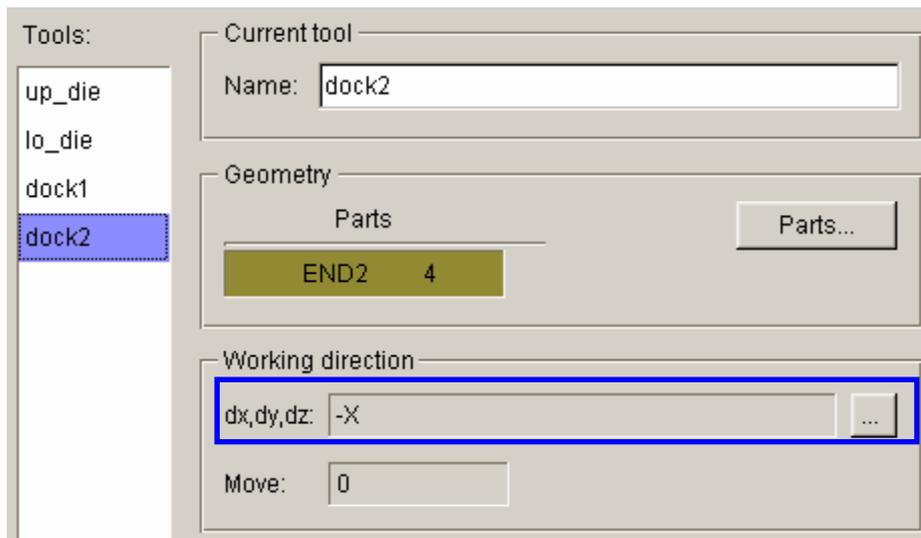


Figure 3.27 Define dock2

27. Click **Exit** button to return to tool definition interface. The font color of all tools is changed from red into black, indicating all tools are defined.

V. Tools Positioning

After defining all tools, the user needs to position the relative position of tools for the stamping operation. The tool positioning operation must be carried out each time the user sets up a stamping simulation model. Otherwise, the user may not obtain

correct stamping simulation setup.

The tool position is related to the working direction of each tool. Therefore, you need to carefully check the working direction prior to positioning the tools. If the process template is chosen, the default working direction is selected. You can also define special working direction.

1. Click **Positioning...** button located at the lower right corner of tool definition interface to display the POSITION dialog box illustrated in Figure 3.28. Alternatively, you can select **Tools→Positioning...** from the menu bar.

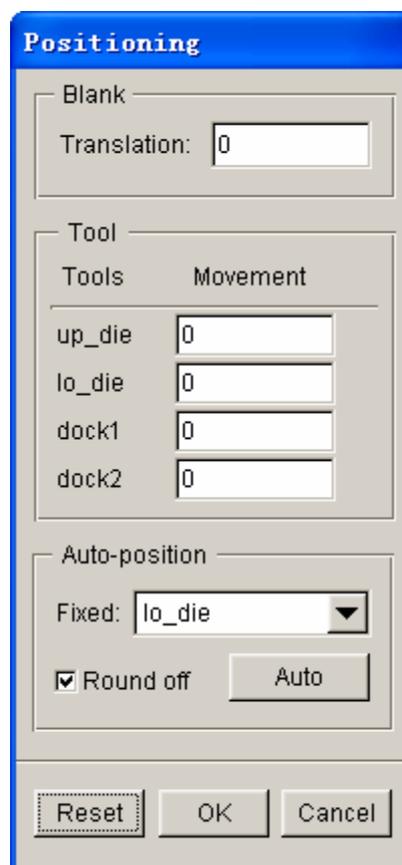


Figure 3.28 Before tools positioning

3. Select **lo_die** as fixed tool and use it as the reference tool. The tool is stationary during automatic positioning.
4. Then, click **Auto** button to position all tools and tube automatically. The result is illustrated in Figure 3.29.
5. Now all tools and tube are moved to a preset location. The movement of each tool is listed in the input data field of corresponding tool. The value is the measurement from the home/final position to the current position.

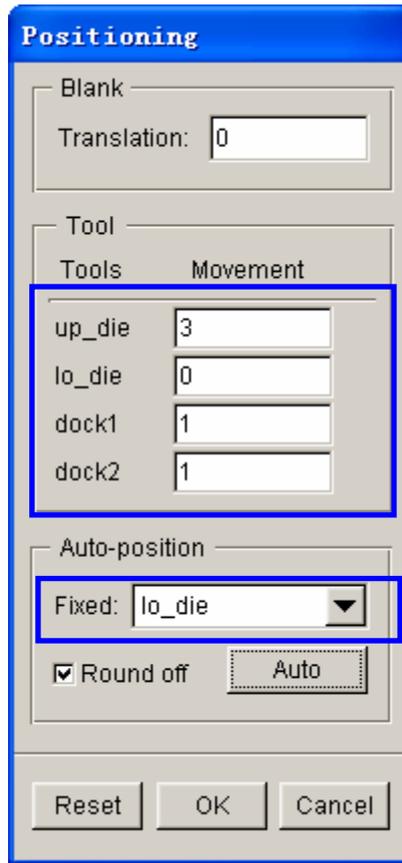


Figure 3.29 After tools auto positioning

- Click  and  icon on the **Icon bar** to display the relative position of tools and tube, as shown in Figure 3.30.

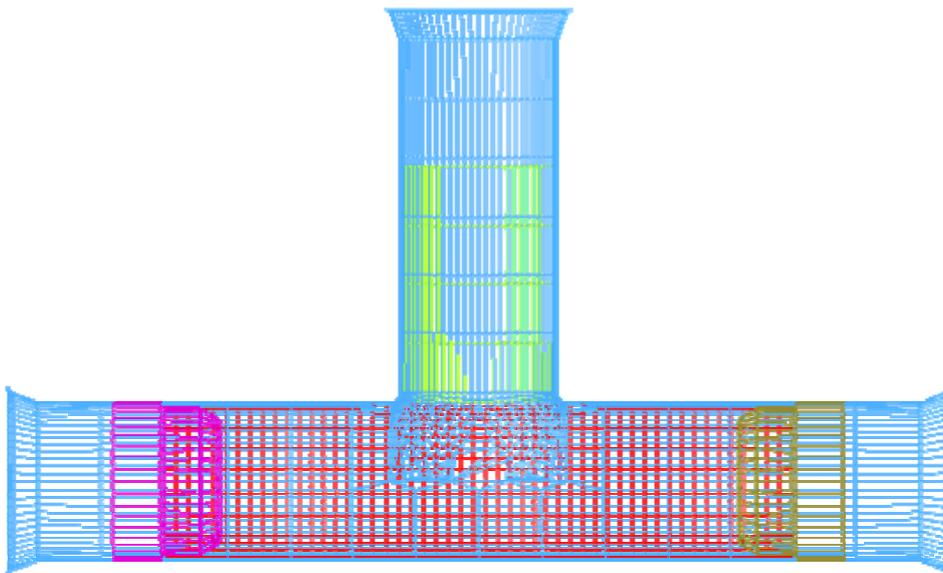


Figure 3.30 The relative position of tools and tube after positioning

7. Click **OK** button to save the current position of tools and tube, and return to the tool definition interface.

Note: After autopositioning, the relative position of tools and blanks is displayed on the screen. However, you may select **Tools → Positioning...** from the Auto Setup menu bar, following by pressing the **Reset** button in the **POSITIONING** dialog box to set the tools and blank(s) back to its original position. Moreover, you can move the tools using the **Home...** function provided in the **Tools** menu.

Now, you can continue with the next process which is definition of process parameters. In Auto Setup application, the definition and positioning of blank(s) and tools and definition of process are not required in strict order. Therefore, you can randomly modify each operation. However, you are recommended to accordingly set up the blank(s) definition, tools definition and process parameters.

VI. Process Definition

The Process definition is utilized to set up process parameters of the current simulation such as time required for every process, tooling speed, binder force and so on. The parameters listed in process definition interface depend on the pre-selected process template, including type of simulation and process.

In this example, the type of simulation is **Tubular hydroforming**. Therefore, the default processes listed in the process definition interface are closing and hydroforming.

You can press **Process** tab of the main interface to enter process definition interface. Next, follow the steps listed below:

1. Select **closing** process illustrated in Figure 3.31, following by clicking the **Delete stage** button in the process definition interface to remove the process.
2. Now, only the hydroforming process is available in the process definition interface. Toggle on the **Show all** option illustrated in Figure 3.32 to display all

the tools.

- In hydroforming process, the **lo_die** remains stationary through out the forming process. Set the velocity of **up_die** to **-2500** (mm/s) so the tool is moving downward along the working direction. Both **dock1** and **dock2** are moving with the velocity of **500** (mm/s) along their corresponding working direction. See Figure 3.32.
- Click on the **No Pressure** button illustrated in Figure 3.32 to display the HYDRO MECH dialog box illustrated in Figure 3.33. In pressure control field, select **Constant** option. Then, type in constant pressure of 10 (N/mm²).

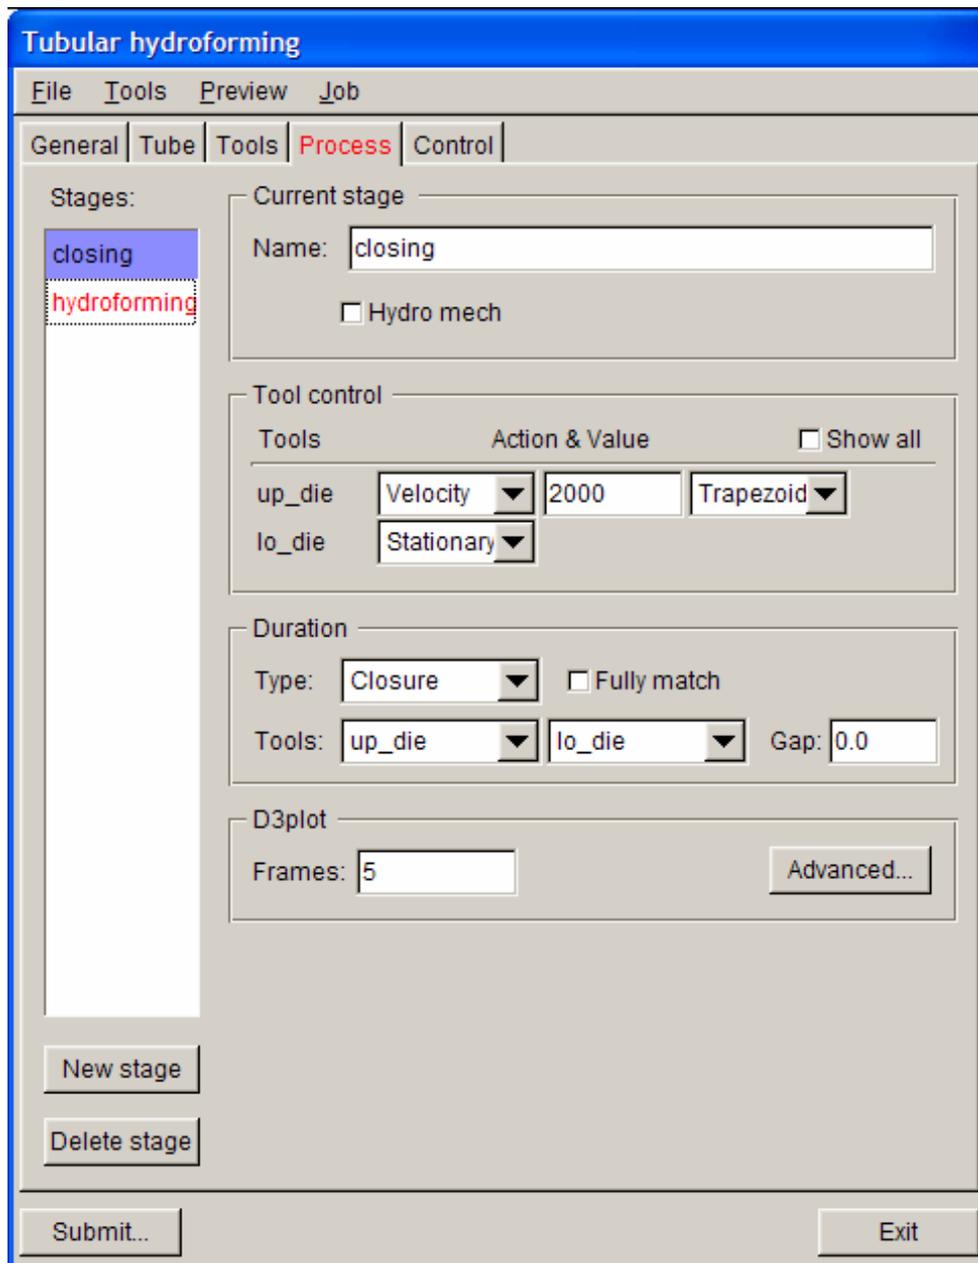


Figure 3.31 Closing process interface

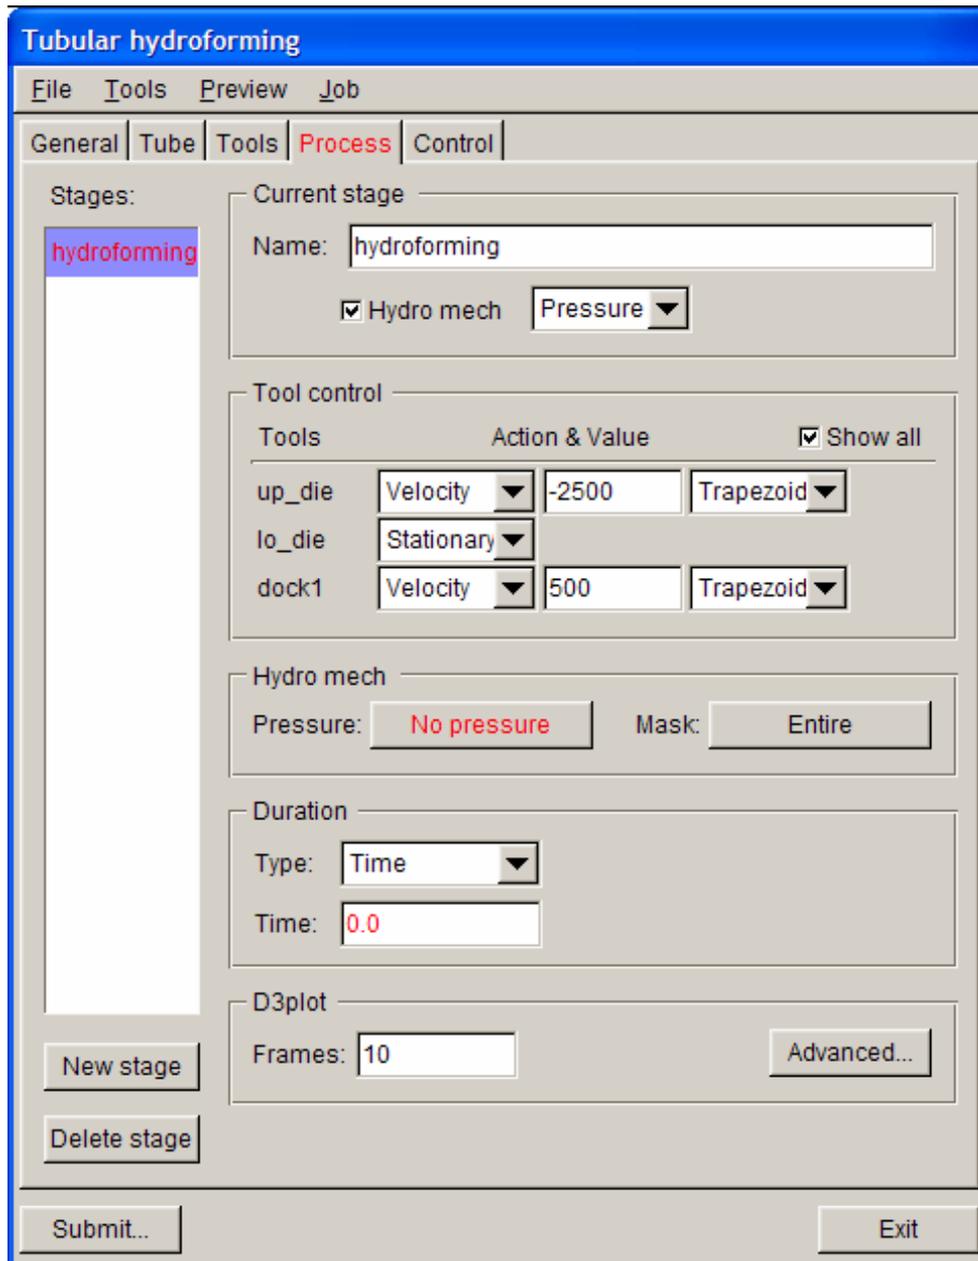


Figure 3.32 Hydroforming process interface

- Click **OK** button to dismiss the HYDRO MECH dialog box. As illustrated in Figure 3.34, the **No Pressure** button is switched to **P=10** indicating the fluid pressure is defined.

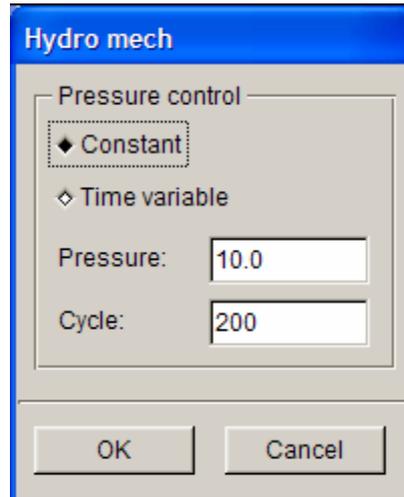


Figure 3.33 Hydro mech dialog box

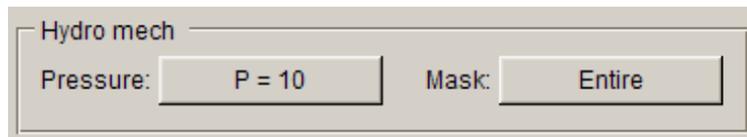


Figure 3.34 Hydroforming fluid pressure

6. Next, let's set the duration field of the process. Type in **0.01** (s) at the input data field of **Time**, as illustrated in Figure 3.35.



Figure 3.35 Hydroforming process time

7. Verify the process setting is defined according to the figures.
8. The default Control setting is adopted.

VII. Animation

Prior to submitting a simulation job, you shall validate the process setting by viewing the animation of tool movement. The procedure to conduct animation is listed as the following:

1. Select **Preview→Animation...** in the menu bar. See Figure 3.36.

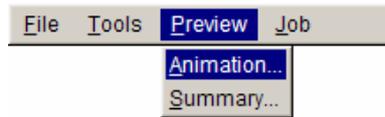


Figure 3.36 Animation menu

2. The animation of tool movement is shown on the display area.
3. You can select the **INDIVIDUAL FRAMES** option from the ANIMATE dialog box illustrated in Figure 3.37 to display the incremental tool movement.

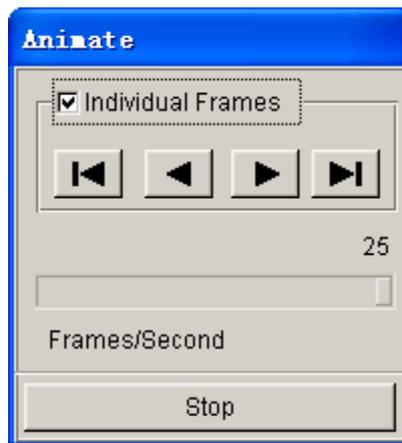


Figure 3.37 Animate control dialog box

4. Click  icon to display the tool movement step by step.
5. The time step and displacement of tools are printed on the upper left hand corner of the display area. See Figure 3.38.
6. Click **Exit** button to return to the main interface.

```

STEP 3      TIME = 2.000000E-003
UP_DIE     POSI = -3.000000
LO_DIE     POSI = 0.000000
BLOCK1     POSI = 1.500000
BLOCK2     POSI = 1.500000
    
```

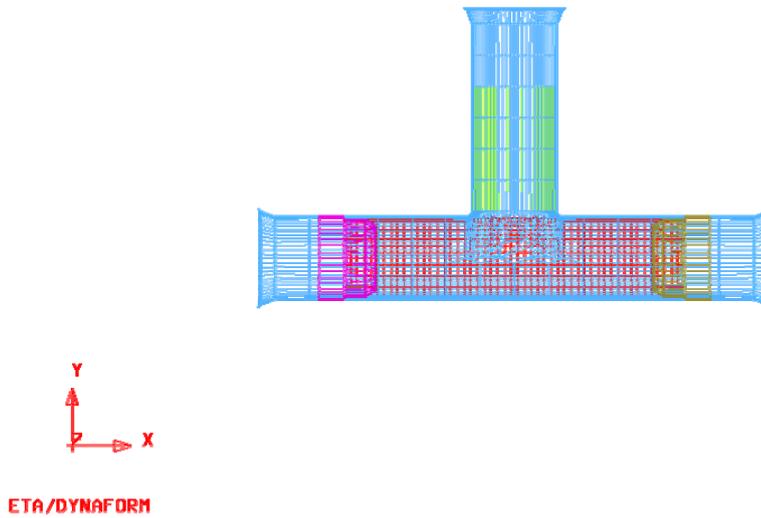


Figure 3.38 Movement condition by animation

VIII. Submit Job

After validating the tools movement, you may continue with submitting the stamping simulation through the steps listed below:

1. Click **Job**→**Job Submitter...** in the menu bar. See Figure 3.39.

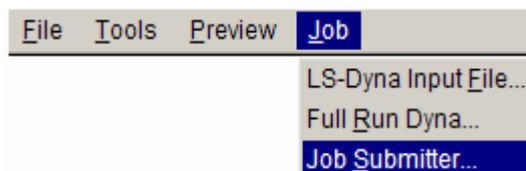


Figure 3.39 Job menu

2. The SUBMIT JOB dialog box illustrated in Figure 3.40 is displayed.
3. Click **Submit** button from the SUBMIT JOB dialog box to display the Job Submitter interface illustrated in Figure 3.41.

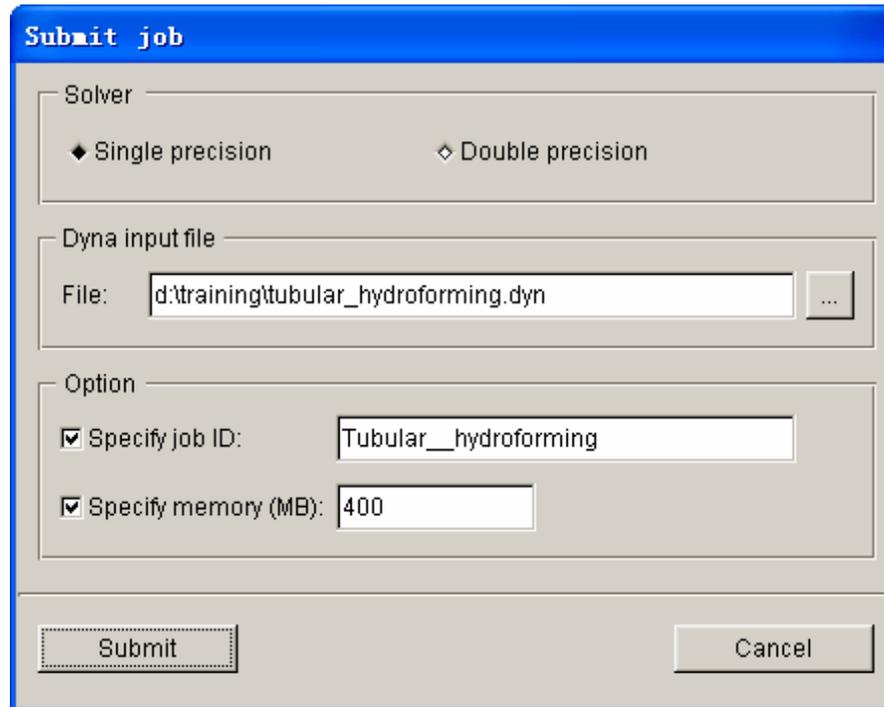


Figure 3.40 Submit job dialog box

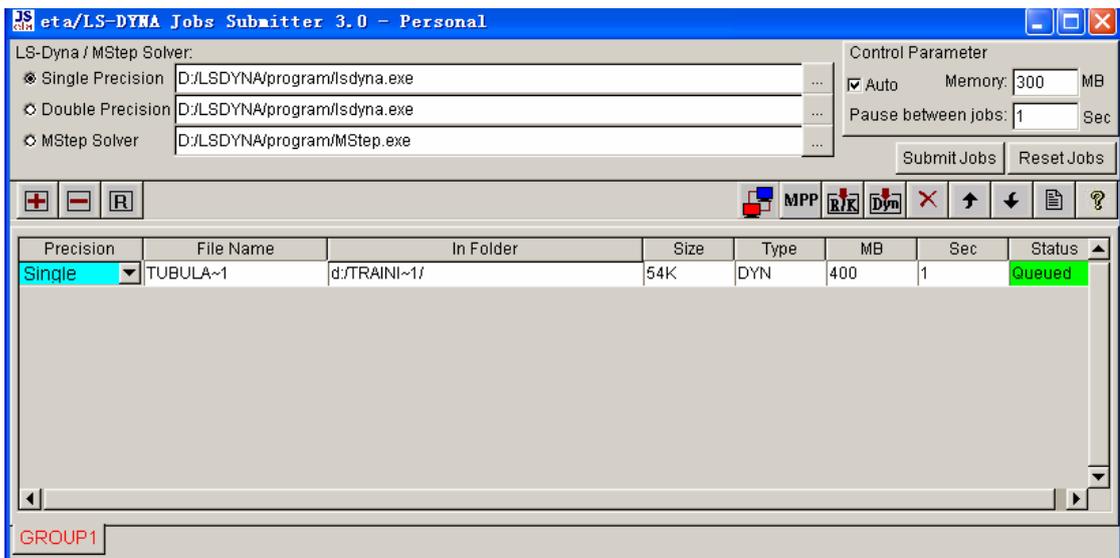
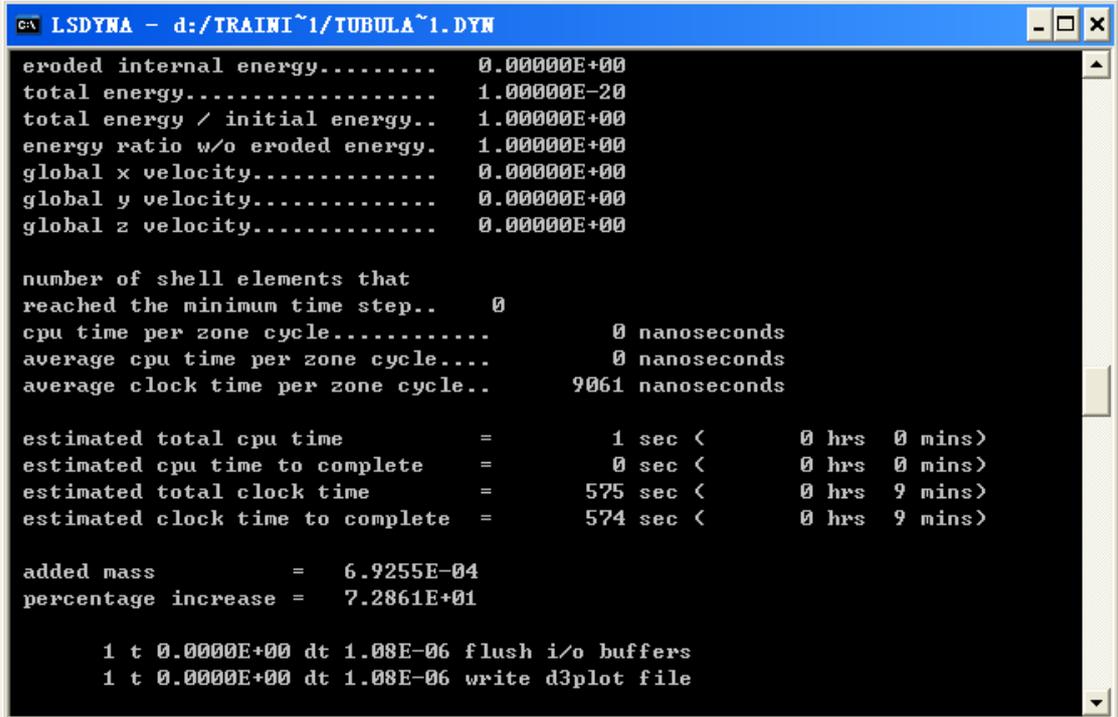


Figure 3.41 Submit job interface

5. Click **Submit Jobs** button to activate the LS-DYNA solver. The LS-DYNA window illustrated in Figure 3.42 is displayed and the simulation is in progress.

The image shows a screenshot of a Windows command prompt window titled "LS-DYNA - d:/TRAINI~1/TUBULA~1.DYN". The window contains the following text:

```
eroded internal energy..... 0.00000E+00
total energy..... 1.00000E-20
total energy / initial energy.. 1.00000E+00
energy ratio w/o eroded energy. 1.00000E+00
global x velocity..... 0.00000E+00
global y velocity..... 0.00000E+00
global z velocity..... 0.00000E+00

number of shell elements that
reached the minimum time step.. 0
cpu time per zone cycle..... 0 nanoseconds
average cpu time per zone cycle.... 0 nanoseconds
average clock time per zone cycle.. 9061 nanoseconds

estimated total cpu time      =      1 sec <      0 hrs 0 mins>
estimated cpu time to complete =      0 sec <      0 hrs 0 mins>
estimated total clock time    =     575 sec <      0 hrs 9 mins>
estimated clock time to complete =     574 sec <      0 hrs 9 mins>

added mass      =     6.9255E-04
percentage increase =     7.2861E+01

1 t 0.00000E+00 dt 1.08E-06 flush i/o buffers
1 t 0.00000E+00 dt 1.08E-06 write d3plot file
```

Figure 3.42 LS-DYNA solver window

POST PROCESSING (with eta/POST)

The eta/POST reads and processes all the available data in the **d3plot** and ASCII data files such as glstat, rforc, etc.,. In addition to the undeformed model data, the **d3plot** file also contains all result data generated by LS-DYNA (stress, strain, time history data, deformation, etc.).

I. Reading the Results File into the Post Processor

To execute eta/POST, click **PostProcess** from **eta/DYNAFORM** menu bar illustrated in Figure 3.43. The default path for **eta/POST** is C:\Program Files\Dynaform 5.5. In this directory, you can double click on the executable file, **EtaPostProcessor.exe** to open eta/POST GUI illustrated in Figure 3.44. The **eta/POST** can also be accessed from the programs listing under the start menu of **DYNAFORM 5.5**.

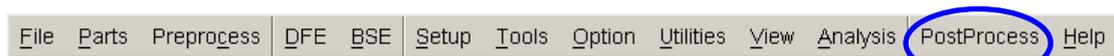


Figure 3.43 PostProcess menu

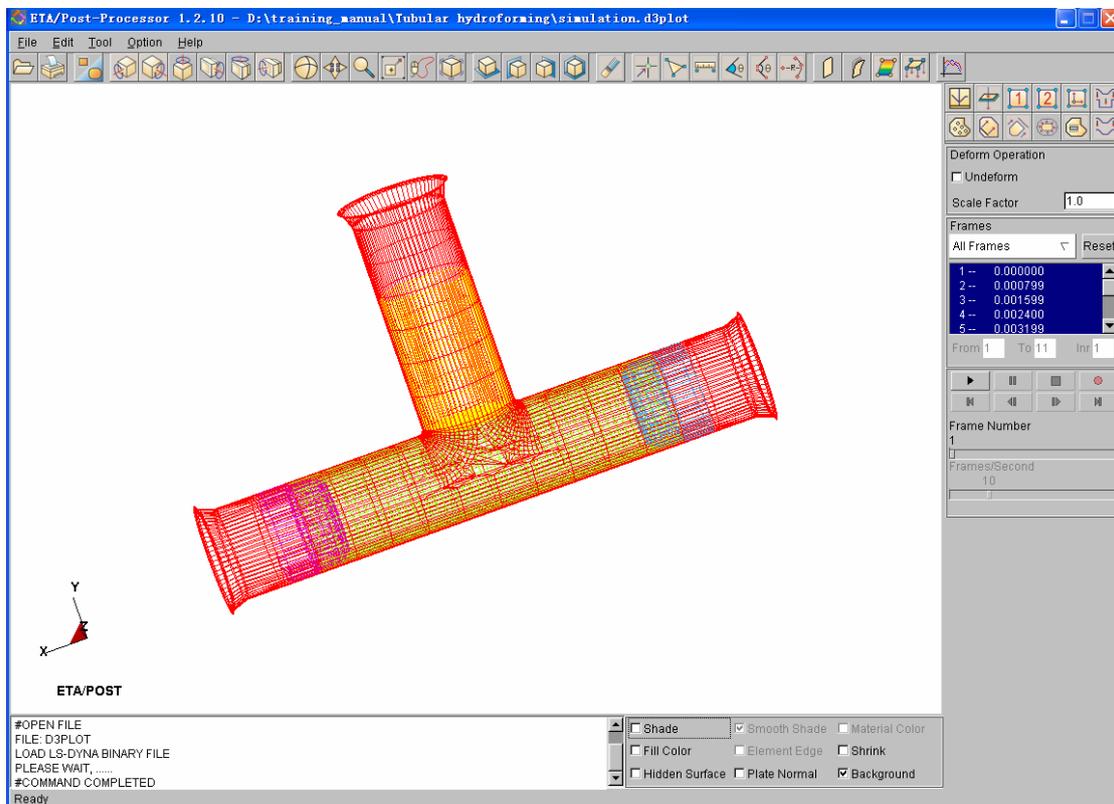


Figure 3.44 Post process GUI

1. From the **File** menu of **eta/POST**, select **Open** function illustrated in Figure 3.45. The Open File dialog box illustrated in Figure 3.46 is displayed.



Figure 3.45 File menu

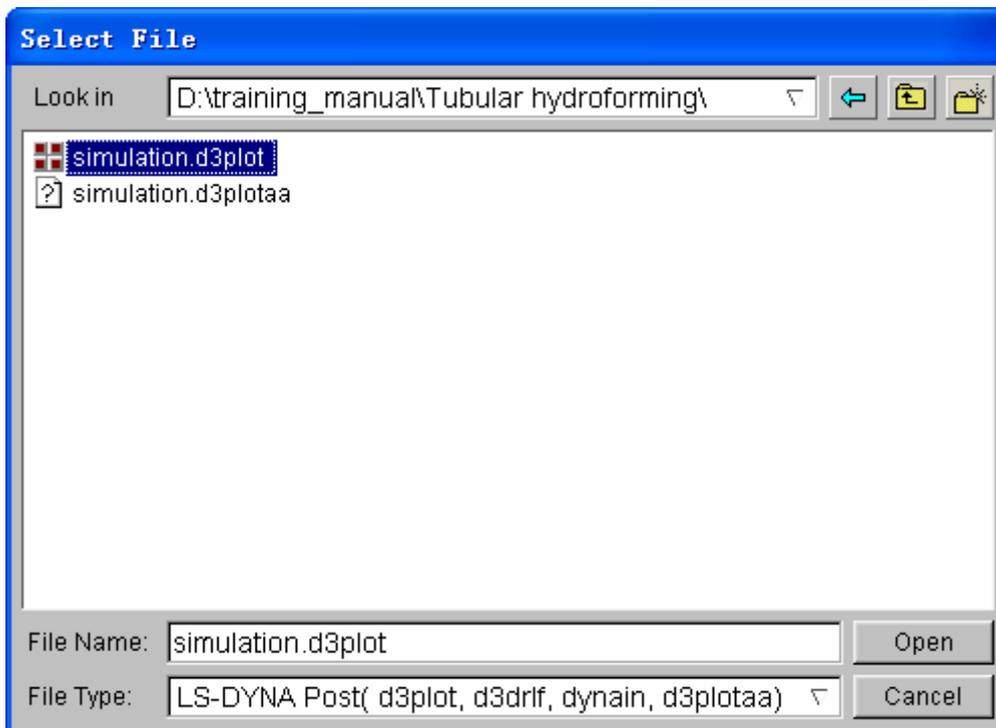


Figure 3.46 Open file

2. The default **File Type** is **LS-DYNA Post (d3plot, d3drif, dynain)**. This option enables you to read in the **d3plot**, **d3drif** or **dynain** file. The **d3plot** is output from forming simulation, such as drawing, binder wrap and springback, while **d3drif** is generated during gravity loading simulation. The **dynain** is generated at the end of each simulation. This file contains the deformed blank information.
3. Choose the directory of the result files and open the **simulation.d3plot** file illustrated in Figure 3.46.
4. The d3plot file is now completely read in. You are ready to process the results using the Special icon bar, as shown in Figure 3.47.



Figure 3.47 Special icon bar for forming analysis

II. Animating Deformation

1. The default **Plot State** is **Deformation**. In the **Frame** dialog, select **All Frames** and press **Play** button to animate the results. See Figure 3.48.

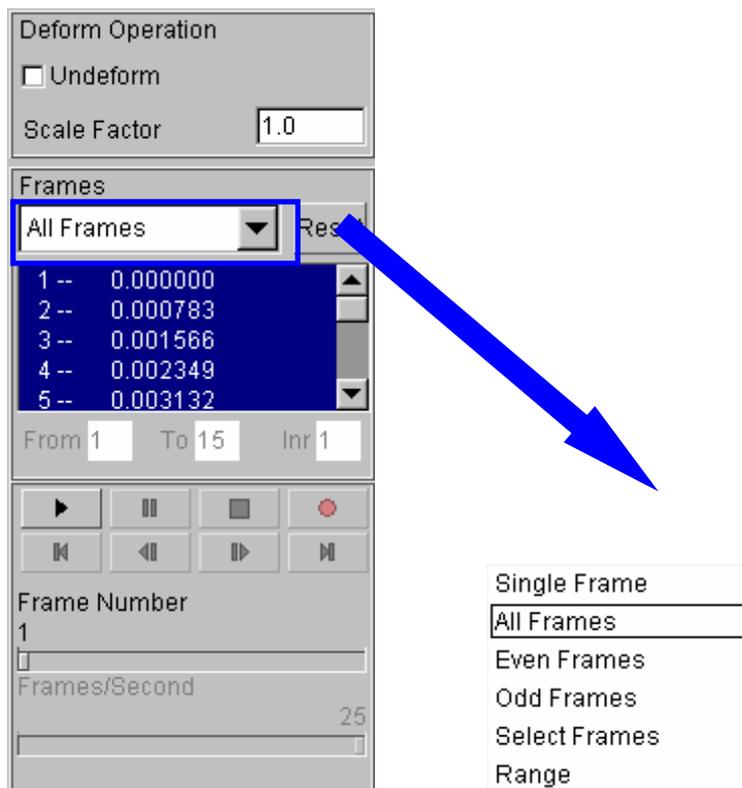


Figure 3.48 Animating deformation dialog box

2. Toggle on the **Shade** checkbox in the display options illustrated in Figure 3.49. The **Smooth Shade** option is also toggled on by default to enable smooth and continuous model display.

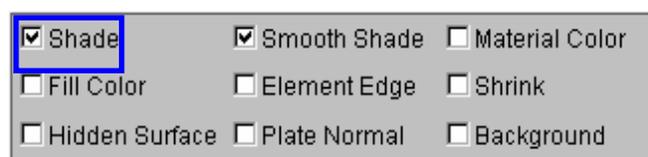


Figure 3.49 Display options

3. Since it is difficult to see the deformed part with all of the other tools being displayed, you can hide all the tools by pressing the  icon from **Icon bar**.

- In Part Operation dialog, use your mouse cursor to click on all the parts, excluding BLANK, as illustrated in Figure 3.50. All the tools are hidden from the display area. Then, press **Exit** button to dismiss the dialog box.

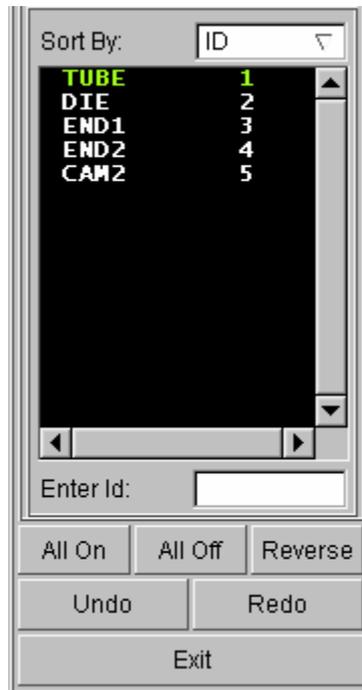


Figure 3.50 Part turn on/off dialog box

- You can also change the displayed model using the view manipulation icons on the **Icon bar** illustrated in Figure 3.51.



Figure 3.51 Icon bar

III. Animating Deformation, Thickness and FLD

In eta/POST, you can animate deformation, thickness, FLD and various strain/stress distribution of the blank. Refer to the following examples for animation.

Thickness/Thinning

- Select  icon from Special icon bar.
- Select **Current Component** from combo box, either THICKNESS or THINNING. The thickness contour of hydroformed tube is illustrated in Figure 3.52.
- Click **Play** button to animate the thickness contour.

4. Use your mouse cursor to move the slider to set the desired frame speed.
5. Click **Stop** button to stop the animation.

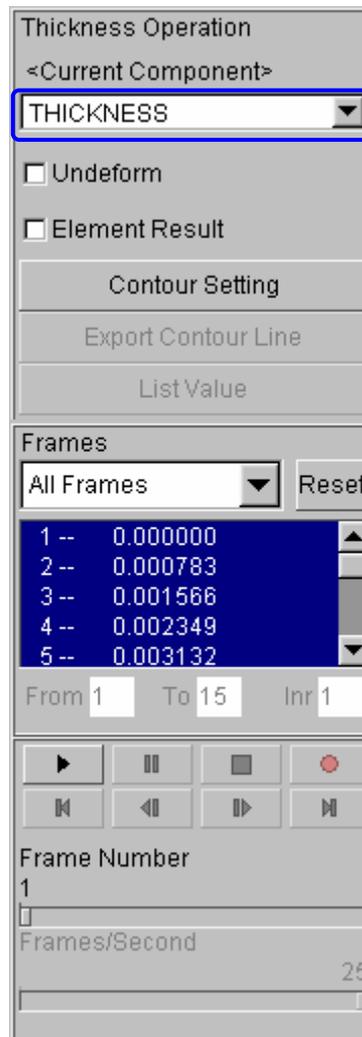


Figure 3.52 Thickness/Thinning contour

FLD

1. Pick  from the Special icon bar.
2. Select **Middle** from the **Current Component** list.
3. Set FLD parameters (n, t, r, etc.) by clicking the **FLD Curve Option** button to display the FLD CURVE AND OPTION dialog box.
4. Click **OK** button to dismiss the FLD CURVE AND OPTION dialog box.
5. Select **Edit FLD Window** function to define location of FLD plot on the display window.

6. Click **Play** button to animate the FLD contour of hydroformed tube, the last frame of the FLD contour as illustrated in Figure 3.53
7. Click **Stop** button.

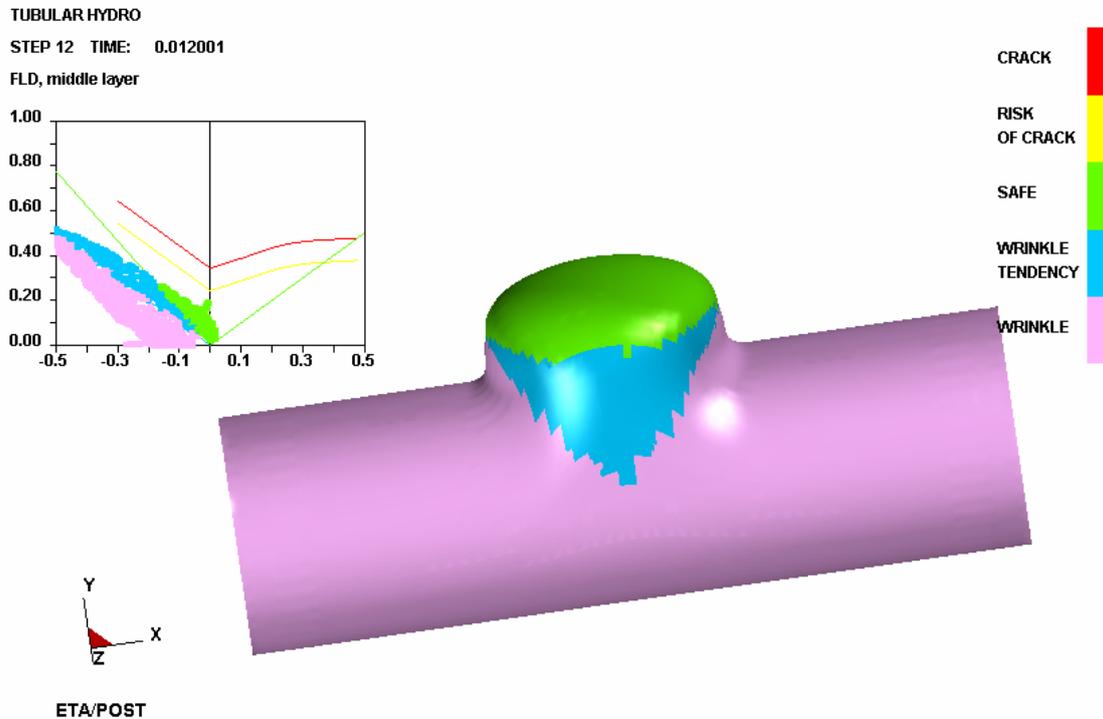


Figure 3.53 FLD contour

IV. Plotting Single Frames

Sometimes, it is much convenient to analyze the result by viewing single frames rather than the animation. To view single frame, select **Single Frame** option from the **Frames** combo box illustrated in Figure 3.54. Then, use your mouse cursor to select the desired frame from the frame list. You can also drag the slider of frame number to select the frame accordingly.

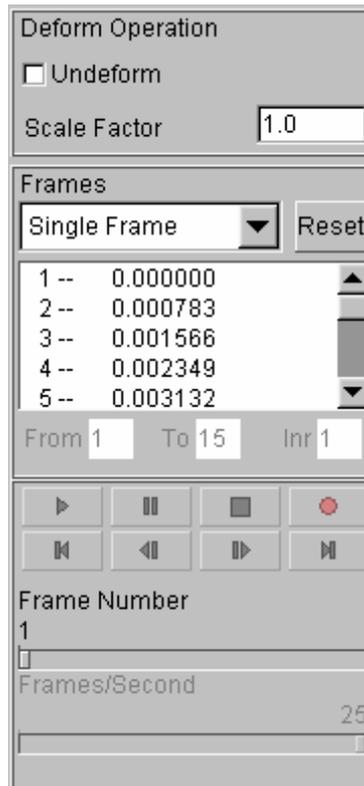


Figure 3.54 Display of single frame

V. Writing an AVI and E3D File

eta/POST provides a very useful tool that allows you to automatically create an **AVI** movie and/or **E3D** files via an animation of screen capture. The **Record** button illustrated in Figure 3.55 is commonly utilized to generate AVI movie and/or E3D files. This is the last function covered in this application example.

AVI movie

The following procedure is used to generate an AVI movie file.

1. Start a new animation (thickness, FLD, etc) using the procedure provided in Section III.
2. Display the model in isometric view.
3. Click the **Record** button.
4. The **Select File** dialog box is displayed.
5. Enter a name of the **AVI** movie file (e.g. traincase.avi) at the input data field of File Name illustrated in Figure 3.56.
6. Then, click **Save** button.

7. From the dialog box illustrated in Figure 3.57, select **Microsoft Video 1** from the **Compressor** list and click **Ok** button.
8. eta/POST will take a screen capture of the animation and write the output.

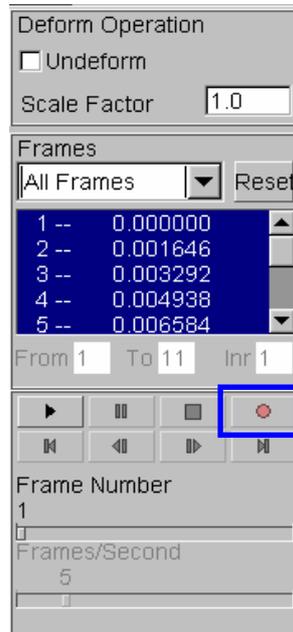


Figure 3.55 AVI dialog box

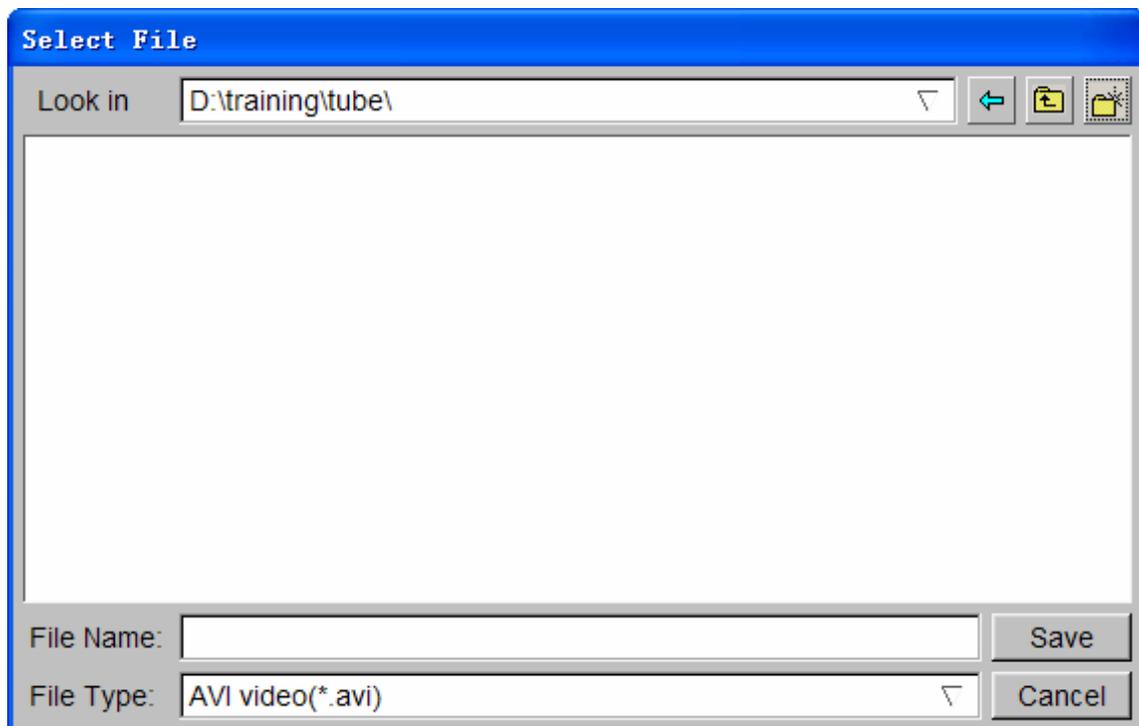


Figure 3.56 Save AVI file

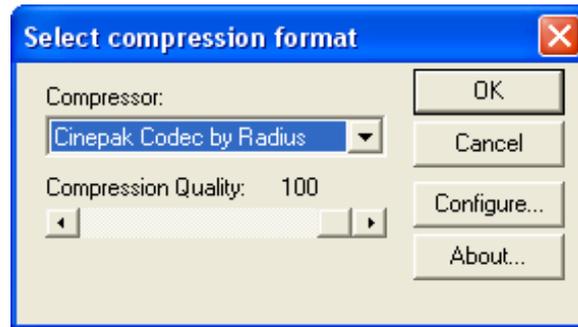


Figure 3.57 Select compression format

E3D file


You can also save simulation results in a much compact file format (*.e3d). The *.e3d file can be viewed using **eta/3DPlayer** which is provided as a free software to any users.

To create an E3D file, refer to the steps listed below:

1. Start a new animation (thickness, FLD, etc) using the procedure provided in Section III.
2. Display the model in isometric view.
3. Click the **Record** button.
4. The **Select File** dialog box is displayed.
5. Click the drop-down button of File Type to select **E3D Player file (*.e3d)**.
6. Enter a name of the **E3D** file (e.g. traincase.e3d) at the input data field of File Name.
7. Then, click **Save** button.
8. eta/POST will take a screen capture of the animation and write the output into *.e3d format.

You can view 3D simulation results using the player. To start the player, select Start→All Programs→Dynaform 5.5→Eta3DPlayer.

Example 4. Gravity Loading

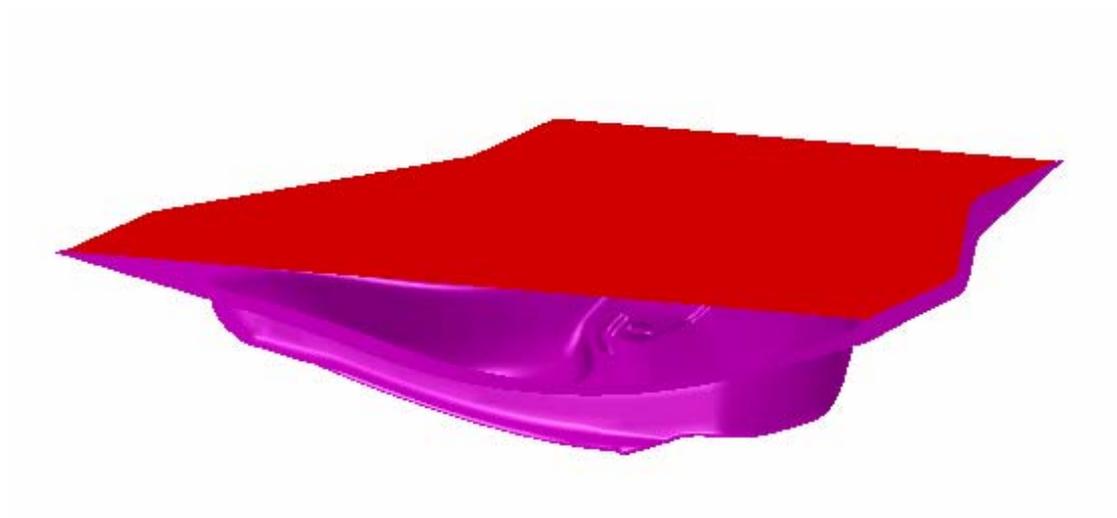

DATABASE MANIPULATION

Creating an eta/DYNAFORM Database and Analysis Setup

Start eta/DYNAFORM 5.5

For workstation/Linux users, enter the command “**df55**” (default) from a UNIX shell. For PC users, double click the **eta/DYNAFORM 5.5 (DF55)** icon from the desktop.

After starting **eta/DYNAFORM**, a default database **Untitled.df** is created.

Open the database

From the menu bar, select **File→Open...** to open the OPEN FILE dialog box illustrated in Figure 4.1.

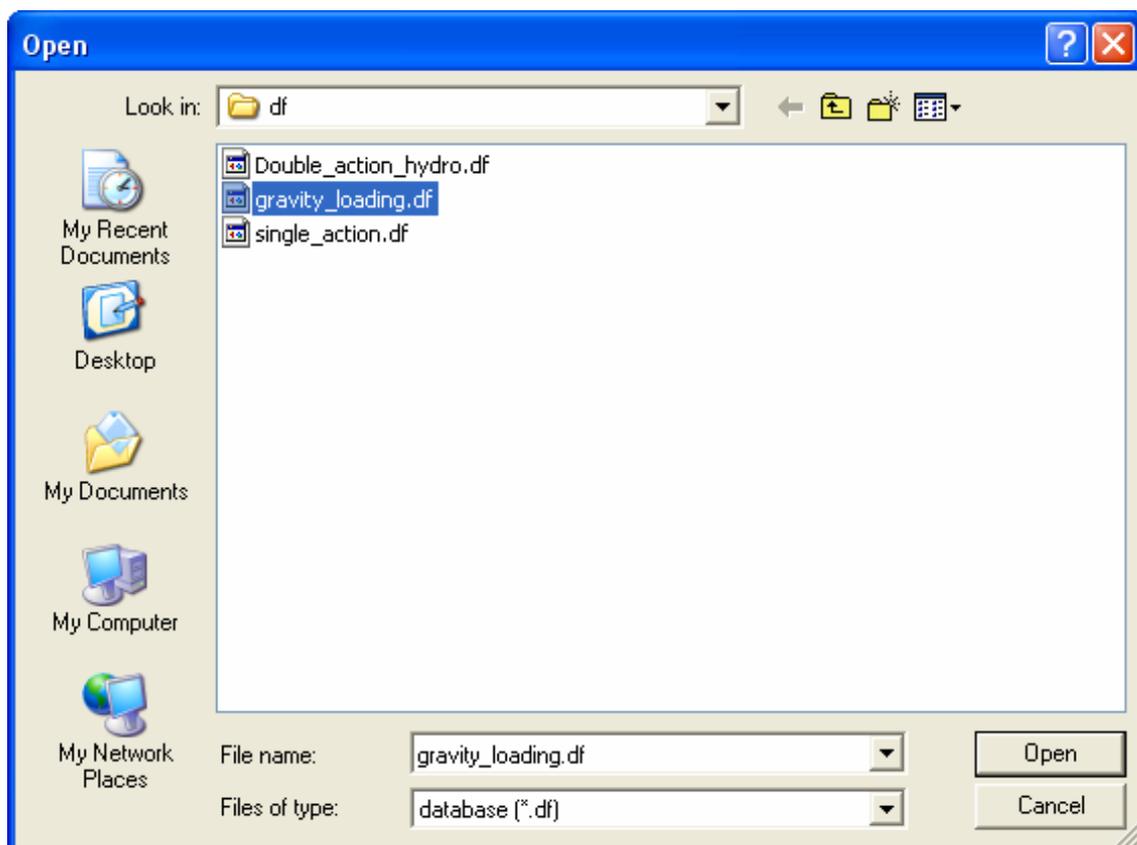


Figure 4.1 Open file dialog box

Go to the training input files located in the CD provided along with the eta/DYNAFORM installation, and open the data file named **gravity_loading.df**. The model shown in Figure 4.2 is displayed on display area.

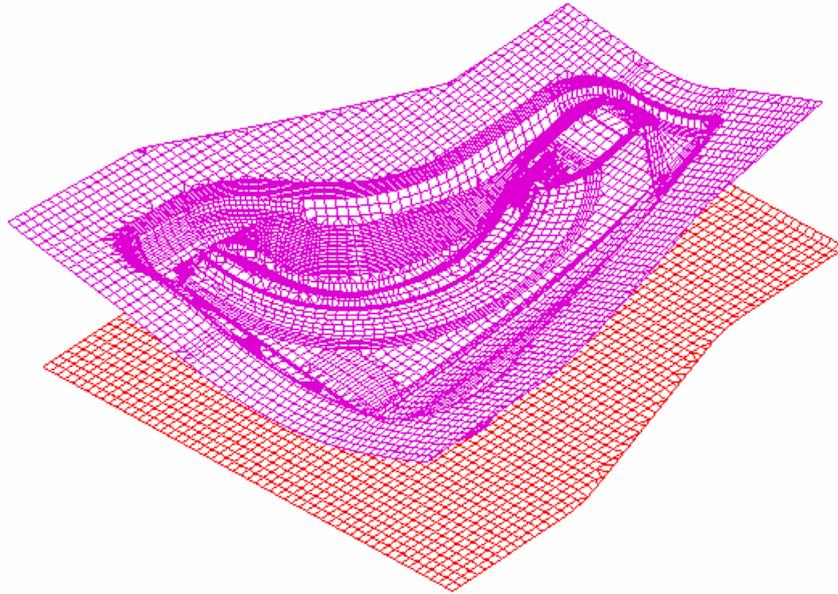


Figure 4.2 Illustration of model in Exercise 4

Database Unit

From the menu bar, select **Tools→Analysis Setup**. The default unit system for a new eta/DYNAFORM database is **mm, Newton, second, and Ton**.

AUTO SETUP

Prior to entering **AUTOSETUP** interface, upper/lower tool meshes are required. The other operation can be carried out in AutoSetup interface, such as **PHYSICAL OFFSET** of element, selection of **CONTACT OFFSET**. As illustrated in Figure 4.3, you can select **AUTOSETUP** option from the **SETUP** menu to display the **AUTOSETUP** interface.

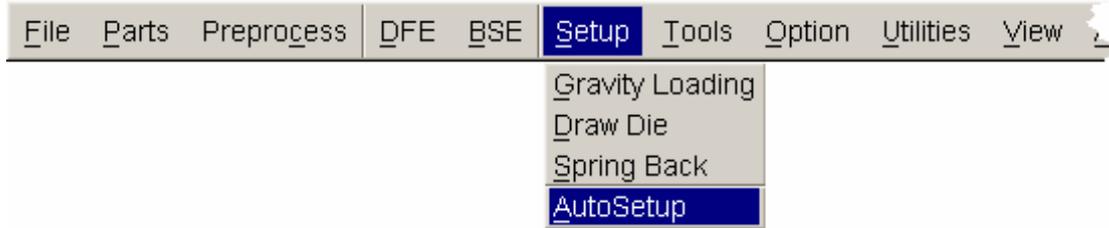


Figure 4.3 Setup menu

I. New Simulation

Click **AutoSetup** in the menu bar to display the NEW SIMULATION dialog box illustrated in Figure 4.4. You continue with defining basic parameters such as blank thickness, type of process, etc from the dialog box.

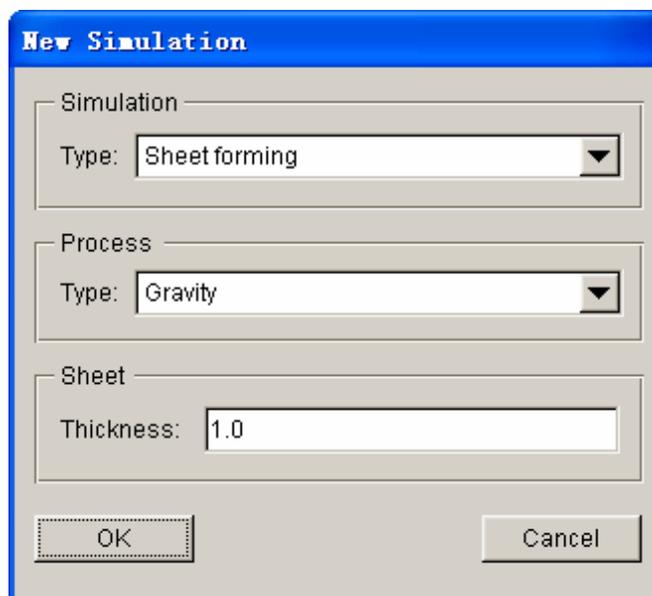


Figure 4.4 New simulation dialog box

1. Select simulation type: **Sheet forming**.
2. Select process type: **Gravity**.

3. Input blank thickness: 1.0 (mm).
4. Click **OK** button to display the main **AUTOSETUP** interface.

II. General

After entering **General** interface, you do not need to modify any parameters except for changing the **Title** into **single_action**. In addition, you can type in some comments about the setting/process in the **Comment** input field illustrated in Figure 4.5.

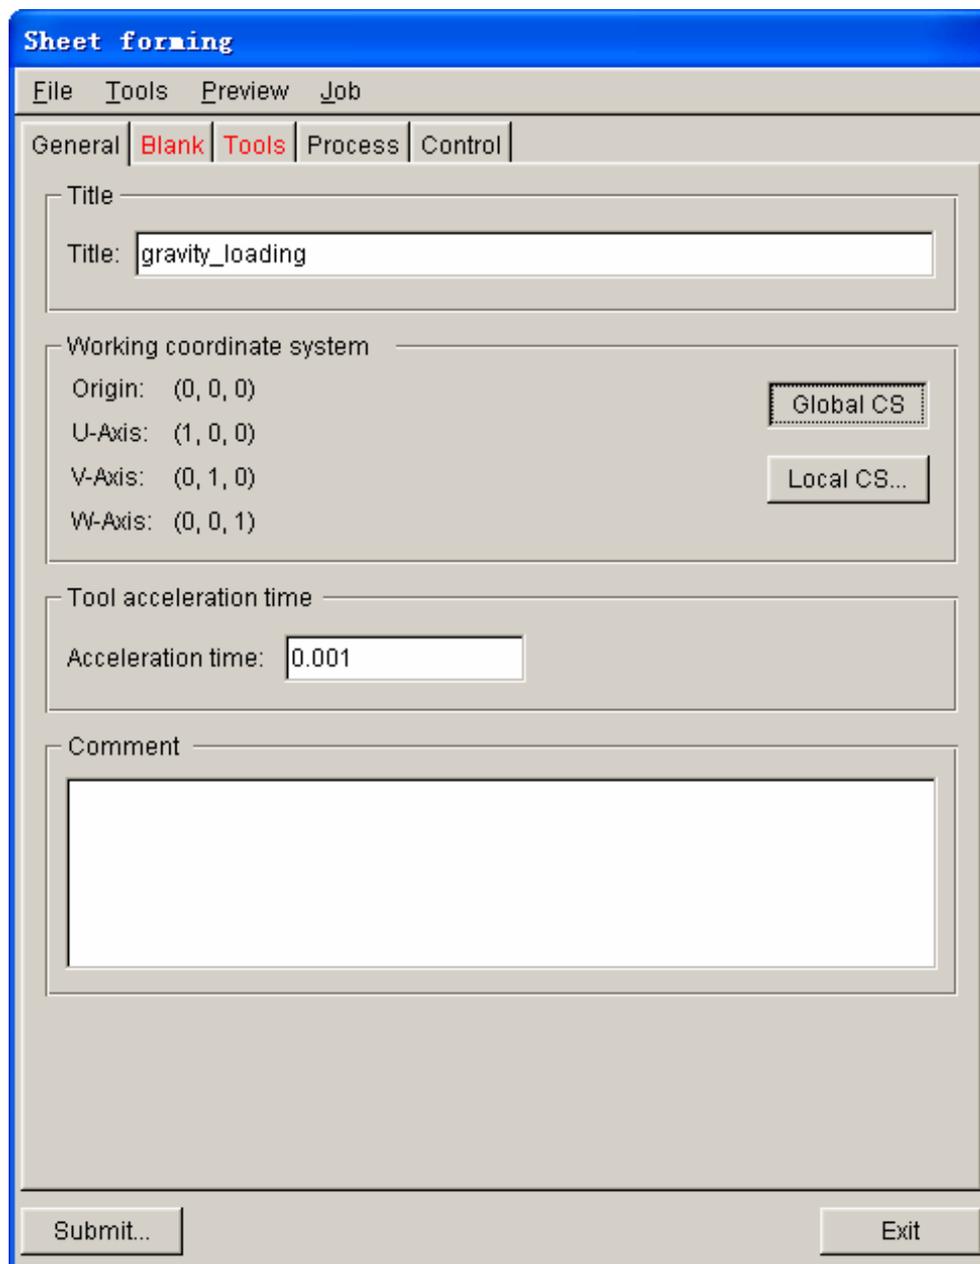


Figure 4.5 General interface

III. Blank Definition

1. Use your mouse cursor to click on **Blank** tab to display blank definition interface.
2. Then, click **Parts...** button from **Geometry** field in blank definition interface. See Figure 4.6.



Figure 4.6 Define blank

3. The DEFINE GEOMETRY dialog box illustrated in Figure 4.7 is displayed.

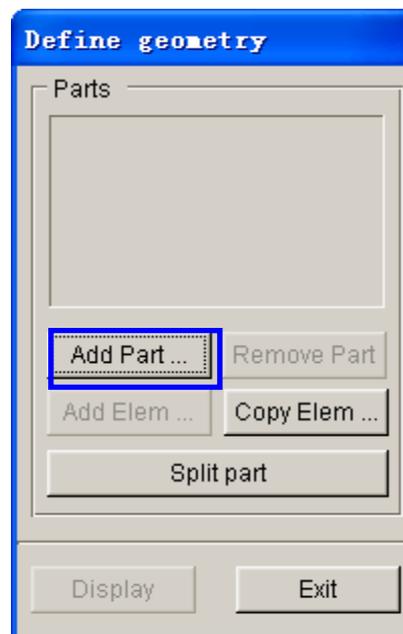


Figure 4.7 Define geometry dialog box

4. Click **Add Part...** button. Use your mouse cursor to select **BLANK** part from the SELECT PART dialog box illustrated in Figure 4.8.

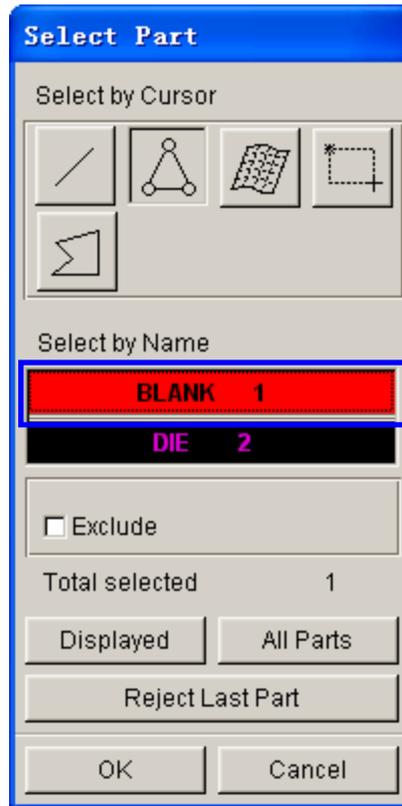


Figure 4.8 Select part dialog box

5. After selecting the part, click on **OK** button to return to DEFINE GEOMETRY dialog box. The **BLANK** part is added to the list. See Figure 4.9.

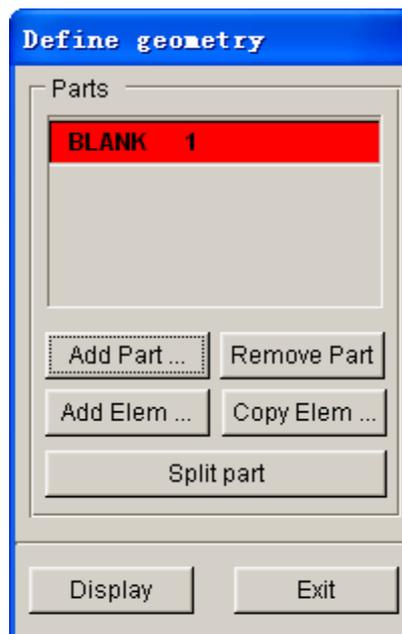


Figure 4.9 Blank geometry list

6. Click the Exit button to return to the blank definition interface. Now, the color of Blank tab is changed to from RED to BLACK. See Figure 4.10.

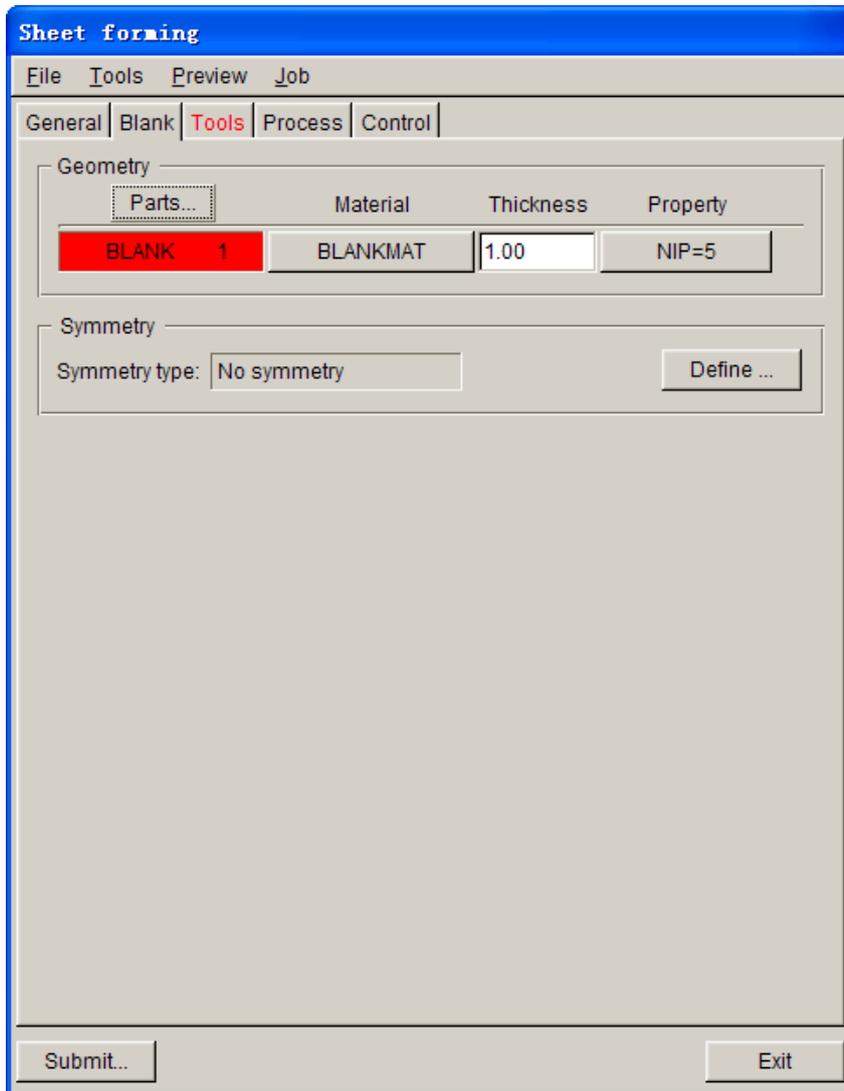


Figure 4.10 Blank definition interface

IV. Blank Material and Property Definition

Once the **BLANK** part is defined, the program automatically assigns a default blank material and relative property. You can also press the **BLANKMAT** button illustrated in Figure 4.11 to edit material definition.

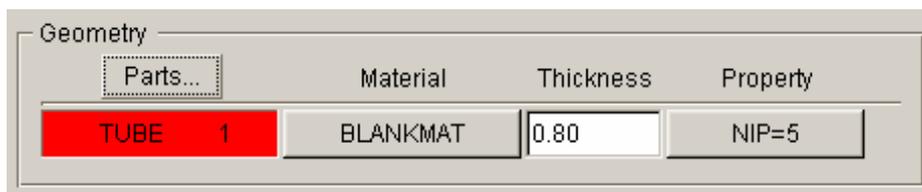


Figure 4.11 Blank definition

After clicking the **BLANKMAT** button, the MATERIAL dialog box illustrated in Figure 4.12 is displayed. You can create, edit or import material into the database. Moreover, you can press the **Material Library...** button to select generic material database provided by eta/DYNAFORM. Click on the **Material Library...** button to select the United States material library illustrated in Figure 4.12.

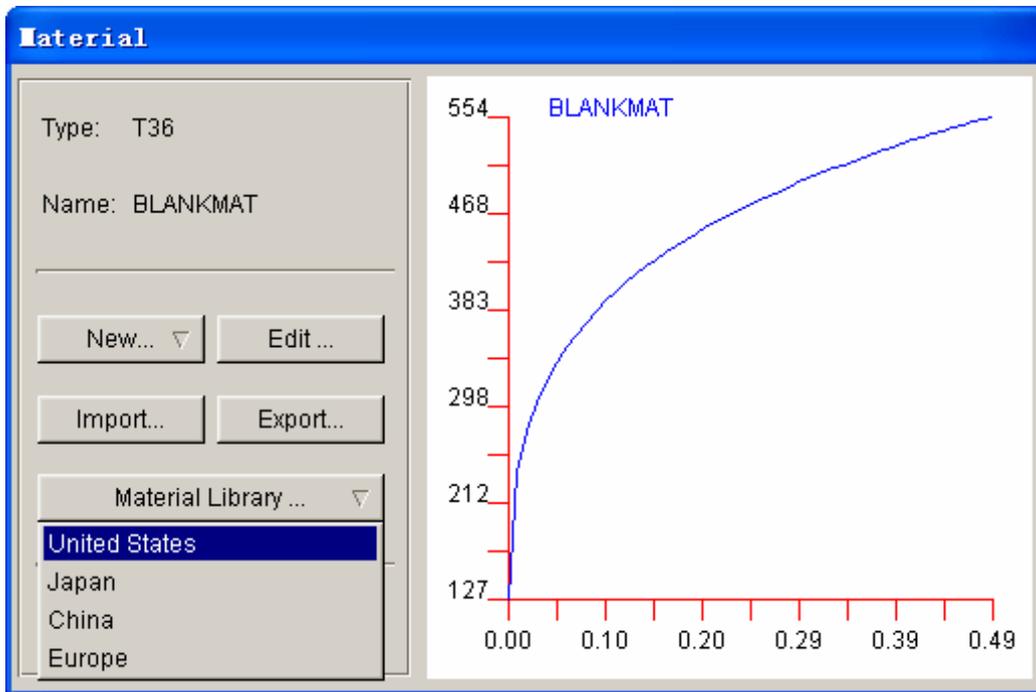


Figure 4.12 Define material

Now, you continue to select a material from the material library, as shown in Figure 4.13.

Material Library									
Material Type	Strength Level	Material Name	T1	T18	T24	T36	T37	T39	T64
STEEL	Mild	DQ	+	+	+	+	+	-	-
		DQSK	+	+	+	+	+	-	-
		DDQIF	+	+	+	+	+	-	-
	Medium	BH180	+	+	+	+	+	+	-
		BH210	+	+	+	+	+	+	-
		BH250	+	+	-	+	+	+	-
	High	HSLA250	+	+	+	+	+	+	-
		HSLA300	+	+	+	+	+	-	-
		HSLA350	+	+	+	+	+	+	-
	Advanced High	DP500	+	+	+	+	+	-	-
		DP600	+	+	+	+	+	-	-
	Hot Rolled	CQ	+	+	+	+	+	-	-
		DQSK	+	+	+	+	+	-	-
		DDQIF	+	+	+	+	+	-	-
	Stainless	SS11CrCb	+	+	+	+	+	-	-
SS18CrCb		+	+	+	+	+	-	-	
SS304		+	+	+	+	+	-	-	
ALUMINUM		AA5182	+	+	+	+	+	-	-
		AA5454	+	+	+	+	+	-	-
		AA5754	+	+	+	+	+	-	-
		AA6061	+	+	+	+	+	-	-

Figure 4.13 United States generic material library

V. Tools Definition

1. Click on **Tools** tab to display tool definition interface.
2. Click  icon from the **Icon bar**, and turn off the BLANK part.
3. Click **OK** button to return to tool definition interface. Based on the defined process, the standard tool listed at the left side of the tool definition interface is **die**. You can continue with definition of each tool.
4. Press **Parts...** button to assign a part as die. See Figure 4.14.

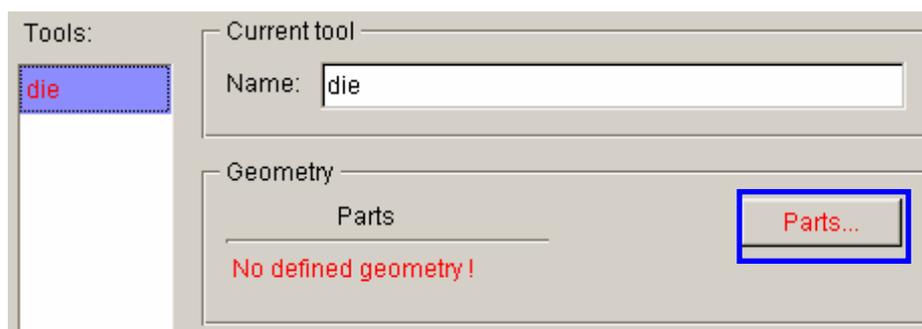


Figure 4.14 Die definition

5. The DEFINE GEOMETRY dialog box illustrated in Figure 4.15 is displayed. Next, click **Add Part...** button in the dialog box.

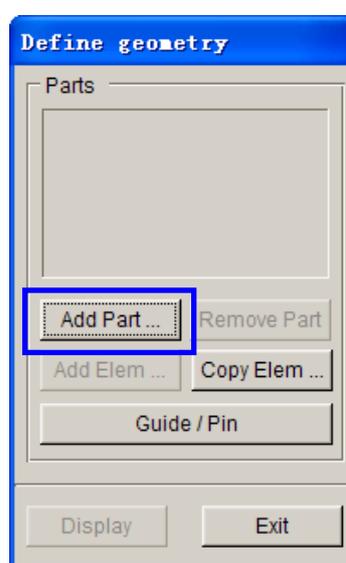


Figure 4.15 Define geometry dialog box

6. Select **DIE** part from the SELECT PART dialog box illustrated in Figure 4.16.

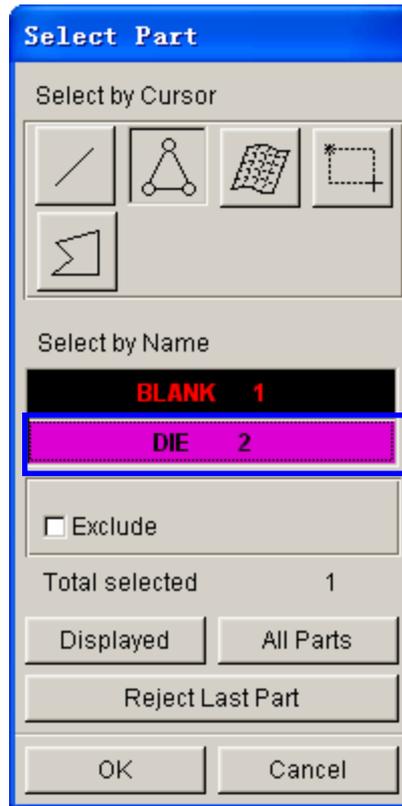


Figure 4.16 Select part

7. Click **OK** to return tool geometry define dialogue box. **DIE** part has been added to the list of die. See Figure 4.17.

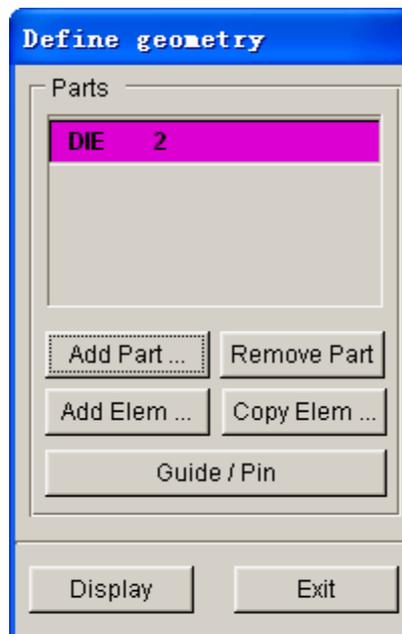


Figure 4.17 Die geometry list

8. Click **Exit** button to return to tool definition interface. Now, you can observe the font color of **die** is changed to BLACK. See Figure 4.18.

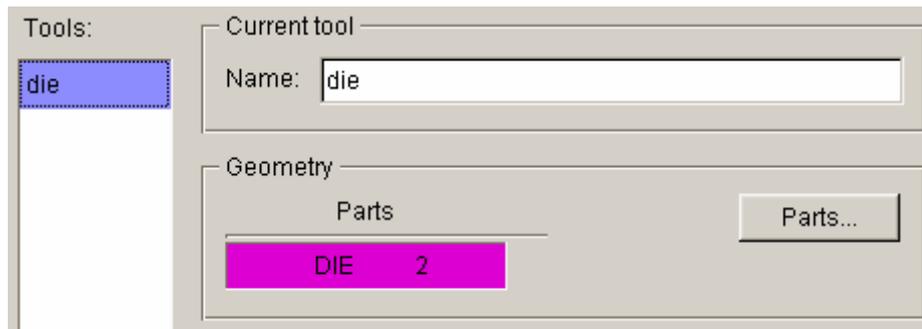


Figure 4.18 Die definition interface

9. Accept the default setting for working direction of tools and contact parameters.

VI. Tools Positioning

After defining all tools, the user needs to position the relative position of tools for the stamping operation. The tool positioning operation must be carried out each time the user sets up a stamping simulation model. Otherwise, the user may not obtain correct stamping simulation setup.

The tool position is related to the working direction of each tool. Therefore, you need to carefully check the working direction prior to positioning the tools. If the process template is chosen, the default working direction is selected. You can also define special working direction.

1. Click the **Positioning...** button located at the lower right corner of tool definition interface to display the POSITIONING dialog box illustrated in Figure 4.19. Alternatively, you can select **Tools→Positioning...** from the menu bar.

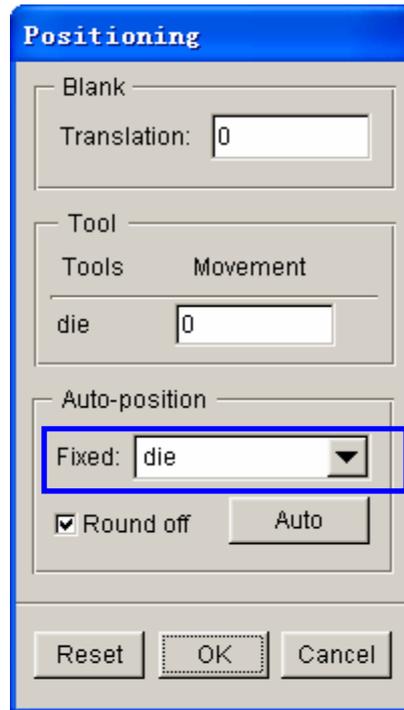


Figure 4.19 Before tools positioning

2. Select **die** as fixed tool and use it as the reference tool. The tool is stationary during automatic positioning.
3. Then, click the **Auto** button to position the tool and blank. The result is illustrated in Figure 4.20.
4. The movement of each tool is listed in the input data field of corresponding tool. The value is the measurement from the home/final position to the current position.

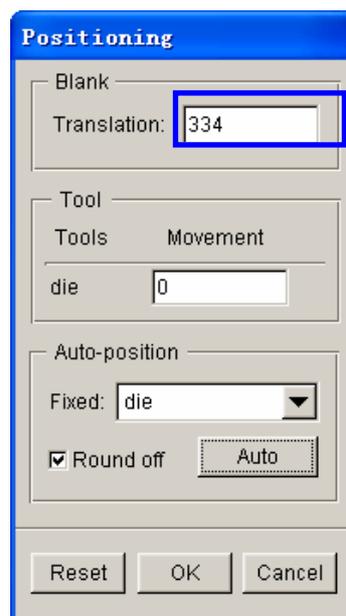


Figure 4.20 After tools auto positioning

5. Toggle off the checkbox of **Lines** and **Surfaces** in **Display Options** located at the lower right side of screen. See Figure 4.21.



Figure 4.21 Display options

6. Click  and  icon on the **Icon bar** to display the relative position of tool and blank, as shown in Figure 4.22.

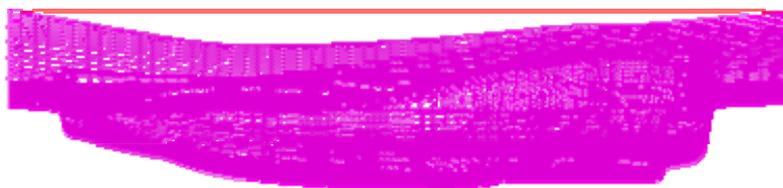


Figure 4.22 The relative position of tool and blank after positioning

7. Click **OK** button to save the current position of tool and blank, and to return to the main interface.

Note: After autopositioning, the relative position of tools and blanks is displayed on the screen. However, you may select **Tools → Positioning...** from the Auto Setup menu bar, following by pressing the **Reset** button in the **POSITIONING** dialog box to set the tools and blank(s) back to its original position. Moreover, you can move the tools using the **Home...** function provided in the **Tools** menu.

Now, you can continue with the next process which is definition of process parameters. In Auto Setup application, the definition and positioning of blank(s) and tools and definition of process are not required in strict order. Therefore, you can randomly modify each operation. However, you are recommended to accordingly set up the blank(s) definition, tools definition and process parameters.

VII. Process Definition

The Process definition is utilized to set up process parameters of the current simulation such as time required for every process, tooling speed, binder force and so on. The parameters listed in process definition interface depend on the pre-selected process template, including type of simulation and process.

In this example, the type of simulation and process is **Sheet Forming** and **Gravity**, respectively. Therefore, only one default process is listed in the process definition interface: gravity.

You can press **Process** tab of the main interface to enter process definition interface. In this exercise, the default setting is adopted.

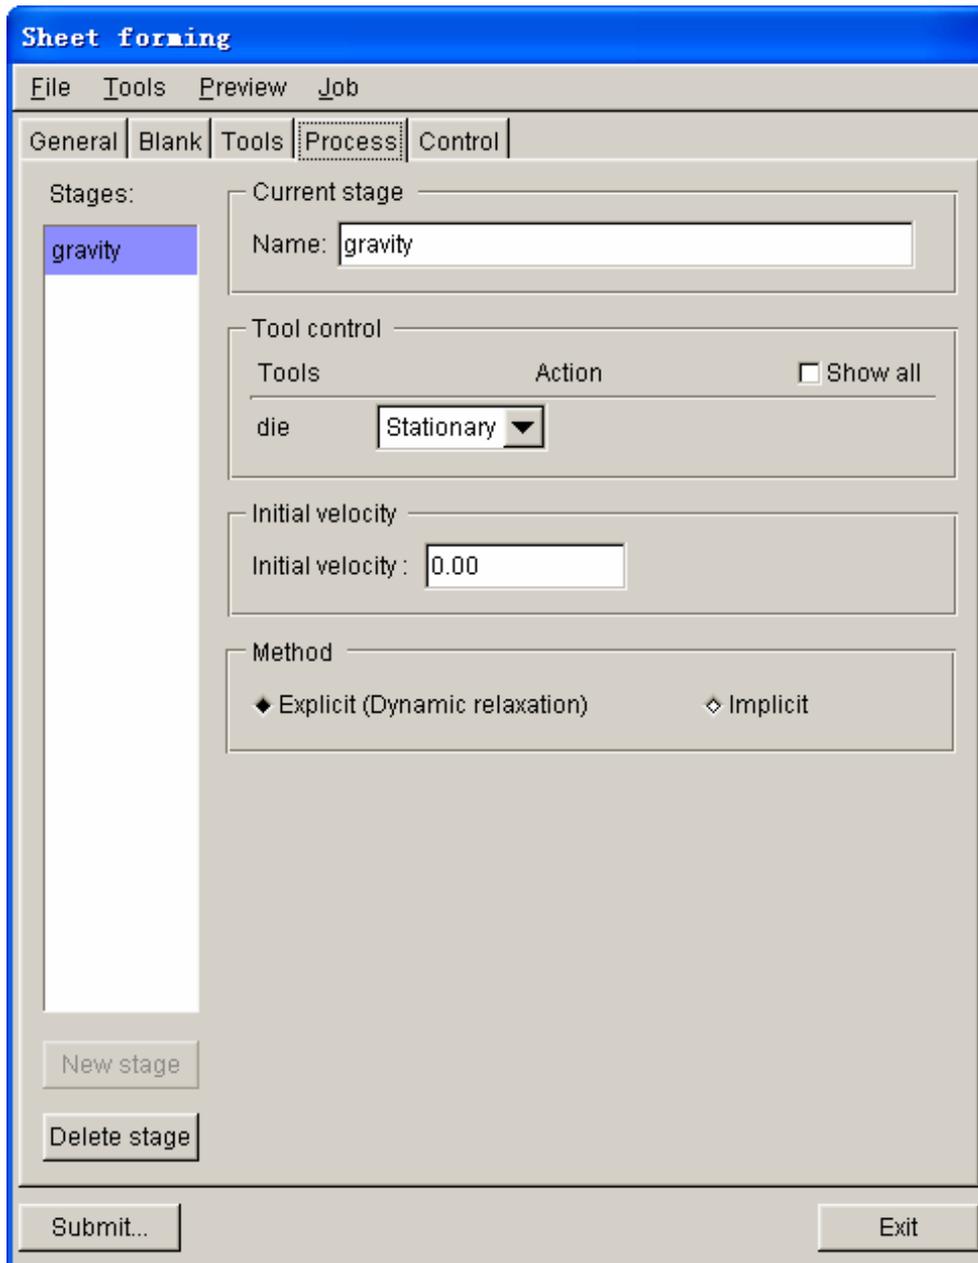


Figure 4.23 Gravity process interface

VIII. Animation

The gravity loading process isn't part of the forming stage in **AUTOSETUP**. Therefore, if you select **Preview**→**Animation...**, the dialog box illustrated in Figure 4.24 is displayed. Click **OK** button to return to main AutoSetup interface.



Figure 4.24 Confirmation dialog box

IX. Submit Job

After validating the tools movement, you may continue with submitting the stamping simulation through the steps listed below:

2. Click **Job→Job Submitter...** in the menu bar. See Figure 4.25.

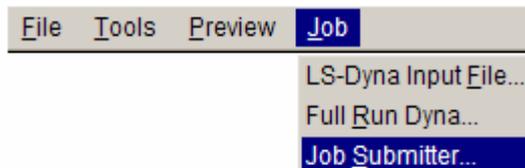


Figure 4.25 Job menu

3. The SUBMIT JOB dialog box illustrated in Figure 4.26 is displayed.

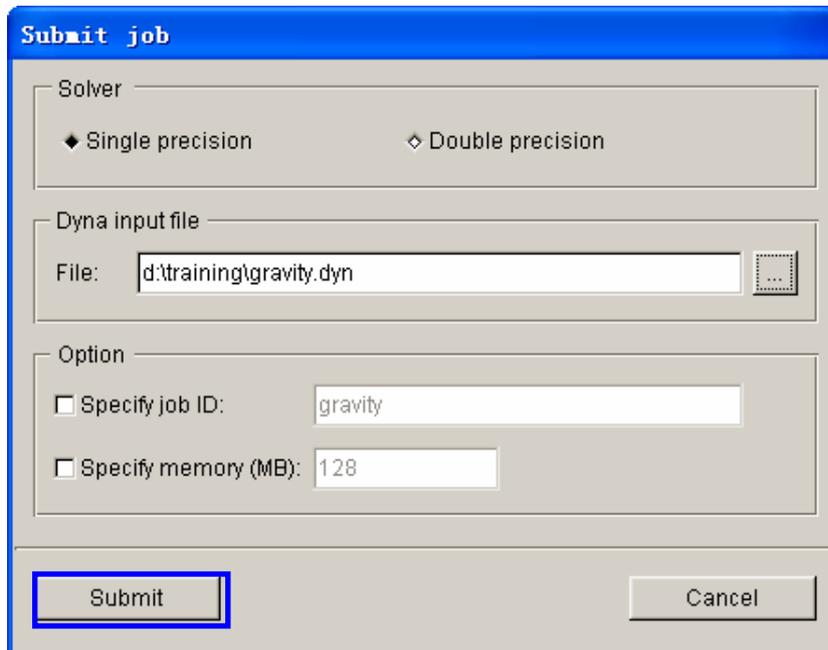


Figure 4.26 Submit job dialog box

4. Click **Submit** button from the SUBMIT JOB dialog box to display the Job

Submitter interface illustrated in Figure 4.27.

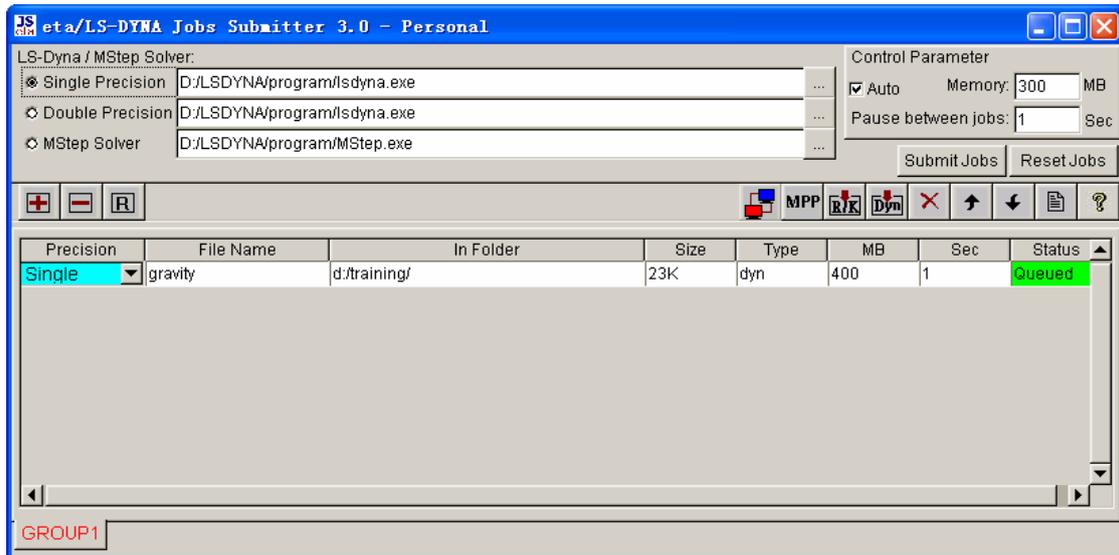


Figure 4.27 Submit job interface

5. Click **Submit Jobs** button, as shown in Figure 4.27 to activate the LS-DYNA solver for running the stamping simulation. The LS-DYNA window illustrated in Figure 4.28 is displayed and the simulation is in progress.

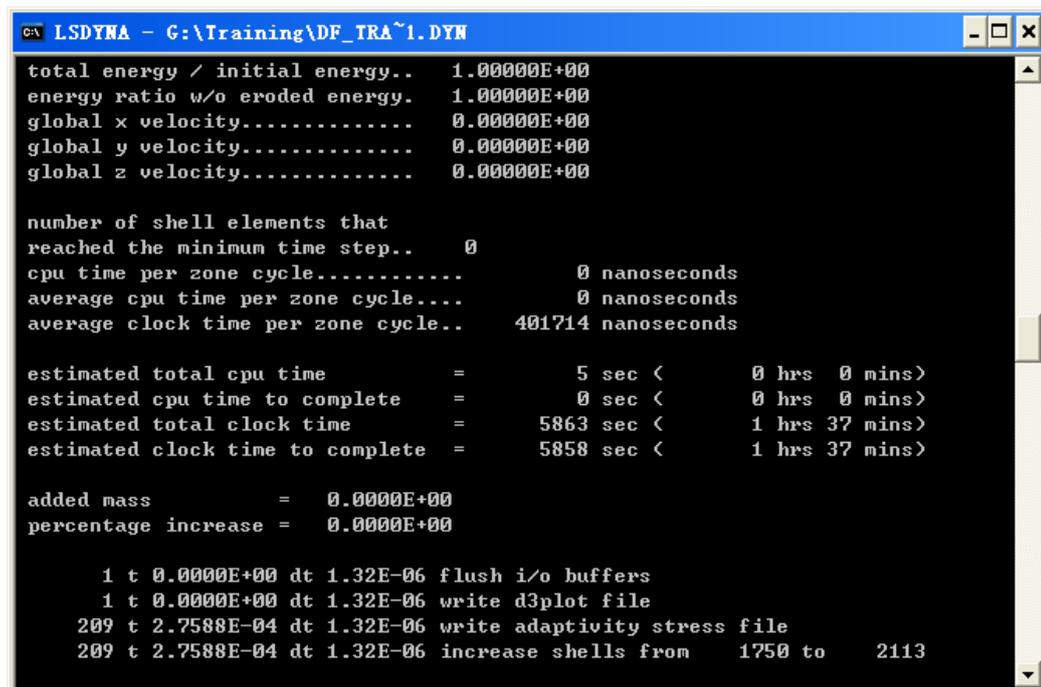


Figure 4.28 LS-DYNA solver window

When you submit a job from eta/DYNAFORM, an input deck is automatically created. The input deck is adopted by the solver, LS-DYNA, to process the stamping simulation. The default input deck names are **gravity.dyn** and **gravity.mod**. In addition, an index file named **gravity.idx** is generated for the reference in eta/POST.

The **.dyn** file contains all of the keyword control cards, while the **.mod** file contains the geometry data and boundary conditions. Advanced users are encouraged to study the **.dyn** input file. For more information, refer to the *LS-DYNA User's Manual*.

Note: All files generated by either eta/DYNAFORM or LS-DYNA is stored in the directory in which the eta/DYNAFORM database has been saved. You shall ensure the folder doesn't include similar files prior to running the current job because these files will be overwritten.

POST PROCESSING (with eta/POST)

The eta/POST reads and processes all the available data in the **d3plot** and ASCII data files such as glstat, rforc, etc.. In addition to the undeformed model data, the **d3plot** file also contains all result data generated by LS-DYNA (stress, strain, time history data, deformation, etc.).

I. Reading the Results File into the Post Processor

To execute eta/POST, click **PostProcess** from **eta/DYNAFORM** menu bar illustrated in Figure 4.29. The default path for **eta/POST** is C:\Program Files\Dynaform 5.5. In this directory, you can double click on the executable file, **EtaPostProcessor.exe** to open eta/POST GUI illustrated in Figure 4.30. The **eta/POST** can also be accessed from the programs listing under the start menu of **DYNAFORM 5.5**.



Figure 4.29 PostProcess menu

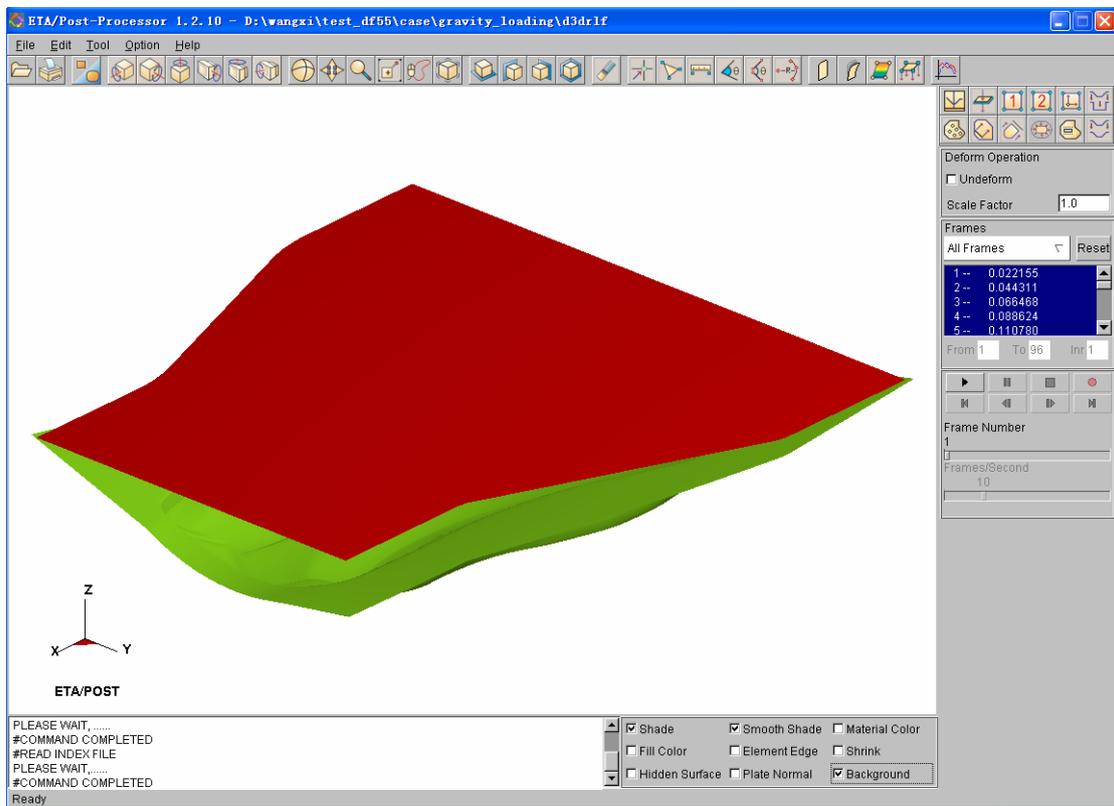


Figure 4.30 Post process GUI

1. From the **File** menu of **eta/POST**, select **Open** function illustrated in Figure 4.31. The Open File dialog box illustrated in Figure 4.32 is displayed.



Figure 4.31 File menu

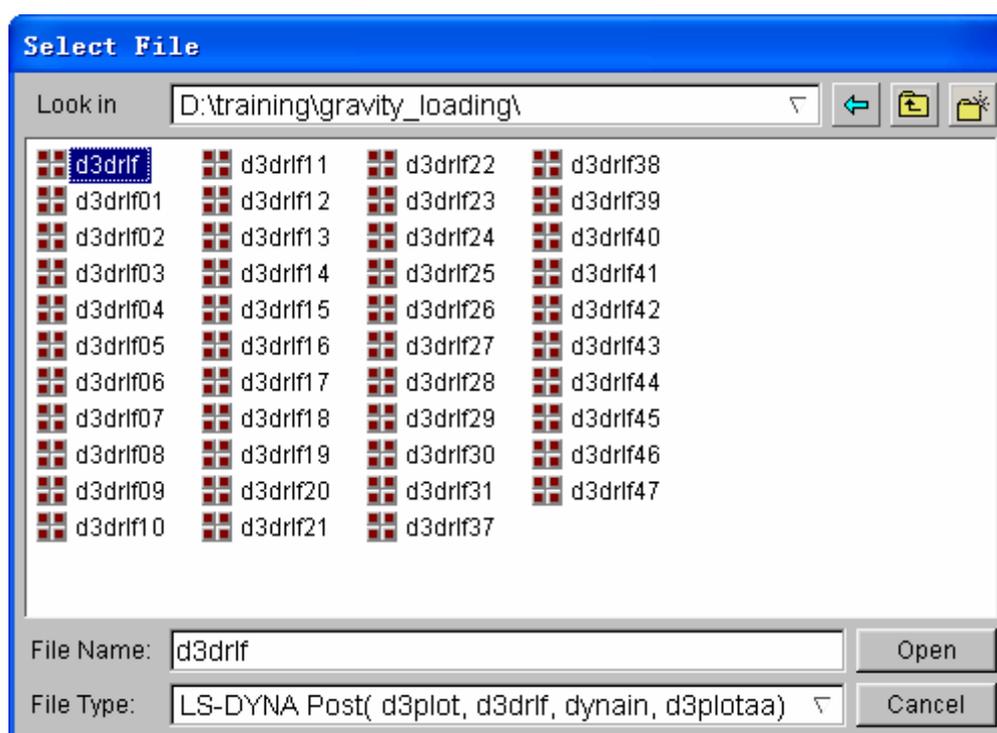


Figure 4.32 Open file dialog box

2. The default **File Type** is **LS-DYNA Post (d3plot, d3drif, dynain)**. This option enables you to read in the **d3plot**, **d3drif** or **dynain** file. The **d3plot** is output from forming simulation, such as drawing, binder wrap and springback, while **d3drif** is generated during gravity loading simulation. The **dynain** is generated at the end of each simulation. This file contains the deformed blank information.
3. Choose the directory of the result files. Pick the **d3drif** file illustrated in Figure 4.32, and press **Open** button.
4. The d3plot file is now completely read in. You are ready to process the results using the Special icon bar, as shown Figure 4.33.



Figure 4.33 Special icon bar for forming analysis

II. Animating Deformation

1. The default **Plot State** is **Deformation**. In the **Frame** dialog, select **All Frames** and press **Play** button to animate the results. See Figure 4.34

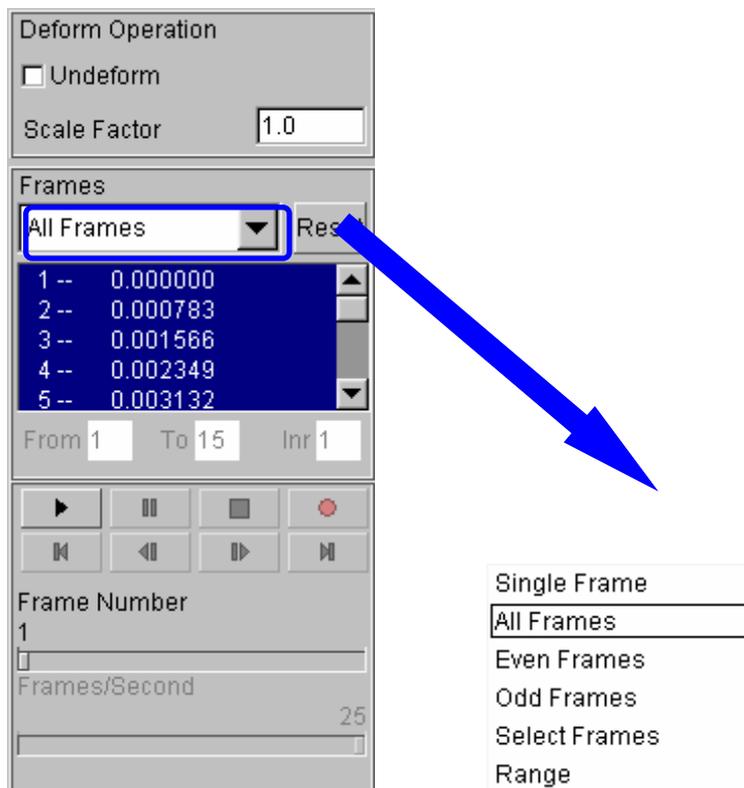


Figure 4.34 Animating deformation dialog box

2. Toggle on the **Shade** checkbox in the display options illustrated in Figure 4.35. The **Smooth Shade** option is also toggled on by default to enable smooth and continuous model display.

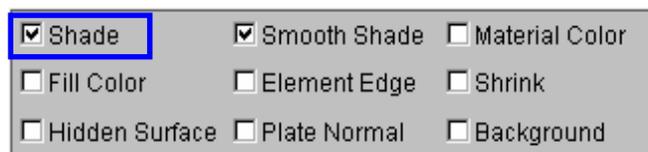


Figure 4.35 Display options

3. From **Icon bar**, select  button to display the PART ON/OFF dialog box illustrated in Figure 4.36.
4. Use your mouse cursor to select **DIE**, following by clicking the **Exit** button to dismiss the dialog box. Now, only the **BLANK** part is displayed in the display area.

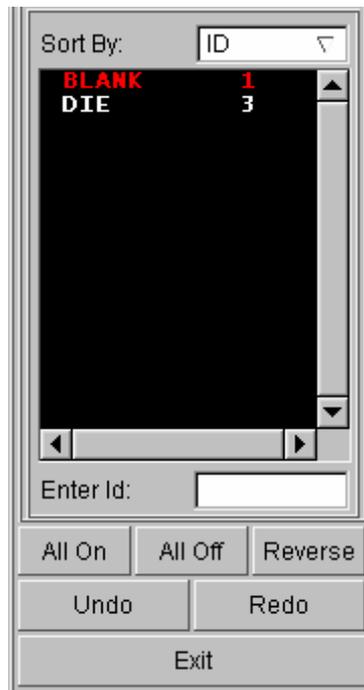


Figure 4.36 Turn parts on/off dialog box

5. You can also change the displayed model using the view manipulation icons on the **Icon bar** illustrated in Figure 4.37.



Figure 4.37 Icon bar

III. Animating Deformation, Thickness and FLD

In eta/POST, you can animate deformation, thickness, FLD and various strain/stress distribution of the blank. Refer to the following examples for animation.

Thickness/Thinning

1. Select  icon from the Special icon bar.
2. Select **Current Component** from combo box, either THICKNESS or THINNING, as illustrated in Figure 4.38.
3. Click **Play** button to animate the thickness contour.
4. Use your mouse cursor to move the slider to set the desired frame speed.
5. Click **Stop** button to stop the animation.

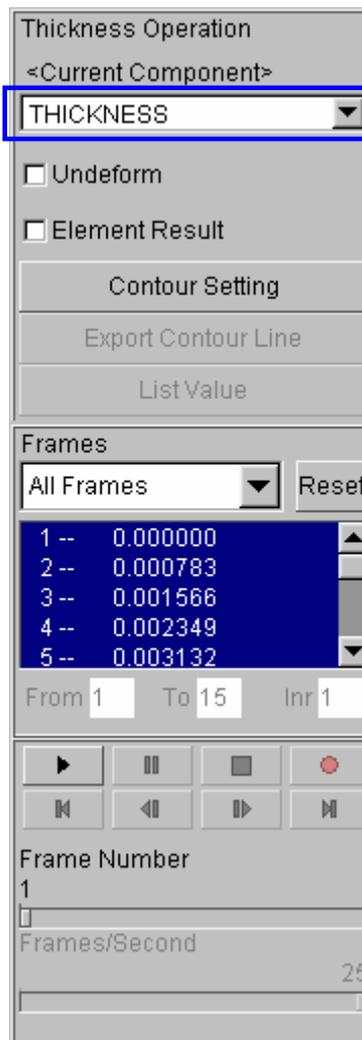


Figure 4.38 Thickness/Thinning dialog box

IV. Plotting Single Frames

Sometimes, it is much convenient to analyze the result by viewing single frames rather than the animation. To view single frame, select **Single Frame** option from

the **Frames** combo box illustrated in Figure 4.39. Then, use your mouse cursor to select the desired frame from the frame list. You can also drag the slider of frame number to select the frame accordingly.

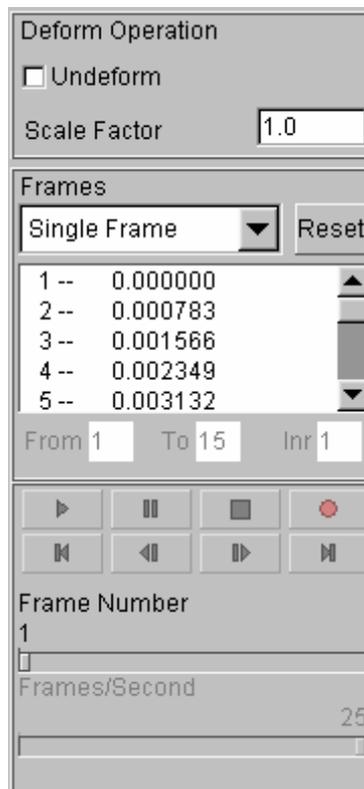


Figure 4.39 Display of single frame

V. Writing an AVI and E3D File

eta/POST provides a very useful tool that allows you to automatically create an **AVI** movie and/or **E3D** files via an animation of screen capture. The **Record** button illustrated in Figure 4.40 is commonly utilized to generate AVI movie and/or E3D files. This is the last function covered in this application example.

AVI movie

The following procedure is used to generate an AVI movie file.

1. Start a new animation (thickness, FLD, etc) using the procedure provided in Section III.
2. Display the model in isometric view.
3. Click the **Record** button.
4. The **Select File** dialog box is displayed.

5. Enter a name of the **AVI** movie file (e.g. traincase.avi) at the input data field of File Name illustrated in Figure 4.41.
6. Then, click **Save** button.
7. From the dialog box illustrated in Figure 4.42, select **Microsoft Video 1** from the **Compressor** list and click **Ok** button.
8. eta/POST will take a screen capture of the animation and write the output.

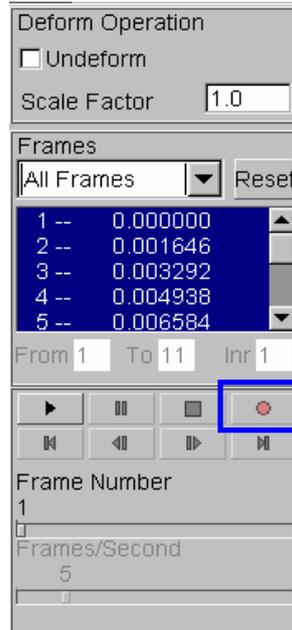


Figure 4.40 AVI dialog box

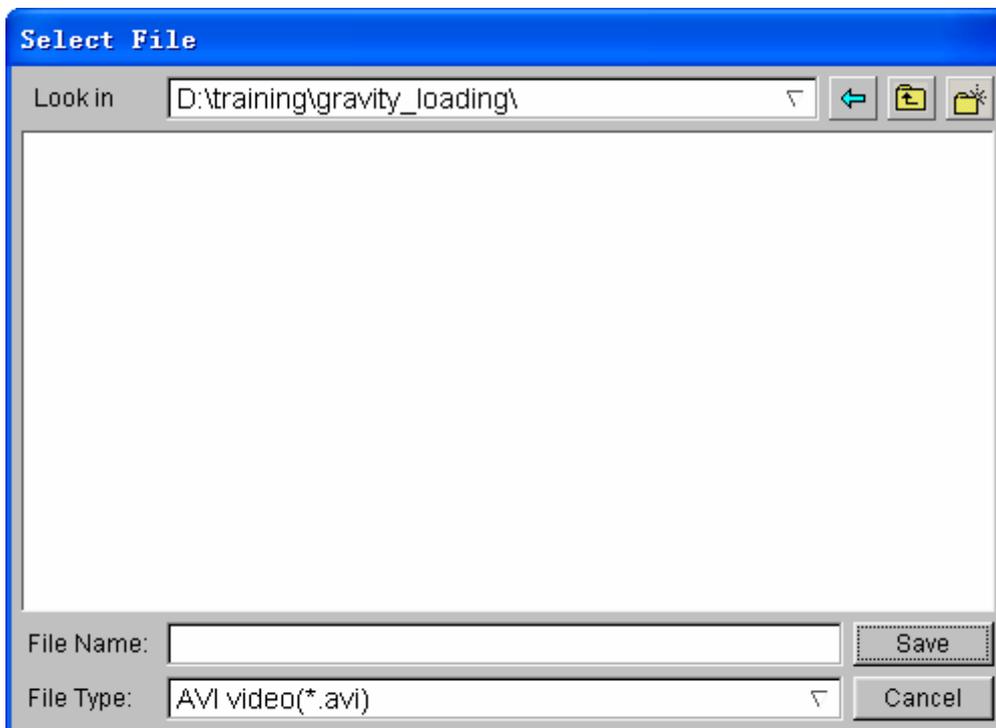


Figure 4.41 Save AVI file

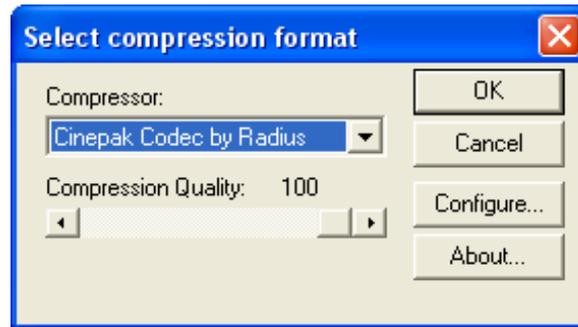


Figure 4.42 Select compression format

E3D file



You can also save simulation results in a much compact file format (*.e3d). The *.e3d file can be viewed using **eta/3DPlayer** which is provided as a free software to any users.

To create an E3D file, refer to the steps listed below:

1. Start a new animation (thickness, FLD, etc) using the procedure provided in Section III.
2. Display the model in isometric view.
3. Click the **Record** button.
4. The **Select File** dialog box is displayed.
5. Click the drop-down button of File Type to select **E3D Player file (*.e3d)**.
6. Enter a name of the **E3D** file (e.g. traincase.e3d) at the input data field of File Name.
7. Then, click **Save** button.
8. eta/POST will take a screen capture of the animation and write the output into *.e3d format.

You can view 3D simulation results using the player. To start the player, select Start→All Programs→Dynaform 5.5→Eta3DPlayer.

Example 5. Single Action - Tailor Welded Blank

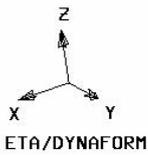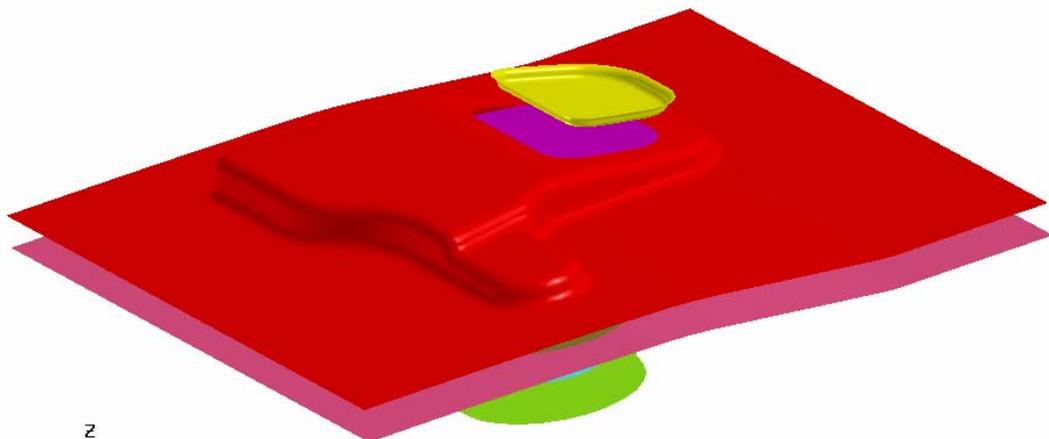

DATABASE MANIPULATION

Creating an eta/DYNAFORM Database and Analysis Setup

Start eta/DYNAFORM 5.5

For workstation/Linux users, enter the command “**df55**” (default) from a UNIX shell. For PC users, double click the **eta/DYNAFORM 5.5 (DF55)** icon from the desktop.

After starting **eta/DYNAFORM**, a default database **Untitled.df** is created. You begin by opening an existing database.

Import file

1. From the menu bar, select **File→Import** to open the IMPORT FILE dialog box illustrated in Figure 5.1, Next, Click the drop-down button of File Type and select “**IGES(*.igs;*.iges)**”. Then, go to the training input files located in the CD provided along with the eta/DYNAFORM installation. Locate the data file: **single_action_weld.igs**.
2. select the data file, following by clicking the **Import** button. Now, the model illustrated in Figure 5.2 is displayed on the display area.

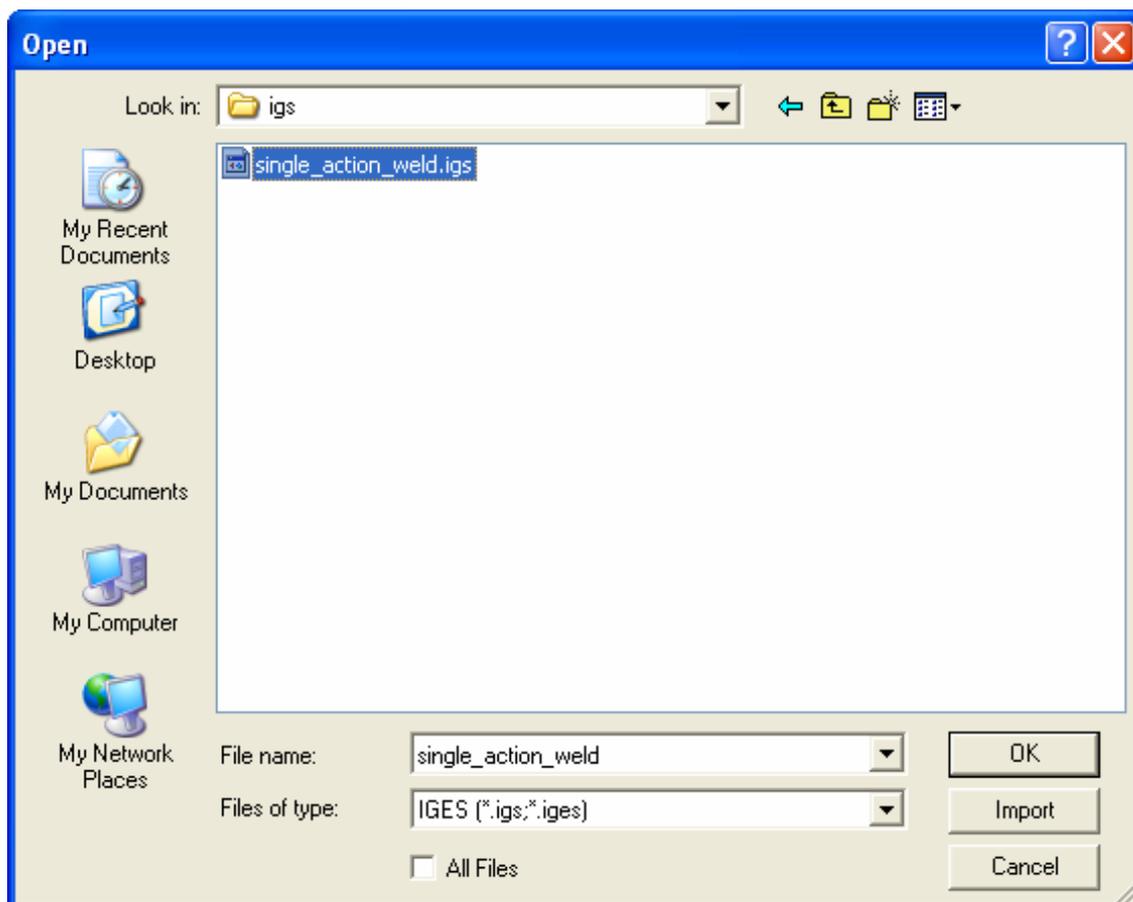


Figure 5.1 Open file dialog box

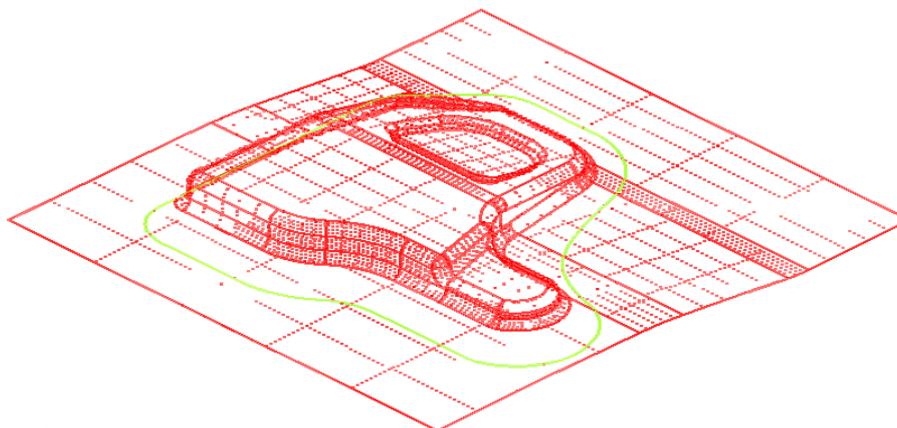


Figure 5.2 Illustration of model in Exercise 5

Note: Icons may appear different depending on platform. Other functions on the **Icon bar** are further discussed in next section. You can also refer to the *eta/DYNAFORM User's Manual* for information about the **Icon bar** functions.

Save the database

1. Click **Save** icon from the **Icon bar** to pop up SAVE AS dialog box illustrated in Figure 5.3.
2. Next, type in **single_action_weld** in the input data field of File Name, following by clicking **Save** button to save the database.

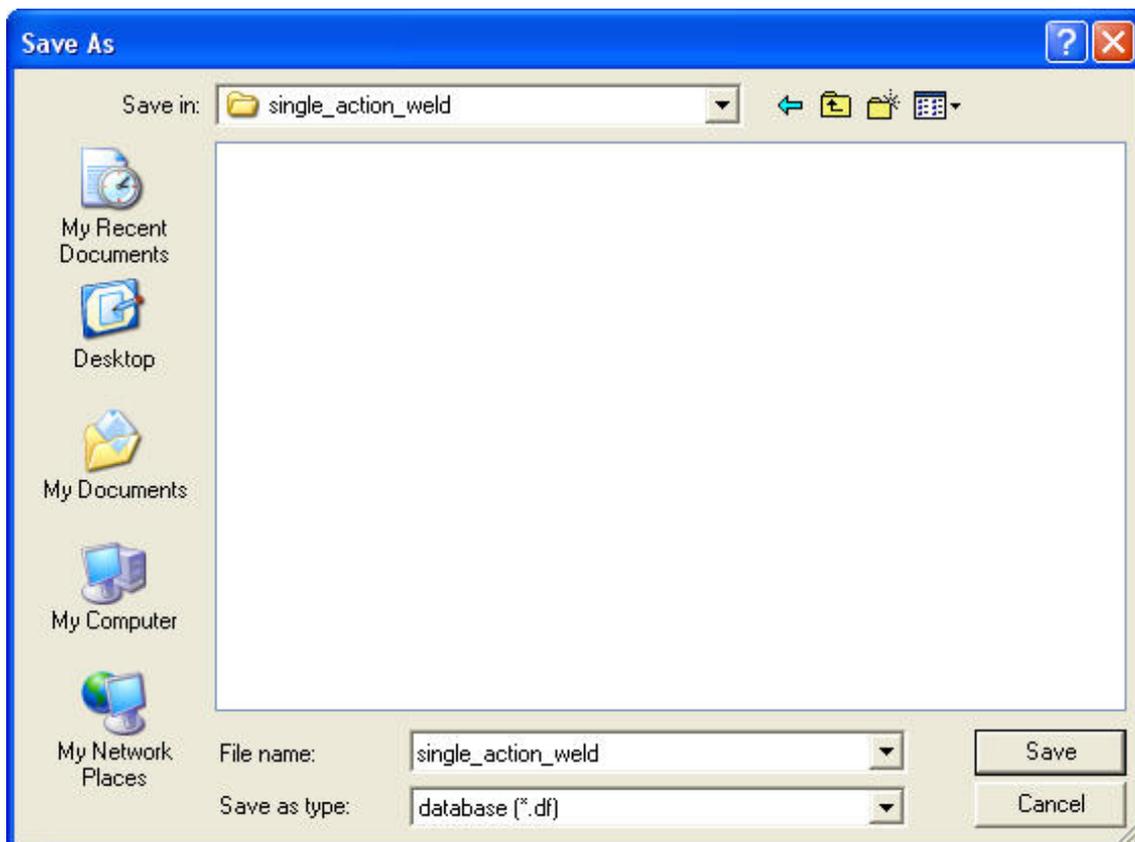


Figure 5.3 Save As dialog box

Edit parts

For ease of identifying each part, modify the name of each part using the Edit Part dialog box, as illustrated in Figure 5.4. Now, you have 2 parts, namely BLANK, and DIE listed in the part list.

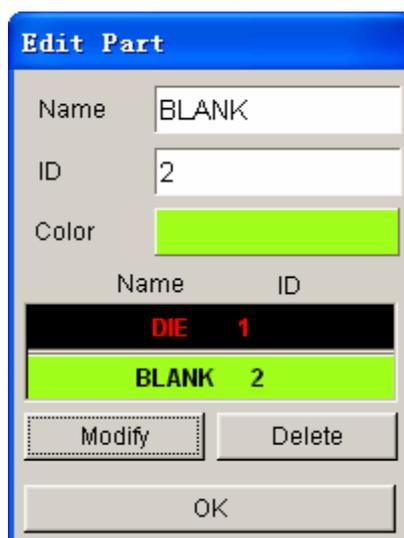


Figure 5.4 Edit part dialog box

Database Unit

From the menu bar, select **Tools**→**Analysis Setup**. The default unit system for a new eta/DYNAFORM database is **mm, Newton, second, and Ton**.

MESHING

To curve mesh or surface mesh is an essential step contributing to successful simulation. There are various methods of creating mesh, however, only Blank Generator and Surface Mesh will be introduced to generate meshes in this manual.

I. Blank Meshing

Blank meshing is the most important mesh function since the accuracy of the forming results depends heavily upon the quality of blank mesh. This manual offers one special function for blank meshing.

1. Select **Tools**→**Blank Generator**→**BOUNDARY LINE**. See Figures 5.5~5.6.
2. Select the **BOUNDARY LIN** among lines in **Selection Option** dialog box.

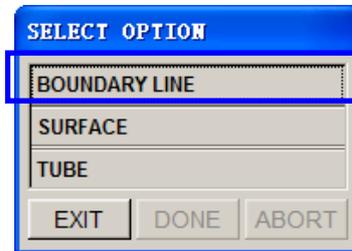
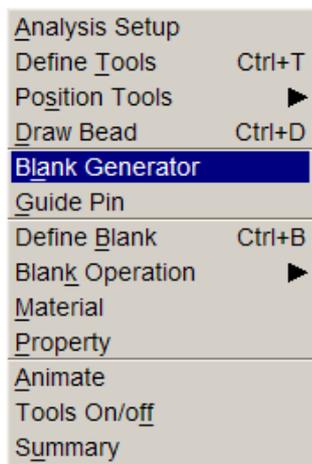


Figure 5.5 Blank generator menu

Figure 5.6 Select option

3. The SELECT LINE dialog box is shown as Figure 5.7.

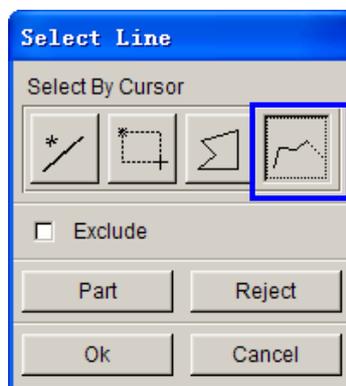


Figure 5.7 Select line

- Shift the method of Select Line into the fourth option and select any line on the BLANK, and then all curves connected with the selected curves are all chosen. You can also select curves by using different methods available in SELECT LINE dialog box. You can place the cursor over each icon and button to identify its function.
- After selection, click **OK** button to open concerned tool radii dialog box. See Figure 5.8.
- Use the default variable (6.0) for the concerned tool radii, the shortest radii in the model. The shorter the radii, the finer the blank mesh; the longer the radii, the coarser the blank mesh.

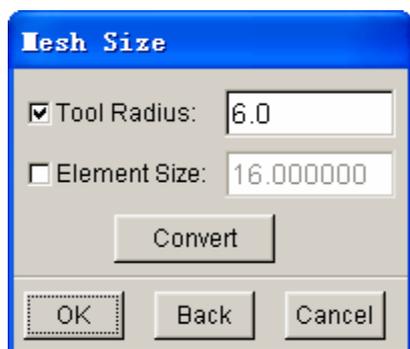


Figure 5.8 Mesh size dialog box

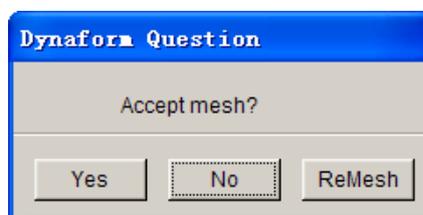


Figure 5.9 Question dialog box

- Click **OK** button to confirm the radii. **Dynaform Question** dialog box prompts “**Accept Mesh?**”, as shown in Figure 5.9. Click **Yes** button to accept the generated mesh.

Note: The user can click **ReMesh** to correct the concerned tool radii value and accept the mesh, or click **No** button to cancel it and repeat the above steps to re-mesh, if he has entered an incorrect value,

- Compare the generated mesh with Figure 5.10.
- Save the database.

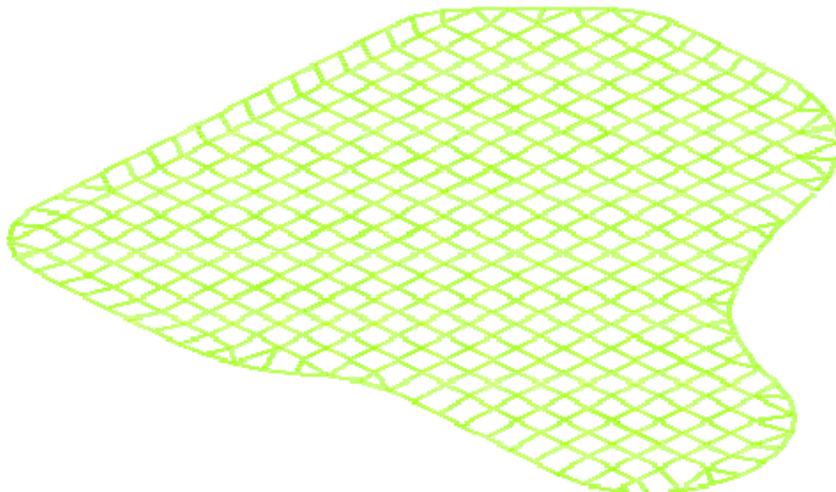


Figure 5.10 Blank meshing

II. Surface Meshing

Most meshes in eta/DYNAFORM is created by **Surface Mesh**. This function will automatically create a mesh based on the provided surface data, which is one quick and convenient meshing tool.

1. Close **BLANK**, open **DIE** and set **DIE** as current part.
2. Select **Preprocess**→**Elements**. See Figure 5.11.

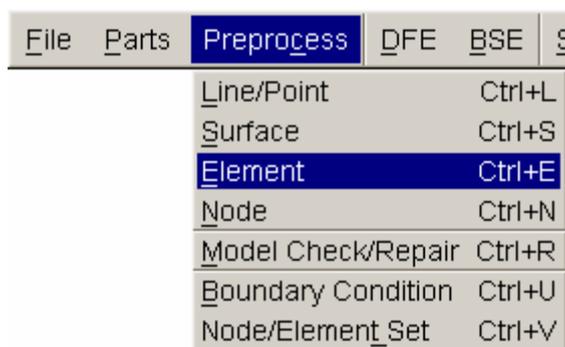


Figure 5.11 Element menu

3. Select **Surface Mesh** icon from **ELEMENT** dialog box shown in Figure 5.12.

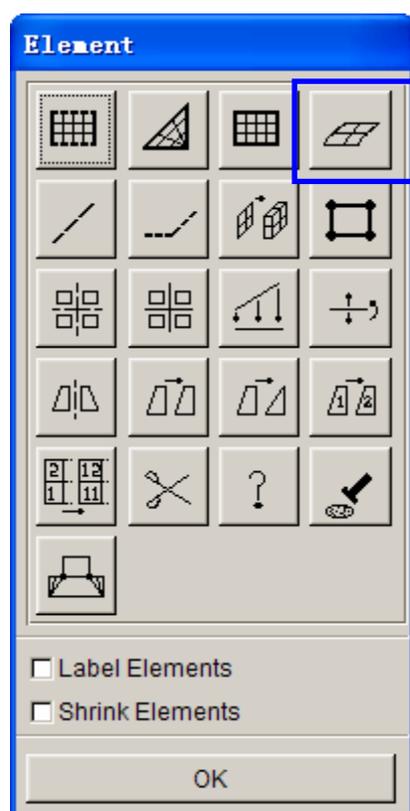


Figure 5.12 Element dialog box

4. In SURFACE MESH dialog box, modify the **Max. Size** to **10**.
5. Toggle off **in Original Part** option and the **Boundary Check** option.
6. Click **Select Surfaces** in SURFACE MESH dialog box. See Figure 5.13.
7. Click Displayed **Surf** in SURFACE MESH dialog box. See Figure 5.14.
8. Click **Apply button** in the SURFACE MESH dialog box.

Note: *Chordal deviation* controls the number of elements along the line/surface curvature;

Angle controls the direction of the feature line;

Gap Tol. Controls whether two adjacent surfaces are connected.

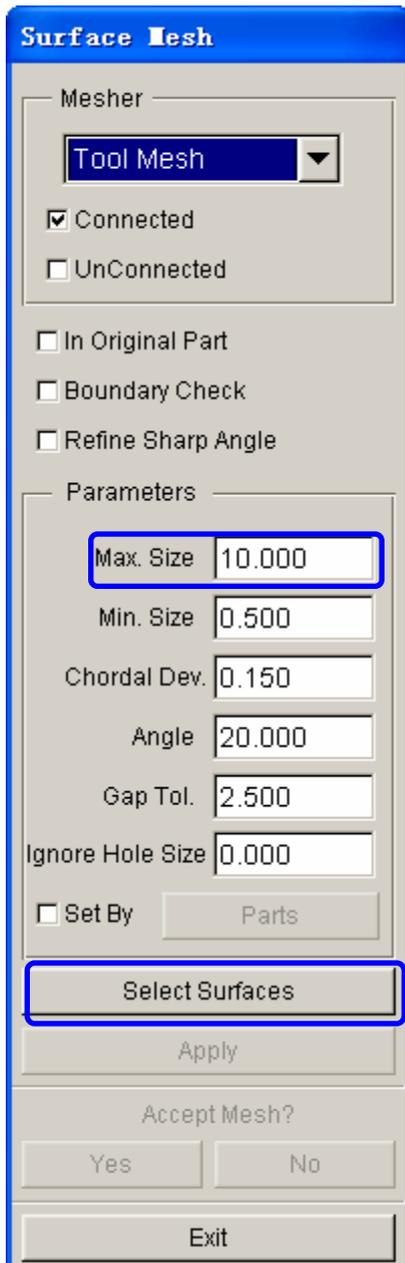


Figure 5.13 Surface mesh

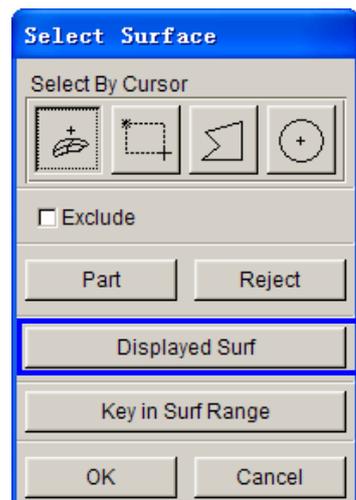


Figure 5.14 Select surface

Note: All displayed surfaces are highlighted in white, indicating that they have been selected. The dialog window allows you to select the surface(s) in different ways. Place the cursor over each icon to identify its specified function.

- The generated mesh is white. Click **Yes** when prompted, “**Accept Mesh?**” in the SURFACE MESH dialog box. Then, compare the mesh with Figure 5.15.

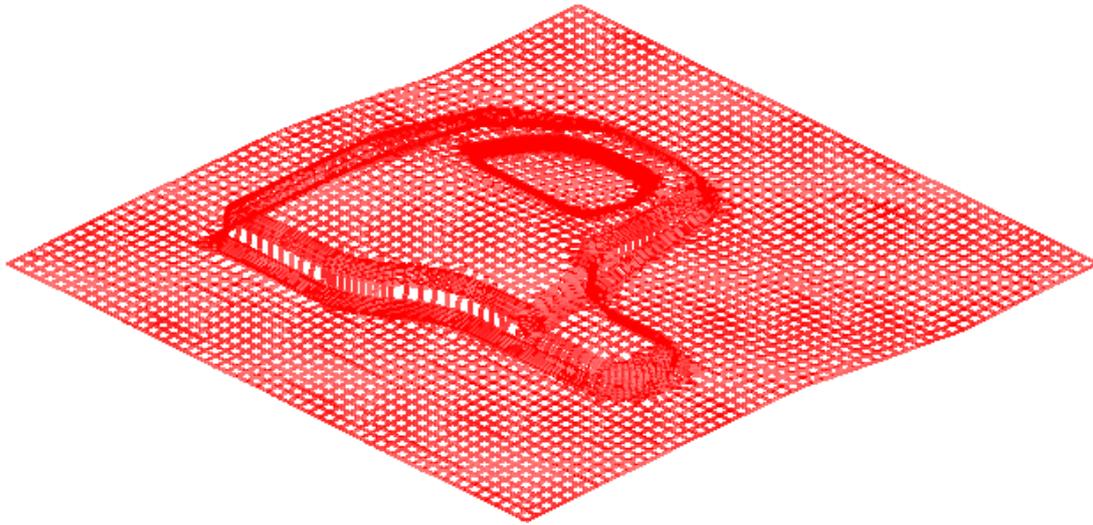


Figure 5.15 After part meshing

10. Click **Exit** button in **Surface Mesh** to exit, and then save the database.

Now, all parts have been meshed. You may toggle off the checkbox for Surface and Lines in Display Options to hide the lines and surfaces. It easier to view the mesh.

III. Mesh Checking

As the mesh has been created, its quality has to be checked to verify that there aren't any defects that could cause potential problems in the simulation.

All the tools used for checking the mesh are located in the **Preprocess**→**Model Check/Repair** on the Menu bar, which can be accessed by choosing Preprocess→Model Check/Repair or Ctrl+R. See Figure 5.16.

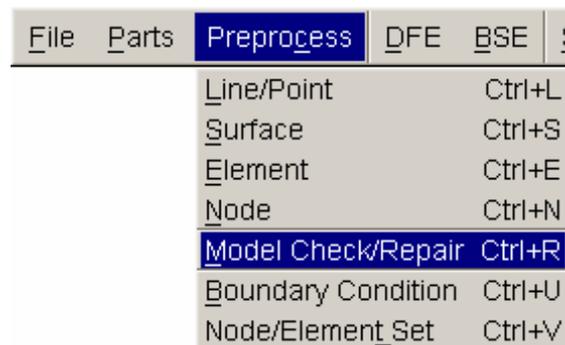


Figure 5.16 Model check/repair

As shown figure 5.17, the Model Check /Repair dialog box consists of some functions that enable you to check the quality of mesh. Only three of the functions are described in this training manual. Please refer to **eta/DNAFORM Online Help** for more information about other functions.

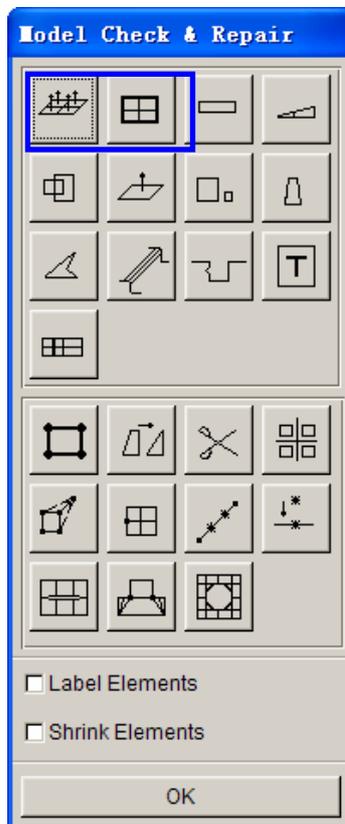


Figure 5.17 Model check/repair dialog box

Auto Plate Normal



1. Select **Model Check/Repair** → **Auto Plate Normal** from the dialog to open a new dialog box.
2. The dialog that appears prompts the user two options: **SURSOR PICK PART AND ALL ACTIVE PARTS**, which is the default option. Under the default condition, you may select any element to adjust the normal direction consistency of all activated parts. Otherwise, you may choose the other option and select one element of any part that needs checking to adjust this part's normal direction consistency. In this example, select any element of DIE as reference element.
3. An arrow that appears on the screen shows the normal direction of the selected element. A prompt will ask **“IS Normal direction acceptable?”**. See Figures 5.18~5.19.

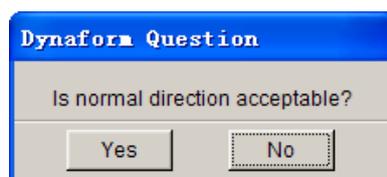


Figure 5.18 Question dialog box

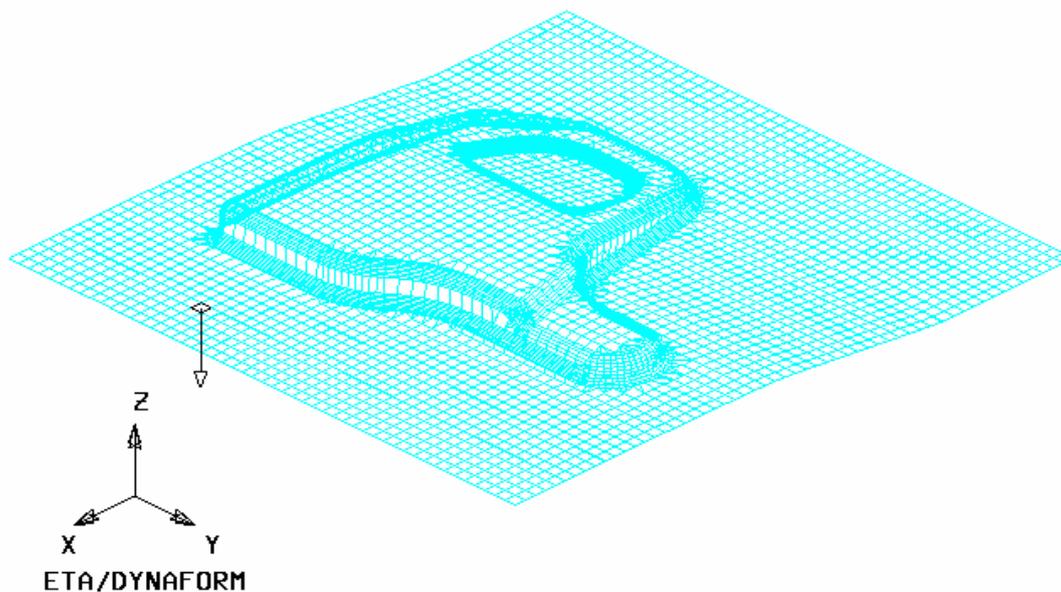


Figure 5.19 Normal direction of the selected element

Pressing the **YES** button will check all elements in the part and reorient the normal direction of all elements according to the displayed direction.

Pressing the **NO** button will check all elements and reverse the normal direction of all elements according to the displayed direction.

In the example, **NO** button is pressed. In fact, As long as the normal direction of most elements in a part is consistent, the program will accept that; if the normal direction of half of the total element is pointing upward and if that of the other half is pointing downward, the program will be unable to correctly constrain the blank through contact. To avoid such problems, you should check the consistency of the normal direction.

4. After validating the normal direction of elements, save the database.

Display Model Boundary

This function can check the gap, hole or collapsed element on the mesh, and highlight them, which can help the user to repair these defects.

1. Select **Model Check** ➔ **Display Model Boundary**

Minor gaps in the tool mesh (punch, die etc) are acceptable. However, blank mesh should not contain any gaps or holes unless the blank is lanced or is designed with gaps. Select the isometric view and then compare it with below Figure 5.20 to detect the boundary.

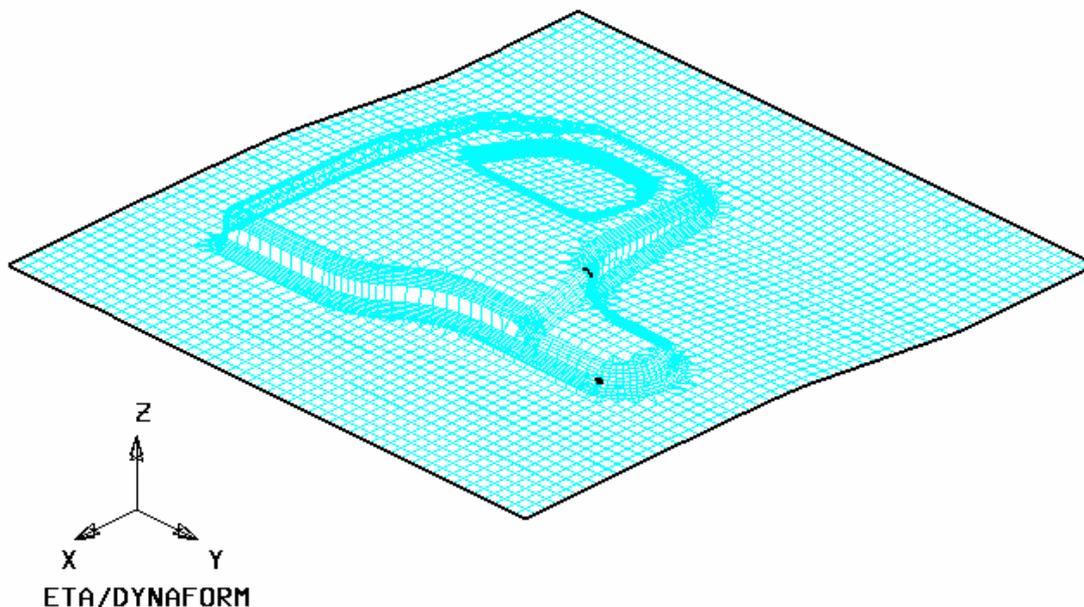


Figure 5.20 Model boundary check

2. Toggle off the checkbox of Elements and Nodes from the **Display Options** dialog at right corner of the screen (**Note**: the boundary lines are still displayed). This enables you to detect those minor gaps that might be difficult to detect when the mesh is displayed. If other white lines are also displayed, besides the boundary, you should repair the defective mesh accordingly. See Figure 5.21.
3. From the following picture, a boundary is seen to be in the middle of the part. Therefore, you should use the local zoom to position the boundary. Then, select the repair tools to modify the meshes in the interior boundary.

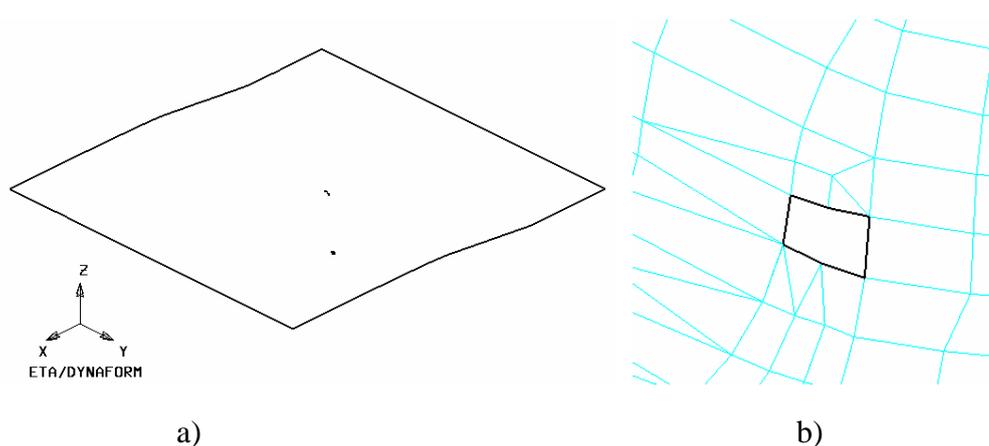


Figure 5.21 Boundary line check

4. Use other repair functions to check those overlapping or minimum-size elements. Delete the duplicated elements if they were found.
5. Turn off all parts except DIE. Click the **Clear** icon in the **Icon bar** to remove the boundary.
6. Save the database.

AUTO SETUP

Prior to entering **AUTOSETUP** interface, upper/lower tool meshes are required. The other operation can be carried out in AutoSetup interface, such as **PHYSICAL OFFSET** of element, selection of **CONTACT OFFSET**. As illustrated in Figure 5.3, you can select **AUTOSETUP** option from the **SETUP** menu to display the **AUTOSETUP** interface.

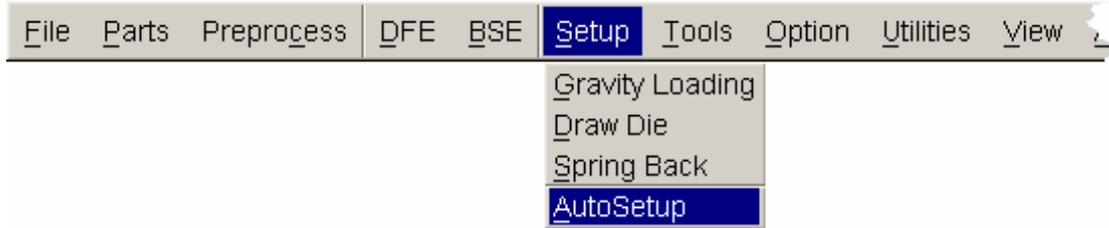


Figure 5.22 Setup menu

I. New Simulation

Click **AutoSetup** in the menu bar to display the NEW SIMULATION dialog box, as illustrated in Figure 5.23. You continue with defining basic parameters such as blank thickness, type of process, etc from the dialog box.

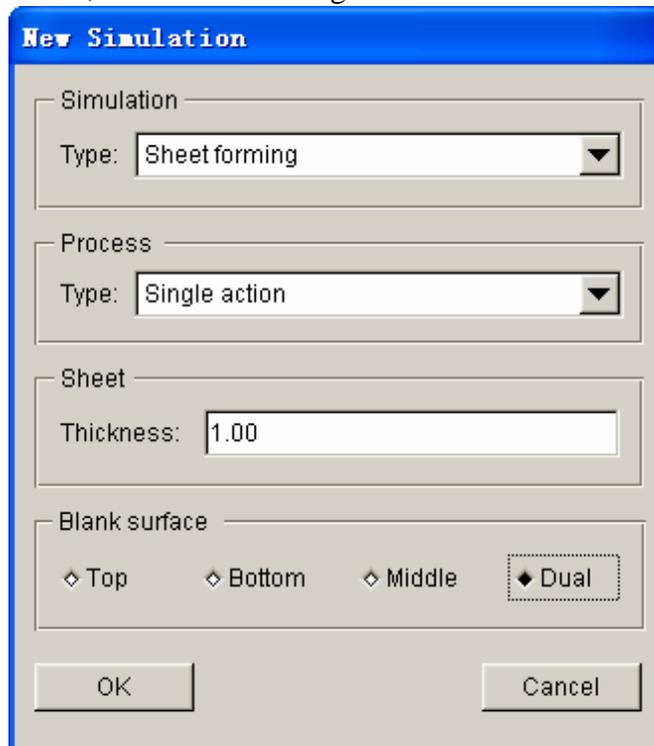


Figure 5.23 New simulation dialog box

1. Select simulation type: **Sheet Forming**.

2. Select process type: **Single Action**.
3. Input blank thickness: 1.0 (mm).
4. Select tools reference: **Dual**.
5. Click **OK** to display the main **AUTOSETUP** dialog box.

II. General

After entering **General** interface, you do not need to modify any parameters except for typing in **single_action_weld** in input data field of **Title**. In addition, you can type in some comments about the setting/process in the **Comment** input field, as illustrated in Figure 5.24.

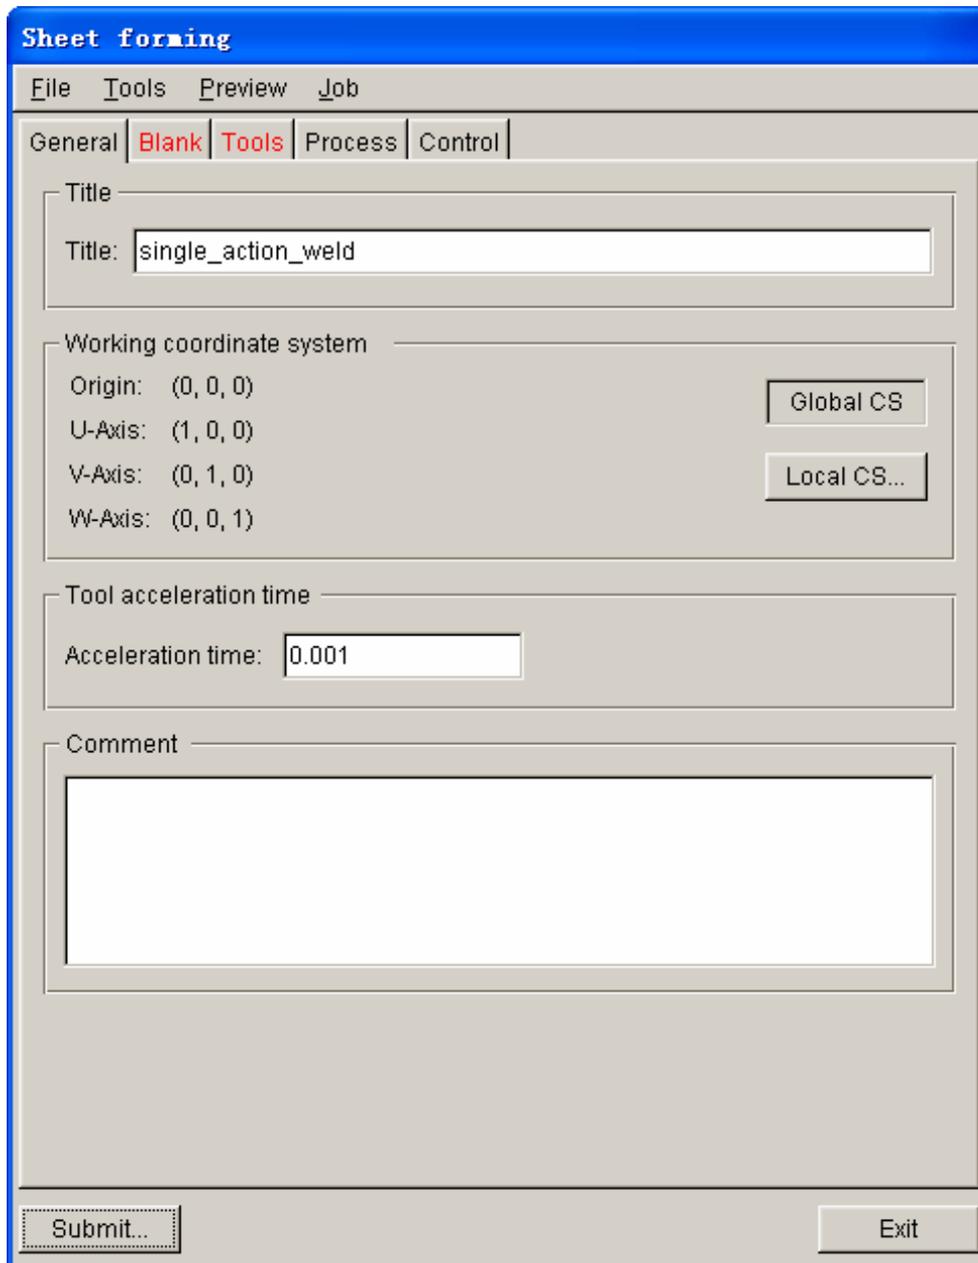


Figure 5.24 General interface

III. Blank Definition

1. Press the **Blank** tab to display the blank definition interface.
2. Then, click **Parts...** button from **Geometry** in blank definition interface. See Figure 5.25. The program will pop up the DEFINE GEOMETRY dialog box illustrated in Figure 5.26.

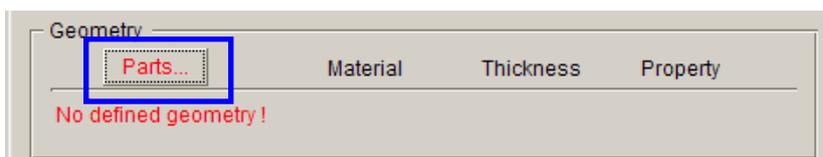


Figure 5.25 Define blank

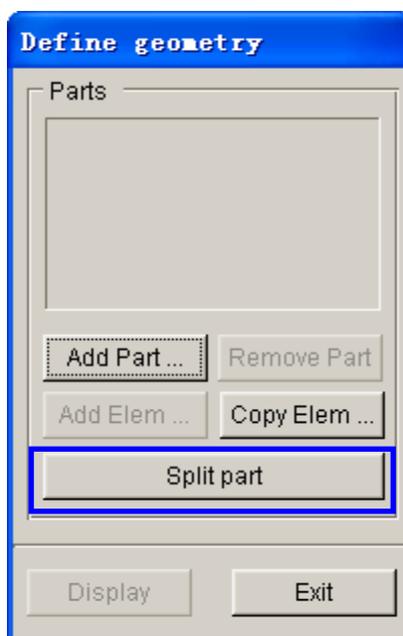


Figure 5.26 Define geometry dialog box

3. Click **Add Part...** to select the **blank** illustrated in Figure 5.27.
4. Click **Split part** button to display the SELECT ELEMENTS dialog box illustrated in Figure 5.29. From the dialog box, press **Drag Window** icon to select elements highlighted in Figure 5.30.
5. Click **OK** button to complete the **Split part** operation. The selected elements are copied to a new part named **BLK00000**. The part is automatically included in the blank geometry list illustrated in Figure 5.31.

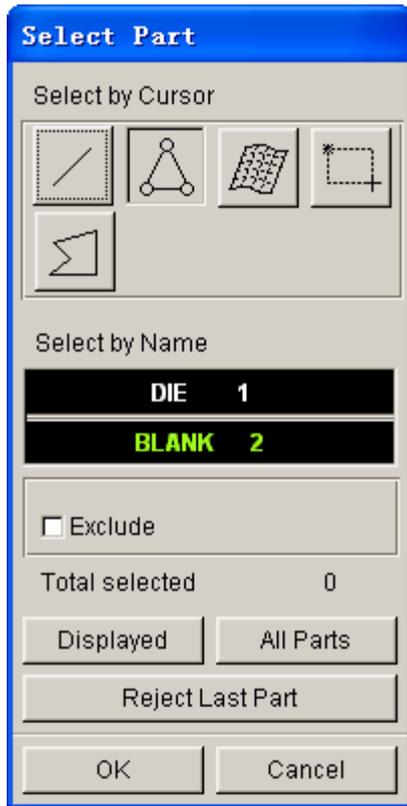


Figure 5.27 Select Part dialog box

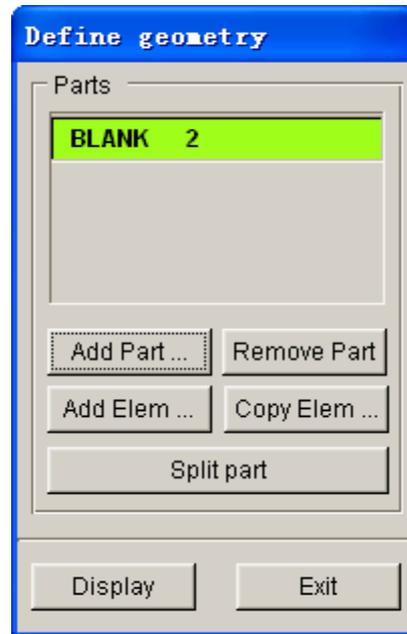


Figure 5.28 Blank geometry list

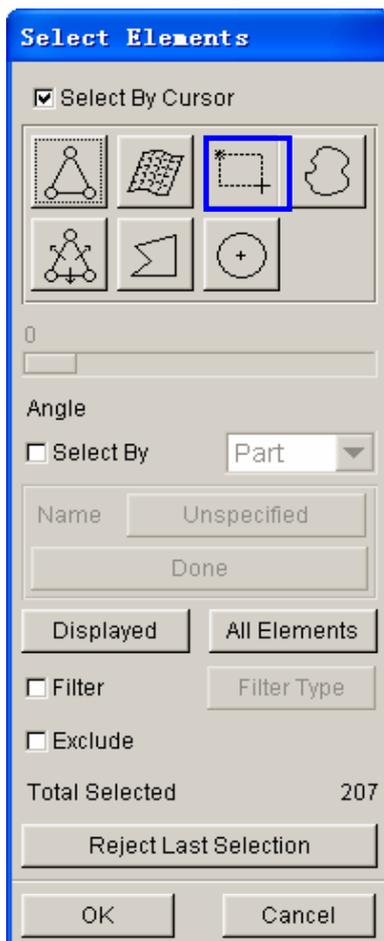


Figure 5.29 Select elements dialog box

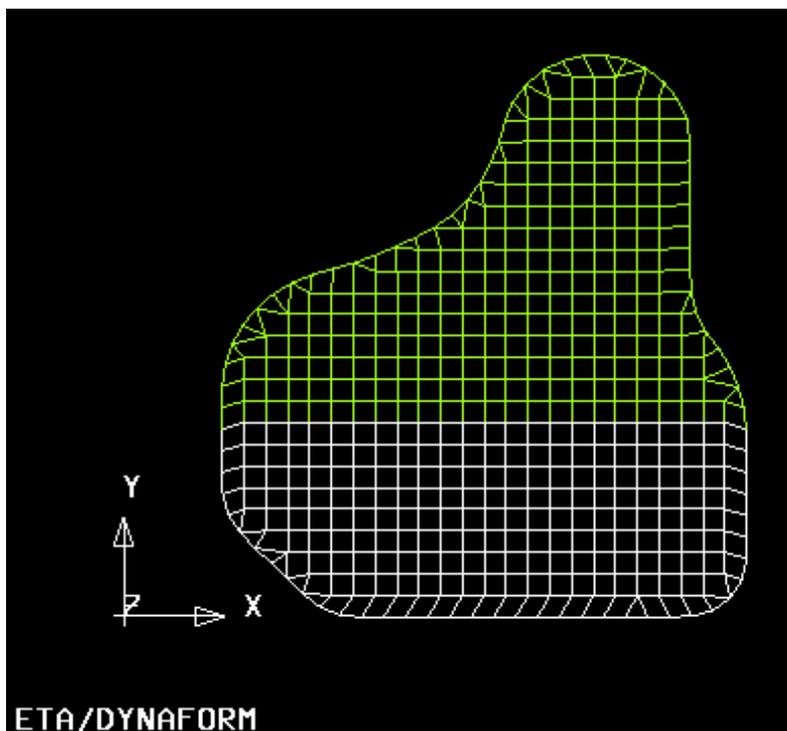


Figure 5.30 Selected elements

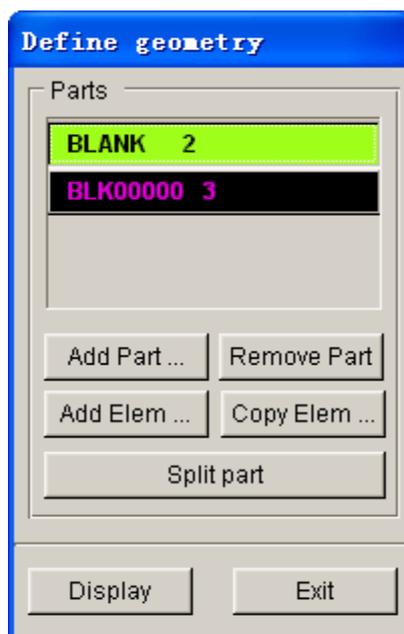


Figure 5.31 Blank geometry list

- Click **Exit** to return to the Blank definition interface illustrated in Figure 5.32.



Figure 5.32 Blank definition interface

IV. Blank Material and Weld Definition

Define geometry

Once the **BLANK** part is defined, the program automatically assigns a default blank material and relative property. You can also press the **BLANKMAT** button illustrated in Figure 5.32 to edit material definition.

After clicking the **BLANKMAT** button, the **MATERIAL** dialog box illustrated in Figure 5.15 is displayed. You can create, edit or import material into the database. Moreover, you can press the **Material Library...** button to select generic material database provided by eta/DYNAFORM. Click on the **Material Library...** button to

select the United States material library illustrated in Figure 5.33.

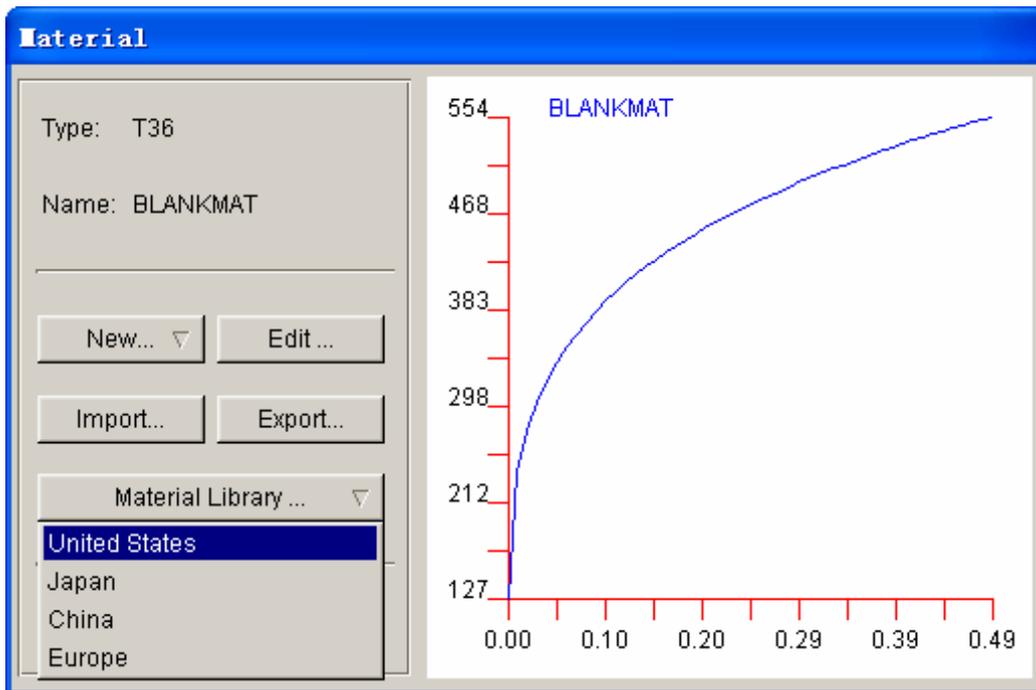


Figure 5.33 Material dialog box

Now, you continue to assign materials to each blank by selecting materials from the United States generic material library shown in Figure 5.16. In addition, the blank thickness for BLK00000 and BLK00001 is 1.80 (mm) and 1.00 (mm), respectively. See Figure 5.34.

Note: You can create your own material or edit the selected material using the functions provided in MATERIAL dialog box.

Material Library									
Material Type	Strength Level	Material Name	T1	T18	T24	T36	T37	T39	T64
STEEL	Mild	DQ	+	+	+	+	+	-	-
		DQSK	+	+	+	+	+	-	-
		DDQIF	+	+	+	+	+	-	-
	Medium	BH180	+	+	+	+	+	+	-
		BH210	+	+	+	+	+	+	-
		BH250	+	+	-	+	+	+	-
	High	HSLA250	+	+	+	+	+	+	-
		HSLA300	+	+	+	+	+	-	-
		HSLA350	+	+	+	+	+	+	-
	Advanced High	DP500	+	+	+	+	+	-	-
		DP600	+	+	+	+	+	-	-
	Hot Rolled	CQ	+	+	+	+	+	-	-
		DQSK	+	+	+	+	+	-	-
		DDQIF	+	+	+	+	+	-	-
	Stainless	SS11CrCb	+	+	+	+	+	-	-
SS18CrCb		+	+	+	+	+	-	-	
SS304		+	+	+	+	+	-	-	
ALUMINUM		AA5182	+	+	+	+	+	-	-
		AA5454	+	+	+	+	+	-	-
		AA5754	+	+	+	+	+	-	-
		AA6061	+	+	+	+	+	-	-

Figure 5.34 United States generic material library

Geometry				
Parts...		Material	Thickness	Property
BLANK	2	DQSK	1.00	NIP=5
BLK00000	3	BH180	1.20	NIP=5

Figure 5.35 Blank material and thickness definition

Define weld

1. Click **Add...** in the Welds field illustrated in Figure 5.36 to display the BLANK WELD dialog box illustrated in Figure 5.37.

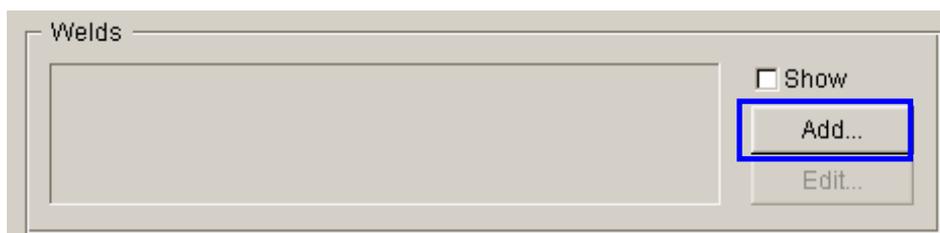


Figure 5.36 Define weld

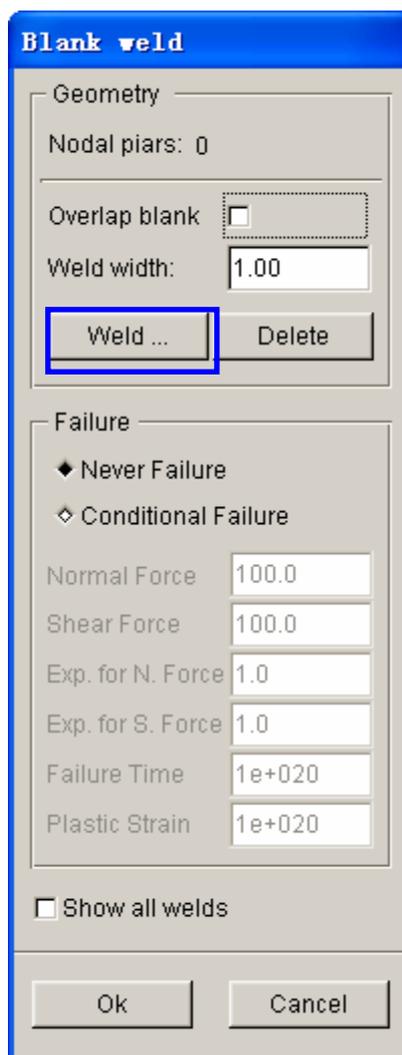


Figure 5.37 Blank weld dialog box

1. Click **Weld...** button to display the SELECT NODE dialog box illustrated in Figure 5.20.
2. Next, using the **Drag window** option to select the boundary nodes between two blanks, as illustrated in Figure 5.38.
3. Click **OK** button to complete the selection. The selected nodes are defined

as welds illustrated in Figure 5.39.

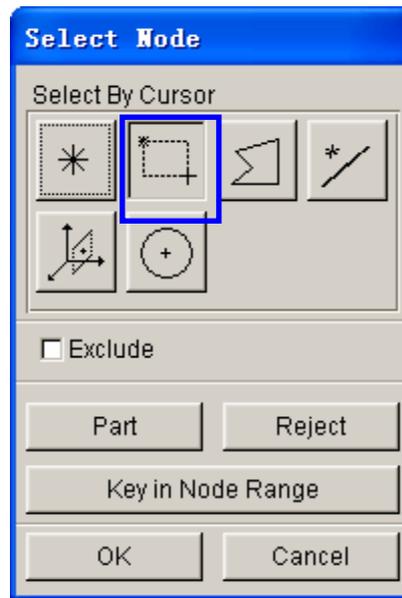


Figure 5.38 Select node dialog box

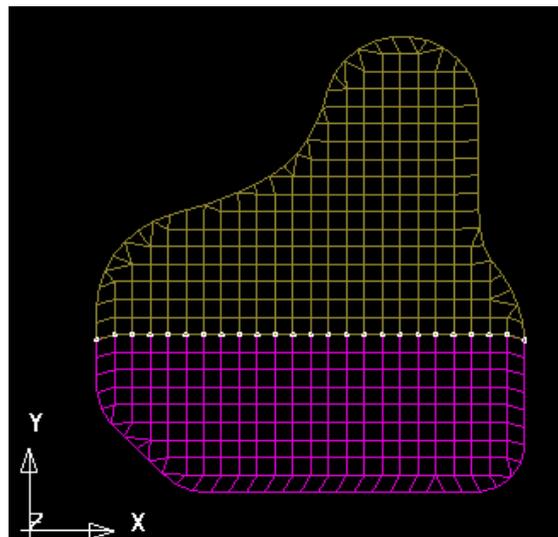


Figure 5.39 Selected nodes

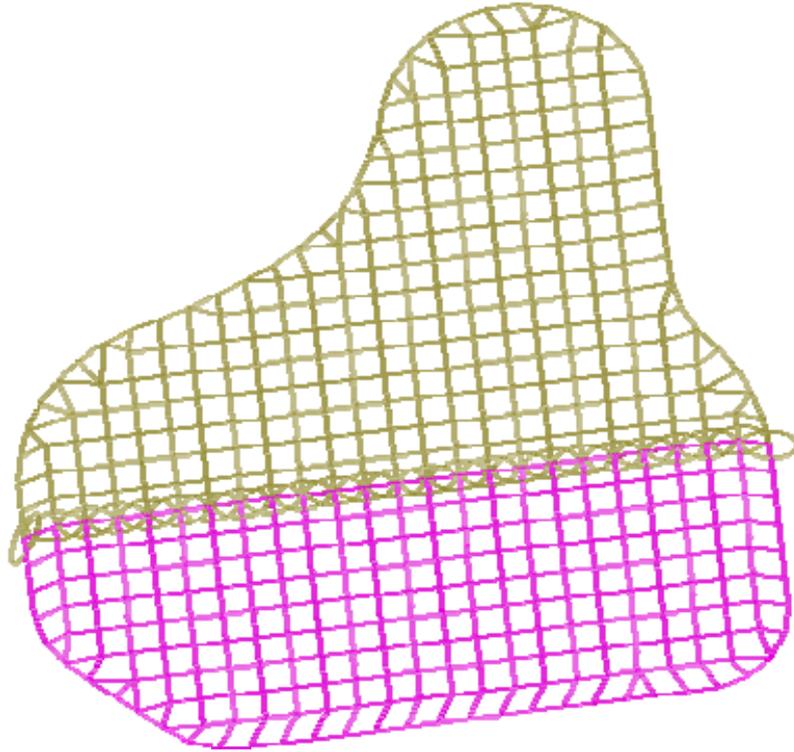


Figure 5.40 Welds

- Click **OK** button in **BLANK WELD** dialog box to return to **AUTOSETUP** interface. You can observe the weld information is listed in the Welds field, as illustrated in Figure 5.41.

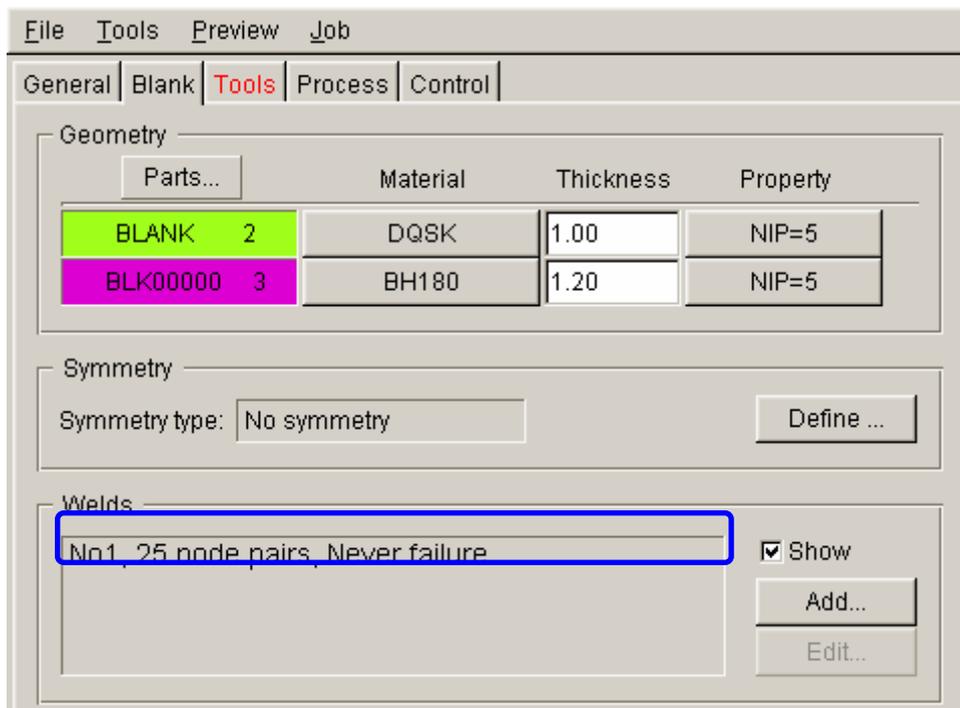


Figure 5.41 Welds definition interface

V. Tools Definition

1. Click on **Tools** tab to display tool definition interface.
2. Click  icon from the **Icon bar**, and turn off the **BLANK** part.
3. Click **OK** button to return to tool definition interface. Based on the defined process, three standard tools: die, punch and binder, are listed at the left side of the tool definition interface. You can continue with definition of each tool. By default, the **die** interface is displayed.
4. Press the **Parts...** button to assign a part as die. See Figure 5.42.

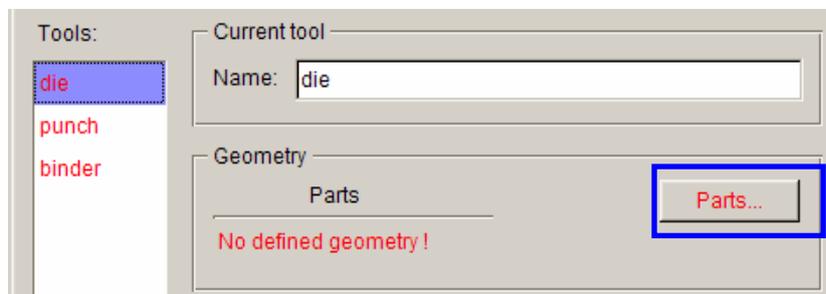


Figure 5.42 Before die definition

5. The DEFINE GEOMETRY dialog box illustrated in Figure 5.43 is displayed. Next, click the **Add Part...** button in the dialog box.



Figure 5.43 Define geometry dialog box

6. Select **DIE** part from the SELECT PART dialog box illustrated in Figure 5.44.

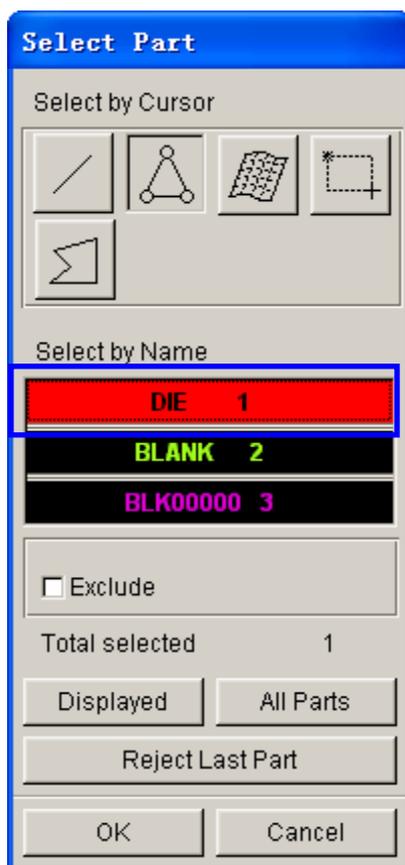


Figure 5.44 Select part dialog box

7. Click **OK** button to return to the DEFINE GEOMETRY dialog box. **DIE** part is added to the list of die. See Figure 5.45.



Figure 5.45 Die geometry list

- Click **Exit** button to return to tool definition interface. Now, you can observe the font color of **die** is changed to BLACK. See Figure 5.46.



Figure 5.46 After die definition

- Click **punch** located at the left side of tools list to display punch definition interface.
- Click **Parts...** button to display the DEFINE GEOMETRY dialog box illustrated in Figure 5.47.
- Click **Copy Elem...** button in the dialog box to display the COPY ELEMENTS dialog box.
- Toggle on the checkbox of **Offset elements** option. The default blank thickness is $1.1 \cdot t_{\max}$. In this example, t_{\max} is 1.20 (mm)

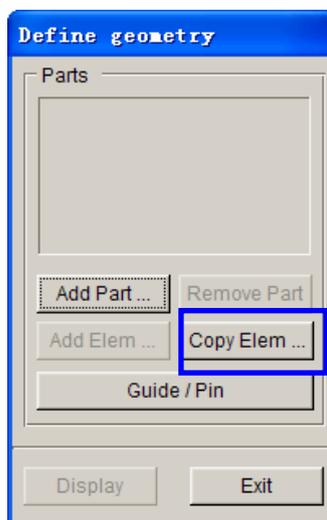


Figure 5.47 Define geometry dialog box

- Next, press **Select...** button to display the SELECT ELEMENTS dialog box.
- Click **DISPLAYED** to select all elements in the display area. Then, toggle on the **Exclude** option, as illustrated in Figure 5.48.

15. Click the **Spread** icon, following by moving the slider to set spread angle as **4°**.
16. Pick an element on the binder surface. You observe the highlighted elements in binder surface are removed. The program prompts that 4464 elements are selected. See Figure 5.48.

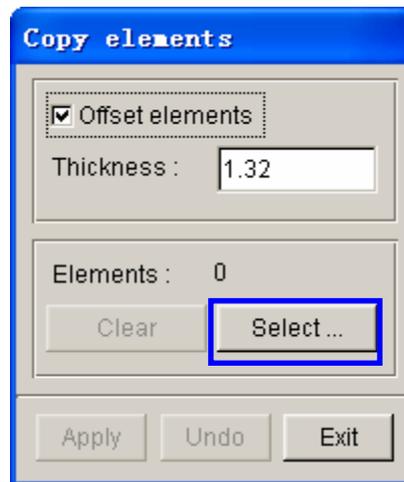


Figure 5.48 Before selecting elements

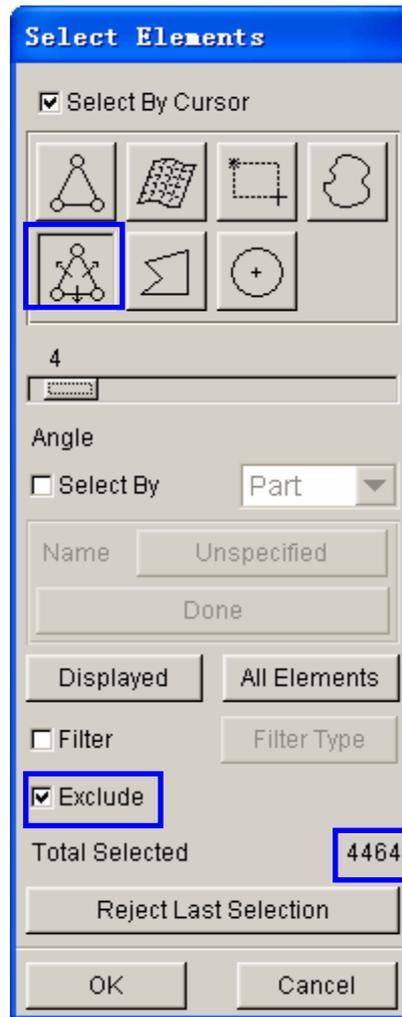


Figure 5.49 Selected elements

17. Click **OK** button to return to the COPY ELEMENTS dialog box. Now, the **Apply** button is enabled. See Figure 5.50.

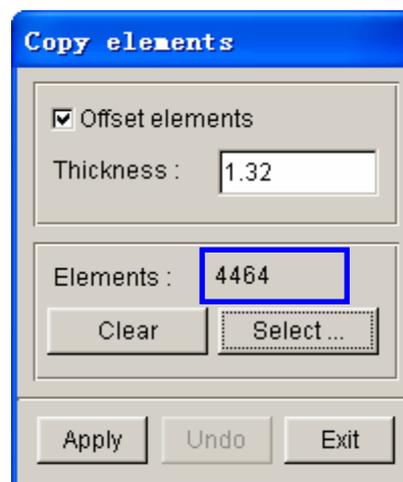


Figure 5.50 After selecting elements

18. Click **Apply** button to offset the selected elements to a new part. See

Figure 5.51.

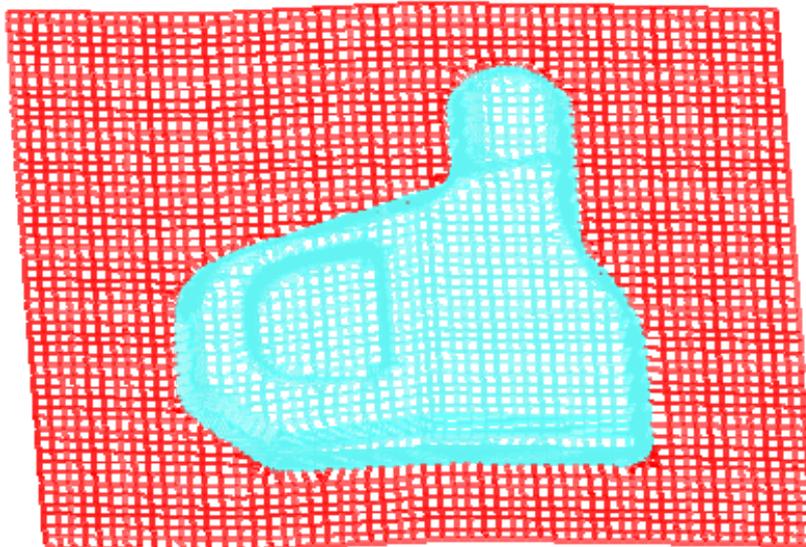


Figure 5.51 Offset elements

19. The new part is added to the list of punch. See Figure 5.52.



Figure 5.52 Punch geometry list

20. Click **Exit** button to return to tool definition interface. The font color of **punch** is also changed to BLACK, as illustrated in Figure 5.53. Since the DUAL option was selected in NEW SIMULATION dialog box, the **None** option is automatically selected in the Contact Offset field

illustrated in Figure 5.53. It means numerical contact offset is not applied to punch.

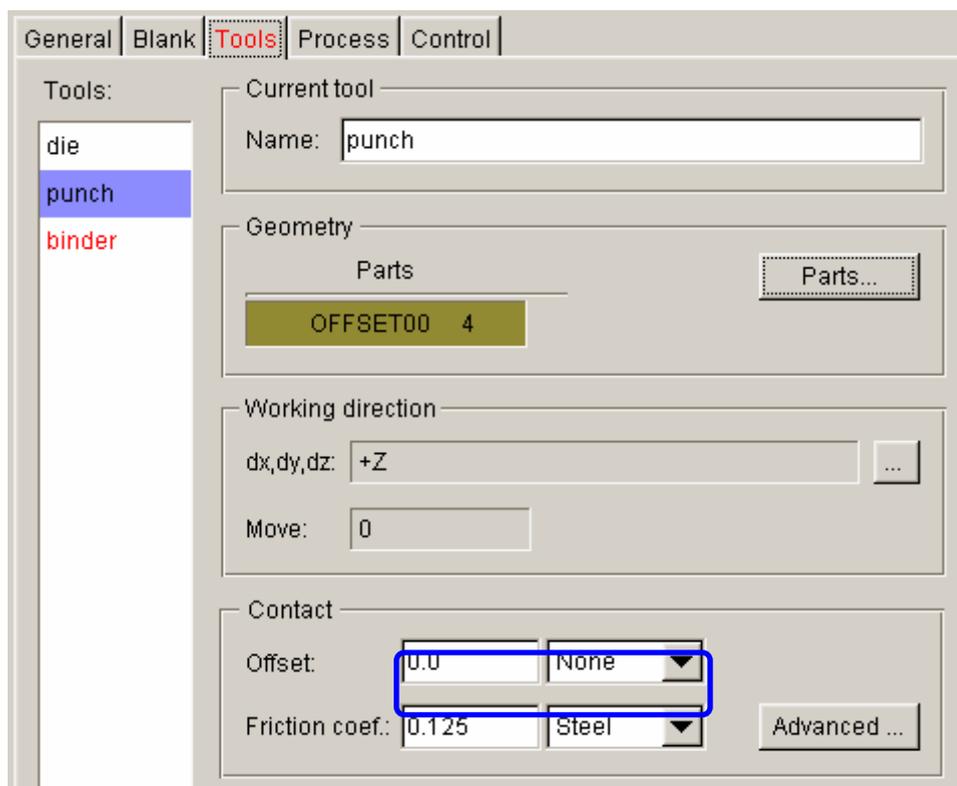


Figure 5.53 Punch definition

21. Click **binder** near the left side of tools interface to display binder definition interface.
22. Press **Parts...** button to display the DEFINE GEOMETRY dialog box.
23. Click **Copy Elem...** button, following by pressing **Select...** button in COPY ELEMENTS dialog box illustrated in Figure 5.54.
24. From the SELECT ELEMENTS dialog box, click Spread icon illustrated in Figure 5.54. Then, use your mouse cursor to move the slider to set spread angle as **4°**.
25. Pick an element on the binder region to highlight all elements of binder surface, as illustrated in Figure 5.55. The program prompts 2014 elements have been selected.

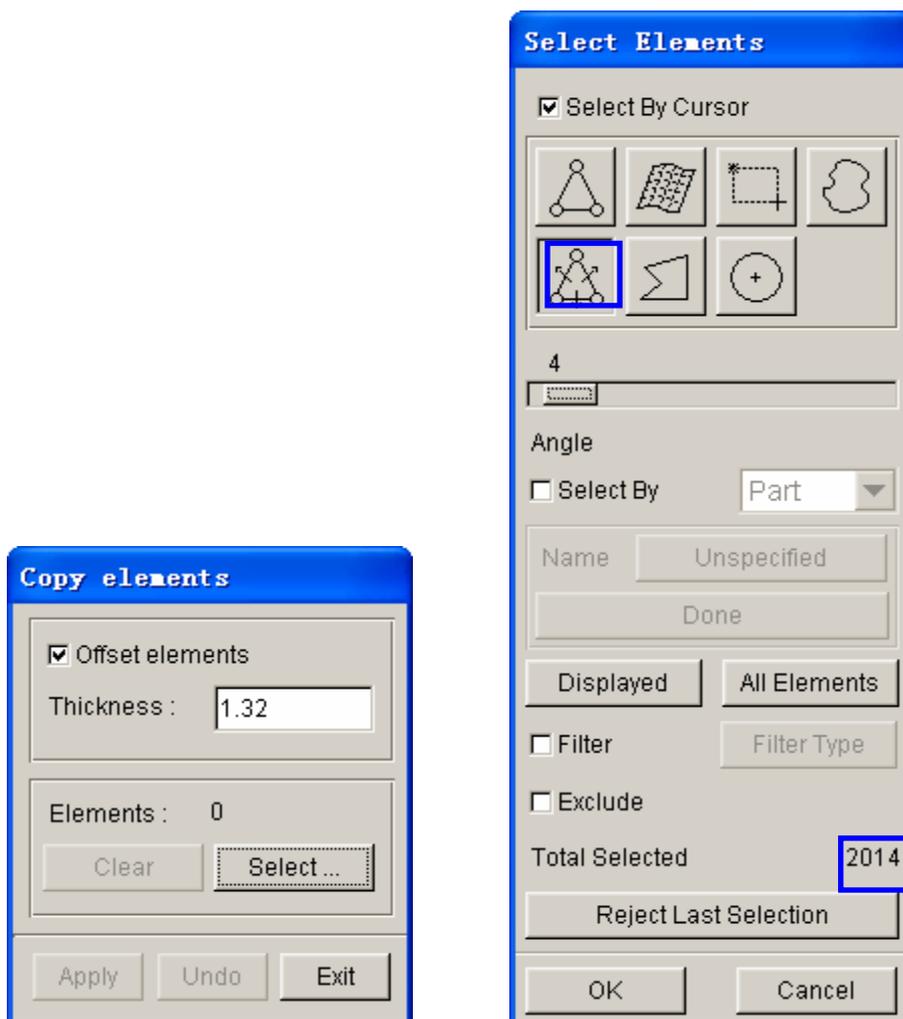


Figure 5.54 Select binder element

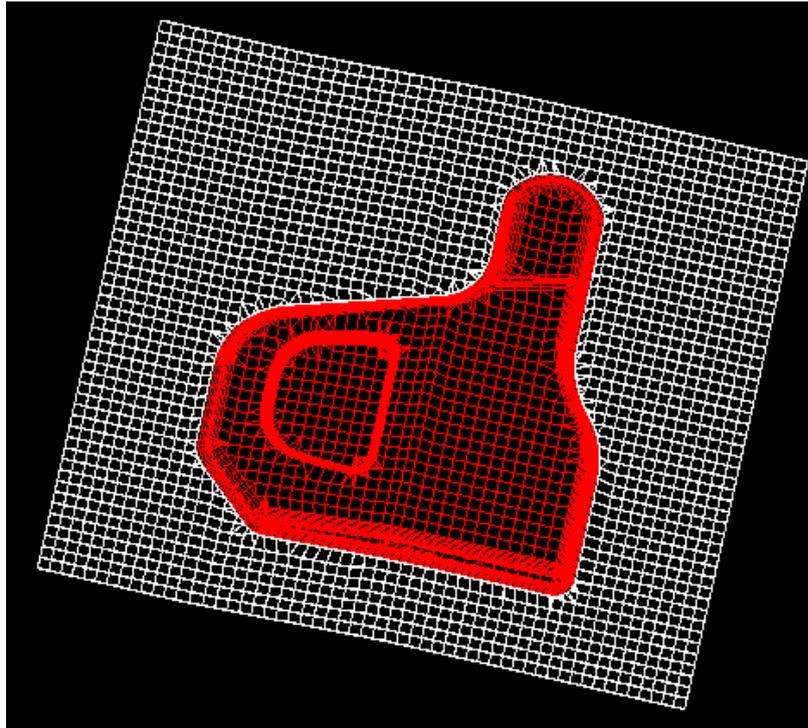


Figure 5.55 Selected elements

26. Click **OK** button to exit the SELECT ELEMENTS dialog box. Next, click **Apply** button to automatically offset all selected elements to a new part. The part is added to the list of binder. See Figure 5.56.



Figure 5.56 Binder geometry list

27. The numerical contact offset is also disabled. See Figure 5.57.



Figure 5.57 Contact setting

28. Click  icon from **Icon bar**. Click **All off** button to hide all parts.
29. Next, use your mouse cursor to pick **DIE**. Then, click **OK** button to dismiss the PART TURN ON/OFF dialog box. Only **DIE** is displayed in the display area.
30. The working directions of the defined tools are along the Z direction of Global Coordinate System. However, the feature encircled in Figure 5.40 cannot be formed along the working direction due to backdraft angle. Therefore, a separate process with different working direction is needed to facilitate cam forming operation in making of the feature.

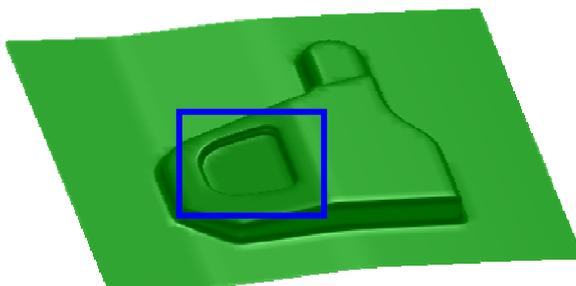


Figure 5.58 Cam formed feature

31. From tool definition interface, click **New tool** button to create a new tool named **pun2**. Select the default setting shown in Figure 5.59. Then, press **Apply** button.
32. Click **Parts...** to display the DEFINE GEOMETRY dialog box illustrated in Figure 5.42. Then, press **Copy Elem...** button to display the COPY ELEMENTS dialog box illustrated in Figure 5.61.

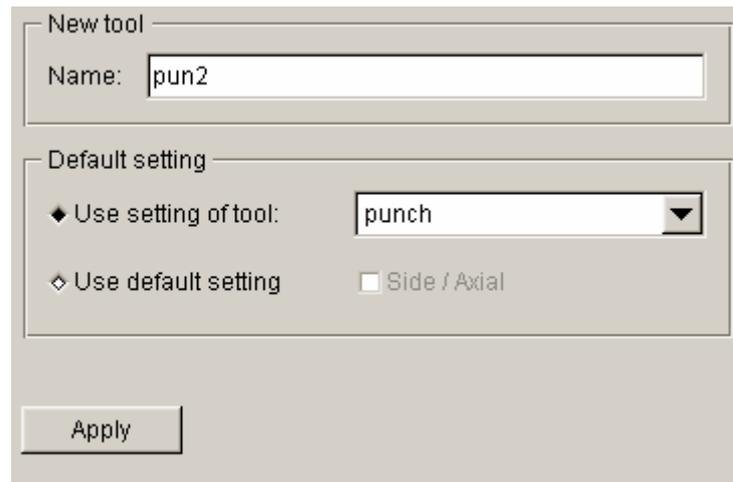


Figure 5.59 Create new tool

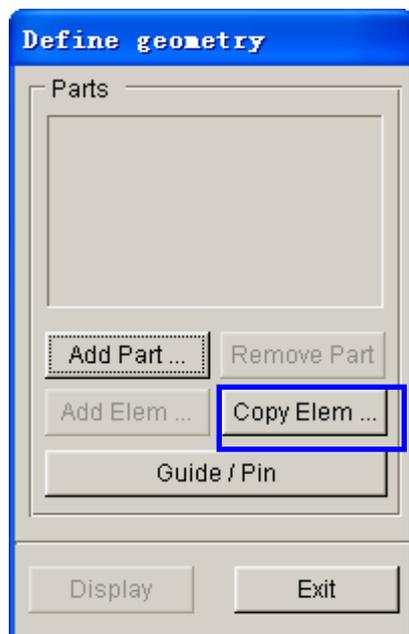


Figure 5.60 Define geometry dialog box

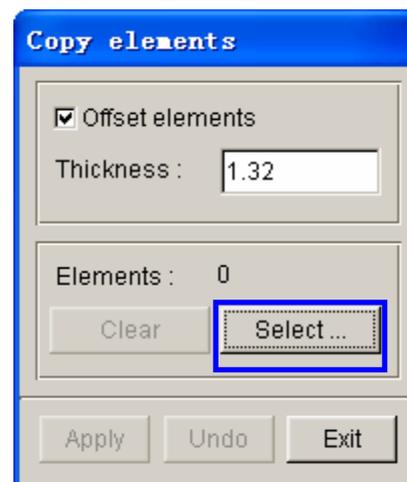


Figure 5.61 Copy elements dialog box

33. Click **Select** button to display the SELECT ELEMENTS dialog box illustrated in Figure 5.62.
34. Select the highlighted elements in Figure 5.62 using the **Multi-Point Region** function.
35. Click **OK** button to accept element selections and return to the COPY ELEMENTS dialog box. Now, **Apply** button is enabled, as illustrated in Figure 5.63.
36. Click **Apply** button to copy the selected elements to a new part.

37. Click **Exit** button to dismiss the COPY ELEMENTS dialog box.

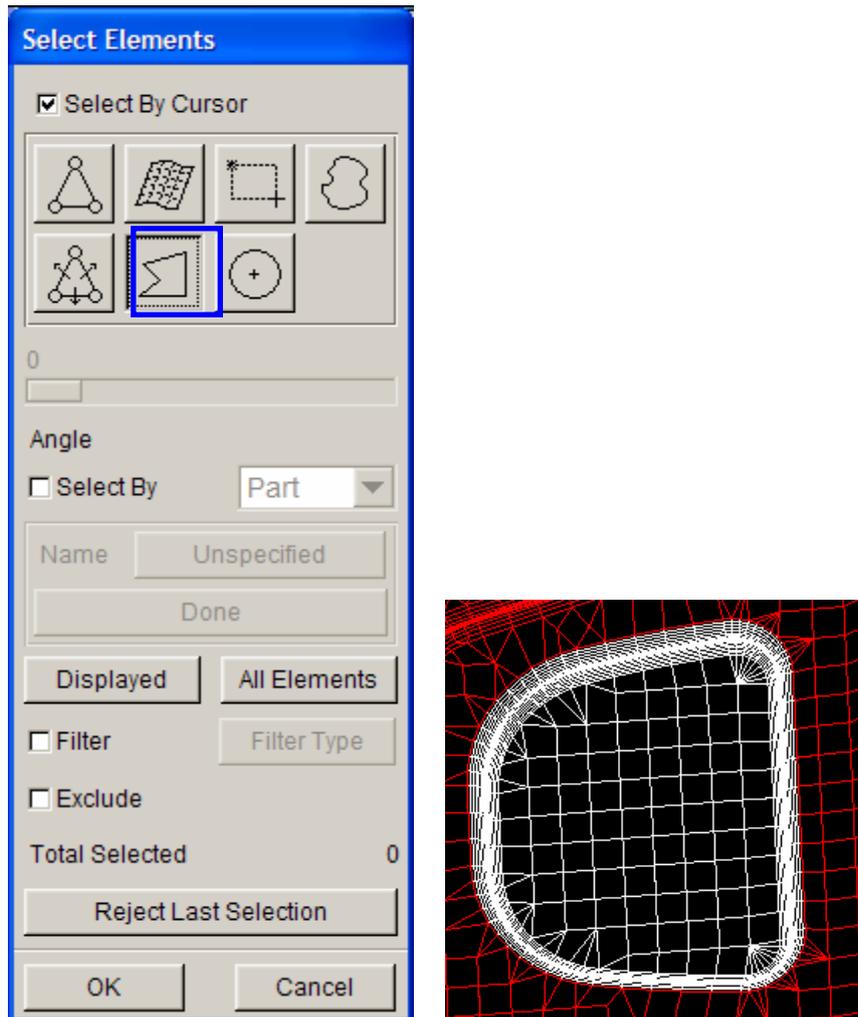


Figure 5.62 Select elements

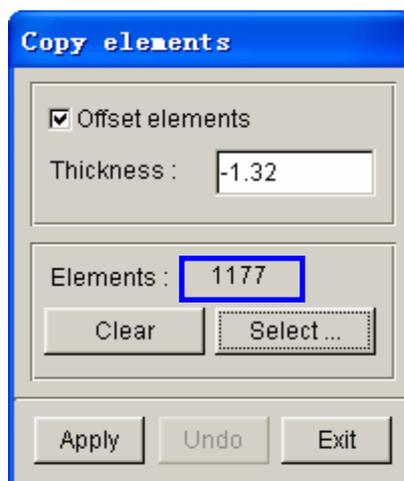


Figure 5.63 Copy elements dialog box

38. Click **Exit** button to return to tool definition interface. Now, let's

continue to define the working direction of **pun2**.

39. Press  button to display the DIRECTION dialog box illustrated in Figure 5.64.

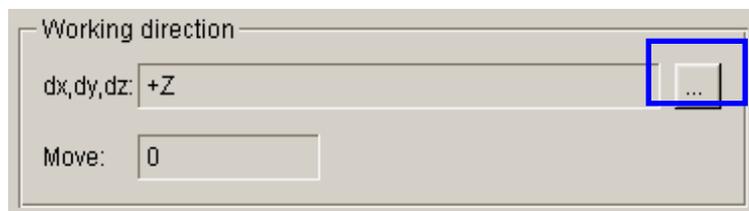


Figure 5.64 Working direction definition

40. Click **Element Normal** button. Then, use your mouse cursor to pick an element on the flat region of **pun2**, as illustrated in Figure 5.65. An arrow indicating the working director is displayed.
41. Click **OK** button to dismiss the DIRECTION dialog box. The vector of working direction for **pun2** is listed in the Working Direction field.
42. Click **Exit** button in the AUTOSSETUP interface.
43. Click  icon from the **Icon bar** to save the database.

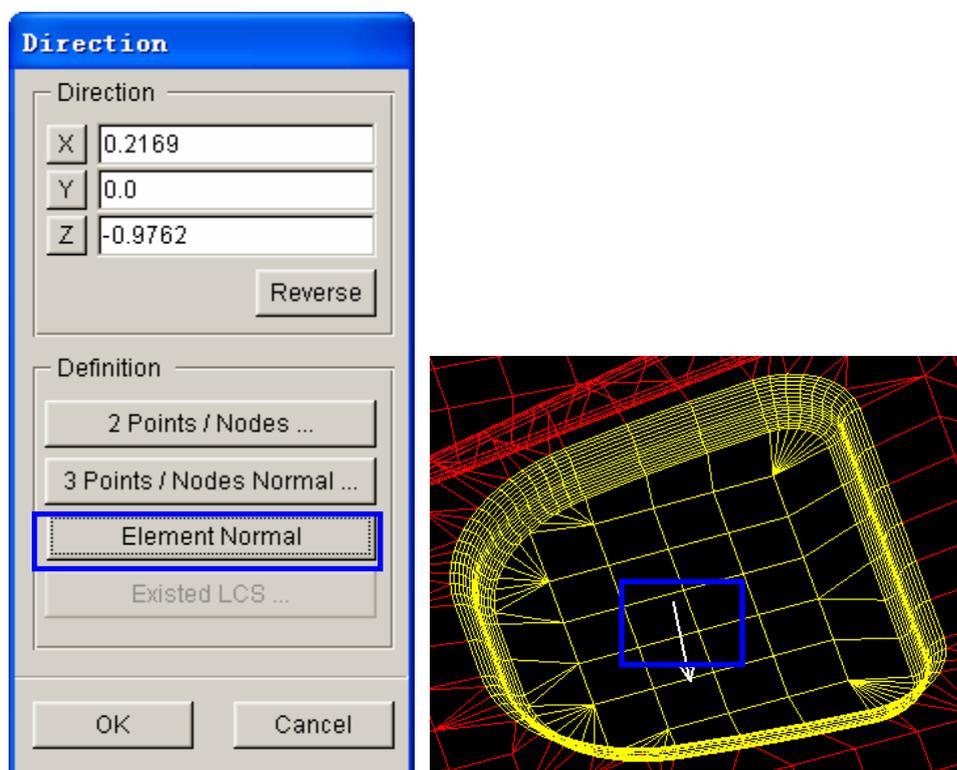


Figure 5.65 Display element normal

44. Next, repeat steps 28-29.
45. From the menu bar, select **Preprocess**→**Element**. Press  icon, following by using the **Multi-Point Region** function to select the highlighted elements in Figure 5.66

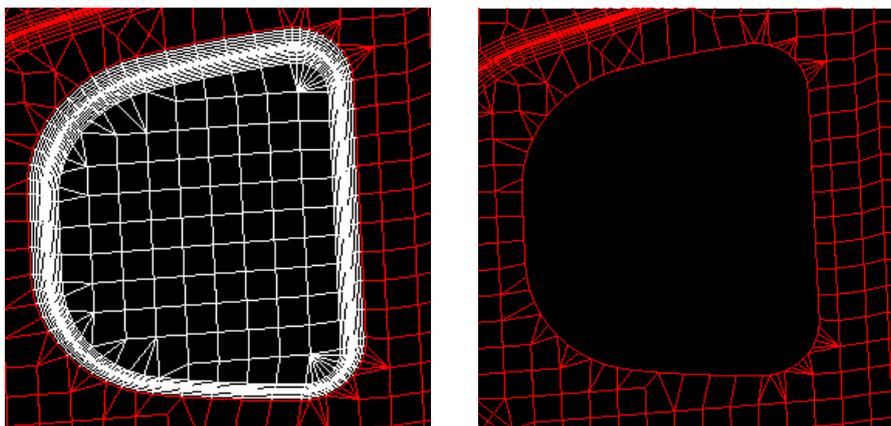


Figure 5.66 Delete elements

46. Click **OK** button to accept element selection and remove the selected elements from the database.
47. Then, click  icon from the **Icon bar** to remove the free nodes.
48. Now, all tools have been defined. You may return to **Tools** tabs of **AUTOSETUP** interface to continue next operation.

VI. Tools Positioning

After all tools are defined, you need to position the relative position of tools for the stamping operation. The tool positioning operation must be carried out each time the user sets up a stamping simulation model. Otherwise, you may not obtain correct stamping simulation setup.

The tool position is related to the working direction of each tool. Therefore, you need to carefully check the working direction prior to positioning the tools. If the process template is chosen, the default working direction is selected. You can also define special working direction.

1. Click the **Positioning...** button located at the lower right corner of tool definition interface to display the POSITIONING dialog box illustrated in

Figure 5.67. Alternatively, you can select **Tools→Positioning...** from the menu bar.

2. Select **punch** as fixed tool and use it as the reference tool. The tool is stationary during automatic positioning.
3. Then, clicks **Auto** button to position all tools and blank. The result is illustrated in Figure 5.68.
4. Now, all tools and blank are moved to a preset location. The movement of each tool is listed in the input data field of corresponding tool. The value is the measurement from the home/final position to the current position.
5. Toggle off the checkbox of **Lines** and **Surfaces** in **Display Options** located at the lower right side of screen. See Figure 5.69.

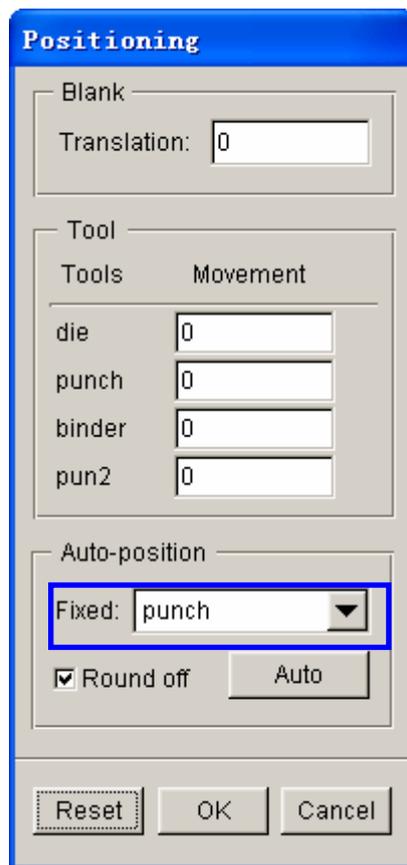


Figure 5.67 Before tool positioning

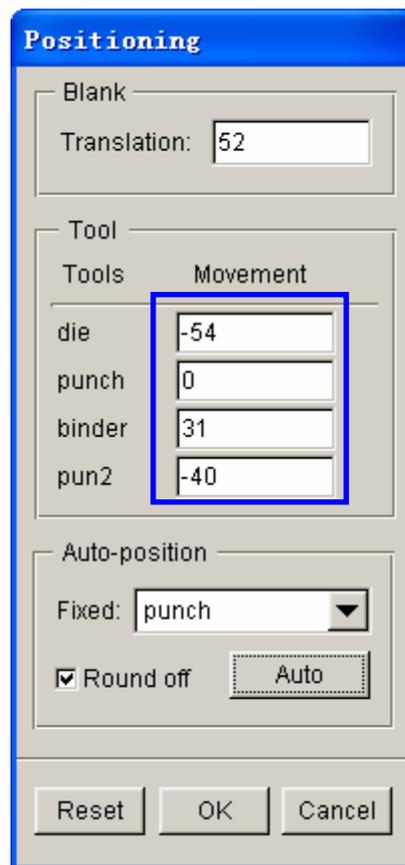


Figure 5.68 After tool auto positioning

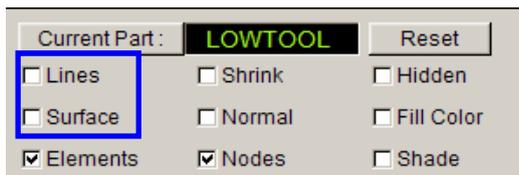


Figure 5.69 Display options

6. Click  and  icon on the **Icon bar** to display the relative position of tools and blank, as illustrated in Figure 5.70.
7. Click **OK** button to save the current position of tools and blank, and return to the tool definition interface.



Figure 5.70 The relative position of tools and blank after positioning

Note: After autopositioning, the relative position of tools and blanks is displayed on the screen. However, you may select **Tools → Positioning...** from the Auto Setup menu bar, following by pressing the **Reset** button in the **POSITIONING** dialog box to set the tools and blank(s) back to its original position. Moreover, you can move the tools using the **Home...** function provided in the **Tools** menu.

Now, you can continue with the next process which is definition of process parameters. In Auto Setup application, the definition and positioning of blank(s) and tools and definition of process are not required in strict order. Therefore, you can randomly modify each operation. However, you are recommended to accordingly set up the blank(s) definition, tools definition and process parameters.

VII. Process Definition

The Process definition is utilized to set up process parameters of the current simulation such as time required for every process, tooling speed, binder force and so on. The parameters listed in process definition interface depend on the pre-selected process template, including type of simulation and process.

In this example, the type of simulation and process is **Sheet Forming** and **Single Action**, respectively. Therefore, two default processes are listed in the process definition interface: closing and drawing process.

You can press **Process** tab of the main interface to enter process definition interface. Next, follow the steps listed below:

1. Select **closing** process from the list located at left side of the interface as the current process. See Figure 5.71.
2. Verify the default setting of **closing** stage is similar to Figure 5.71.
3. Select **drawing** process from the list located at left side of the interface as the current process. See Figure 5.72.
4. Verify the default setting of **drawing** stage is similar to Figure 5.72.

The screenshot shows the 'Sheet forming' application window with the 'Control' tab selected. The interface is organized into several sections:

- Stages:** A list on the left contains 'closing' (highlighted) and 'drawing'.
- Current stage:** A text box contains 'closing'. Below it is a checkbox for 'Hydro mech' which is unchecked.
- Tool control:** A table with columns 'Tools' and 'Action & Value'.

Tools	Action & Value	<input type="checkbox"/> Show all
die	Velocity 2000 Trapezoid	
punch	Stationary	
binder	Stationary	
- Duration:** A dropdown menu is set to 'Closure'. A checkbox for 'Fully match' is unchecked. Below, 'Tools' dropdowns are set to 'die' and 'binder', and a 'Gap' text box contains '0.0'.
- D3plot:** A 'Frames' text box contains '5'. An 'Advanced...' button is to the right.

At the bottom of the window are buttons for 'New stage', 'Delete stage', 'Submit...', and 'Exit'.

Figure 5.71 Closing process interface

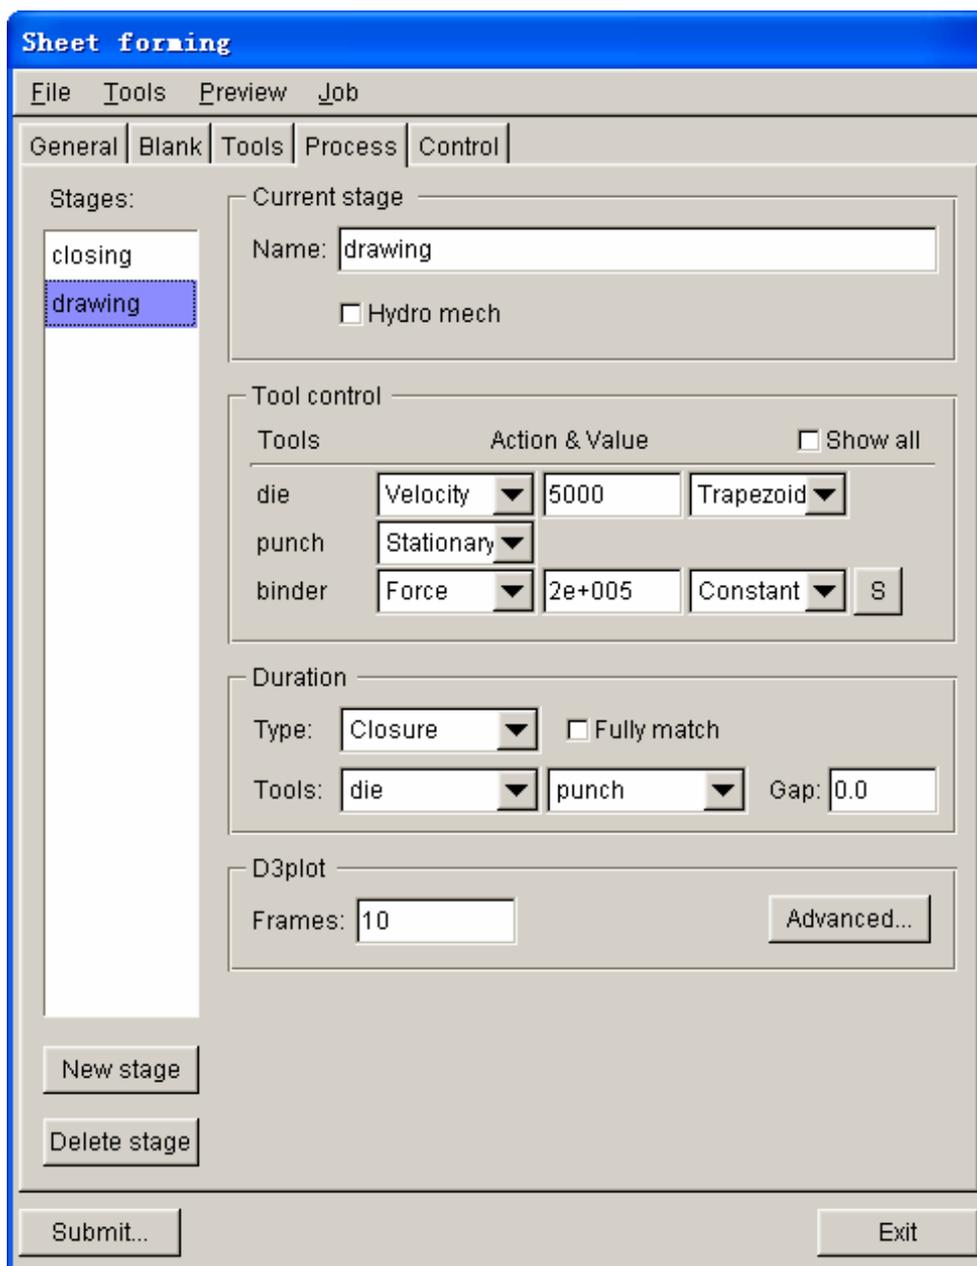


Figure 5.72 Drawing process interface

Now, let's add a new process for **pun2**.

1. Click **New stage** button to display the new stage interface.
2. At the input data field of Name, type in **drawing2** as the name of new process. See Figure 5.73.
3. Verify the other settings are similar to those illustrated in Figure 5.72. Then, press **Apply** button to create the new process.

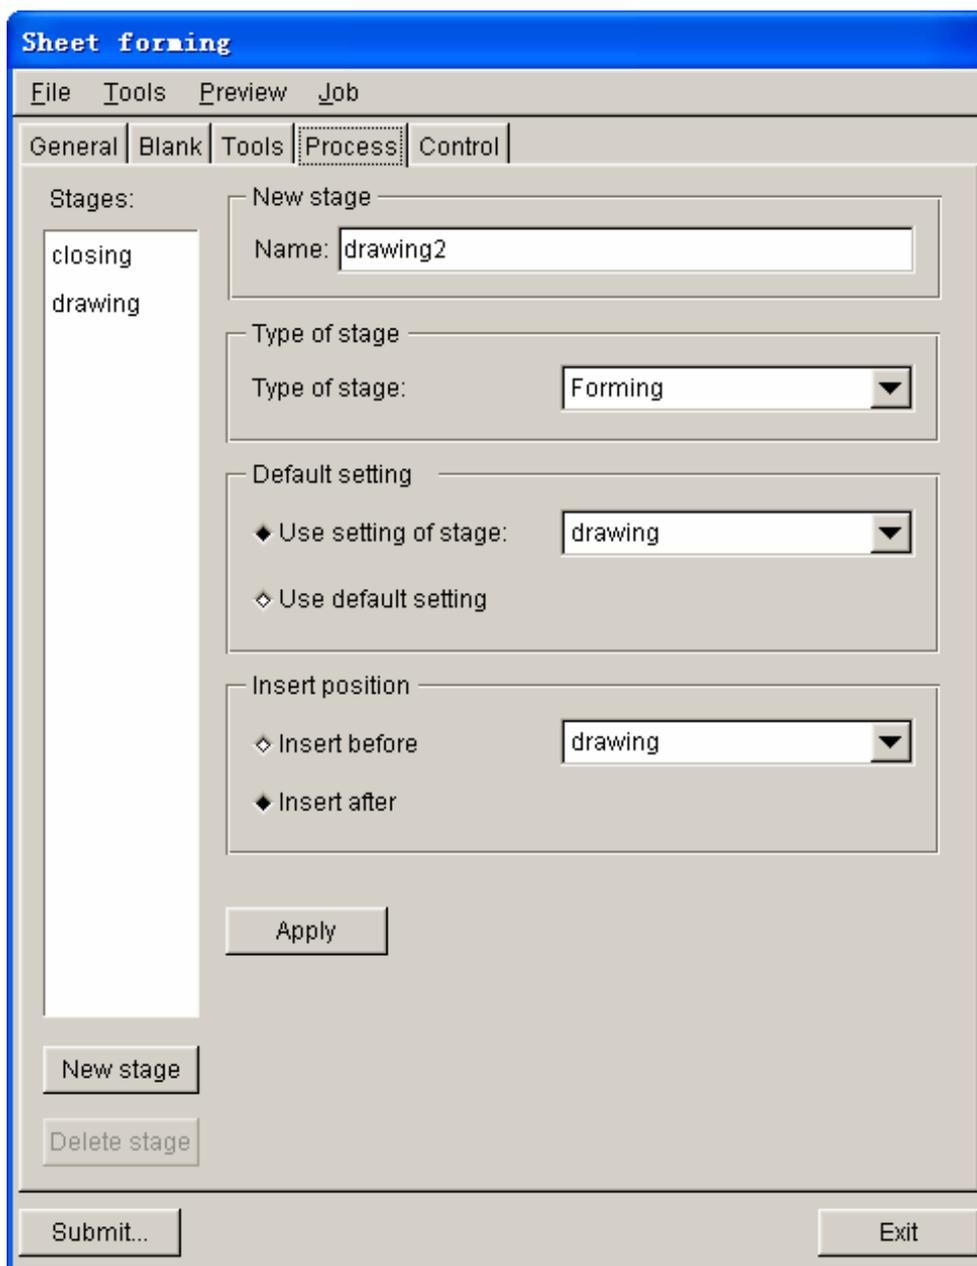


Figure 5.73 Define new process

4. Toggle on the **Show all** checkbox to display all tools, as illustrated in Figure 5.74.
5. Set the movement of all tools stationary, except **pun2**. Set the velocity of **pun2** at **5000** (mm/s).
6. Next, select **Closure** as the type of duration. As shown in Figure 5.74, **pun2** is moving toward **punch**.

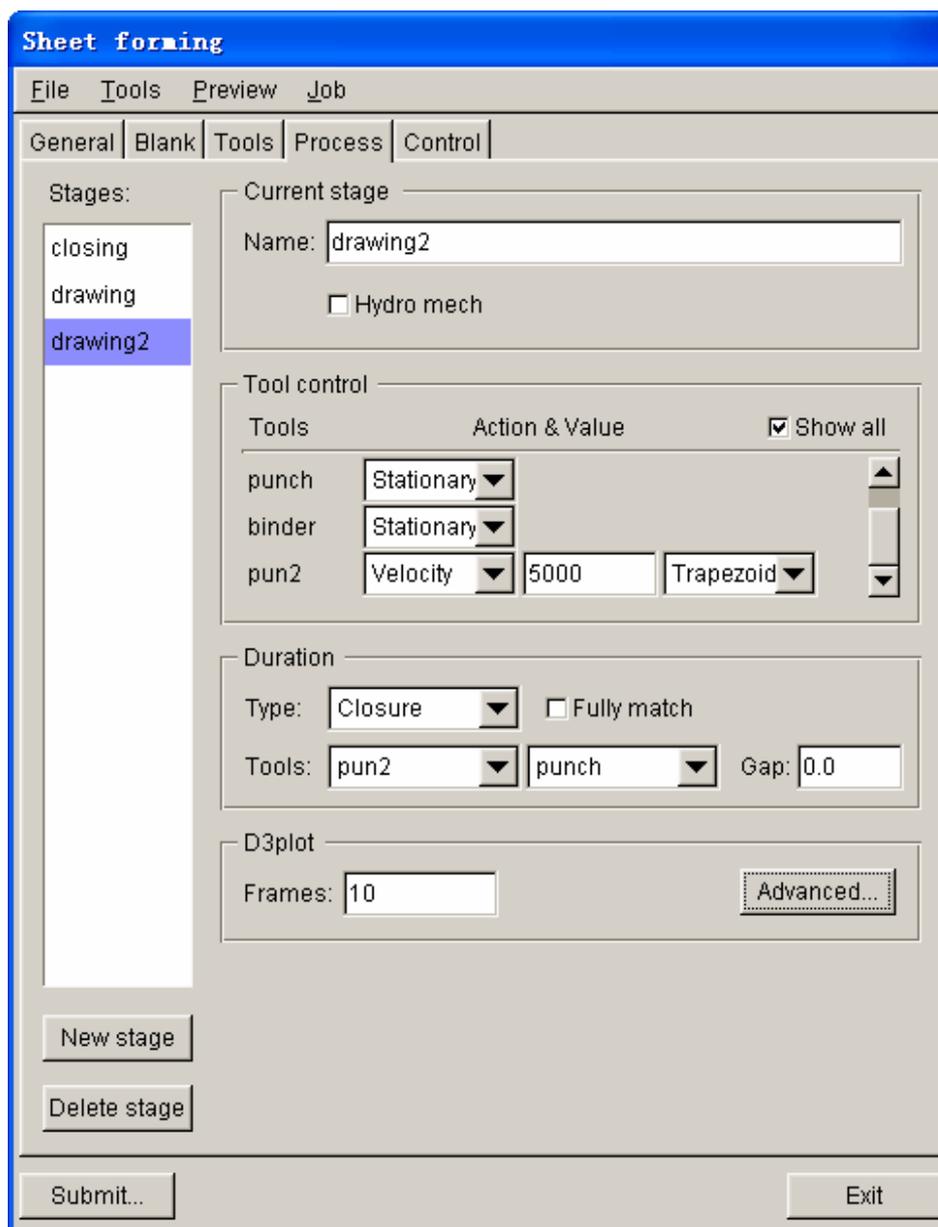


Figure 5.74 Drawing2 process definition

VIII. Animation

Prior to submitting a simulation job, you shall validate the process setting by viewing the animation of tool movement. The procedure to conduct animation is listed as the following:

1. Select **Preview**→**Animation...** in the menu bar. See Figure 5.75.

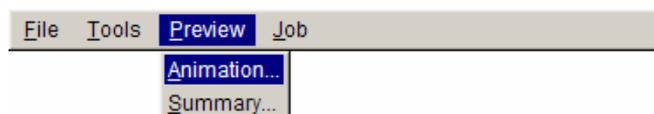


Figure 5.75 Animation menu

- The animation of tool movement is shown on the display area.
- You can select the **INDIVIDUAL FRAMES** option from the ANIMATE dialog box illustrated in Figure 5.76 to display incremental tool movement.

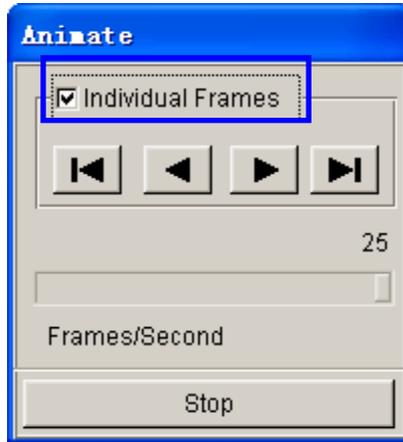


Figure 5.76 Animate control dialog box

- Click  icon to display the tool movement step by step.
- The time step and displacement of tools are printed on the upper left hand corner of the display area. See Figure 5.77.
- Click **Exit** button to return to the main interface.

STEP 17	TIME = 2.1264577E-002
DIE	POSI = 55.477493
PUNCH	POSI = 0.000000
BINDER	POSI = 0.000000
PUN2	POSI = 2.012686

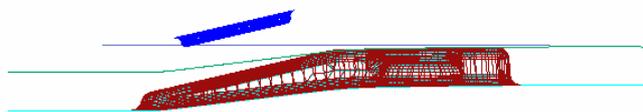


Figure 5.77 Animation of tool movement

IX. Submit Job

After validating the tools movement, you may continue with submitting the stamping

simulation through the steps listed below:

1. Select **Job**→**Job Submitter...** in the menu bar. See Figure 5.78.

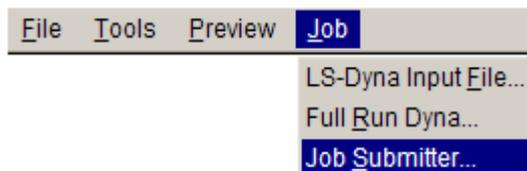


Figure 5.78 Job menu

2. The SUBMIT JOB dialog box illustrated in 5.79 is displayed.

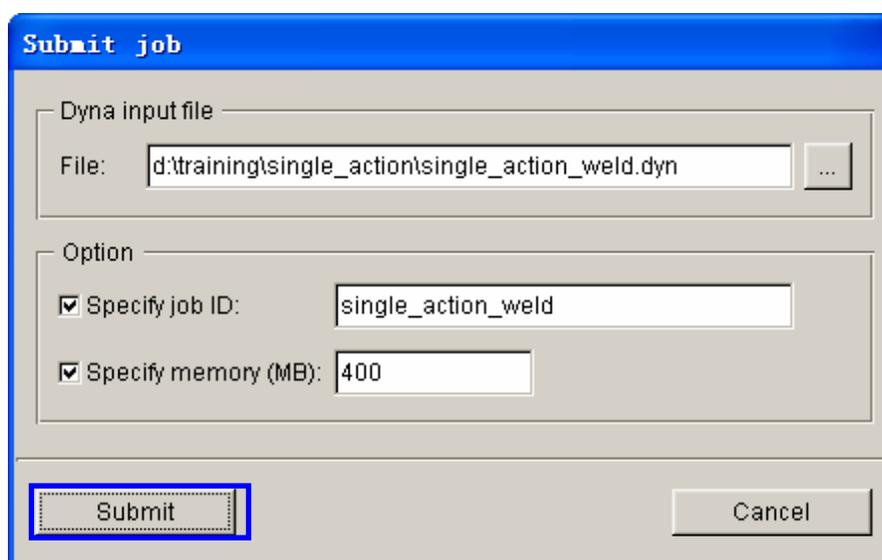


Figure 5.79 Submit job dialog box

3. Click **Submit** button from the SUBMIT JOB dialog box to display the Job Submitter interface illustrated in Figure 5.80.
4. Click **Submit Jobs** button, as shown in Figure 5.80 to activate the LS-DYNA solver for running the stamping simulation. The LS-DYNA solver window illustrated in Figure 5.81 is displayed and the simulation is in progress.

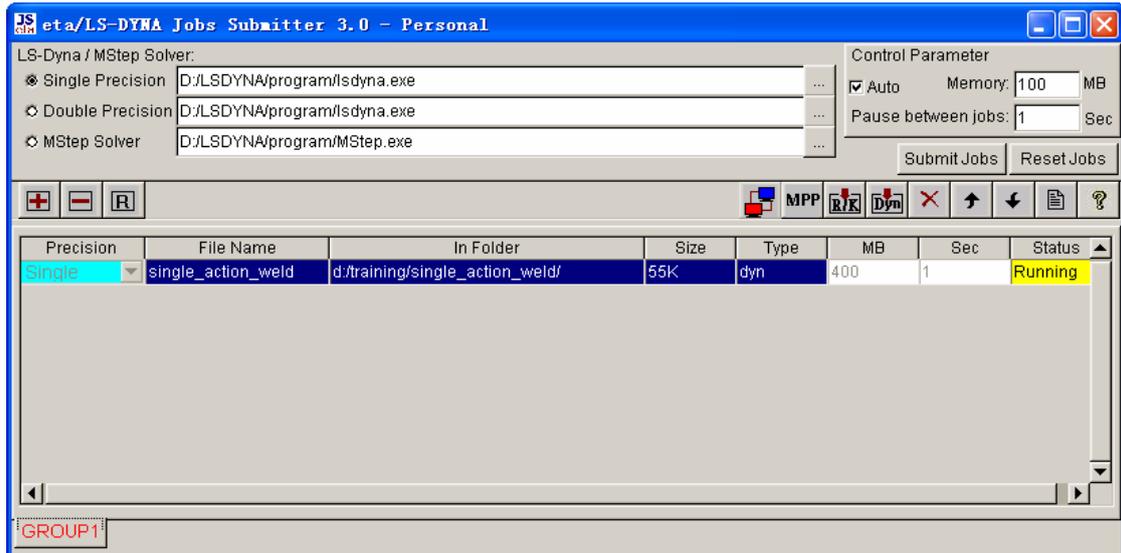


Figure 5.80 Submit job interface

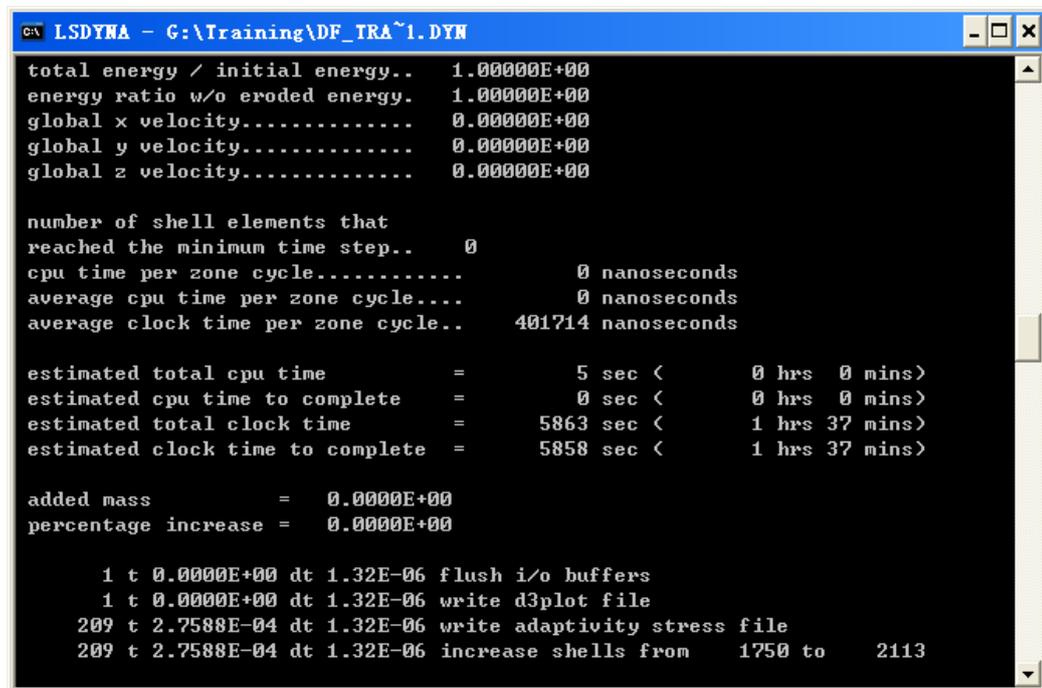


Figure 5.81 LS-DYNA solver window

When you submit a job from eta/DYNAFORM, an input deck is automatically created. The input deck is adopted by the solver, LS-DYNA, to process the stamping simulation. The default input deck names are **single_action_weld.dyn** and **single_action_weld.mod**. In addition, an index file named **single_action_weld.idx** is generated for the reference in eta/POST. The **.dyn** file contains all of the keyword control cards, while the **.mod** file contains the geometry data and boundary conditions. Advanced users are encouraged to study the **.dyn** input file. For more information, refer to the *LS-DYNA User's Manual*.


Note: *All files generated by either **eta/DYNAFORM** or **LS-DYNA** is stored in the directory in which the **eta/DYNAFORM** database has been saved. You shall ensure the folder doesn't include similar files prior to running the current job because these files will be overwritten.*

POST PROCESSING (with eta/POST)

The eta/POST reads and processes all the available data in the **d3plot** and ASCII data files such as glstat, rforc, etc,. In addition to the undeformed model data, the **d3plot** file also contains all result data generated by LS-DYNA (stress, strain, time history data, deformation, etc.).

Refer to previous examples for information about processing forming result.

Example 6. U-channel springback simulation

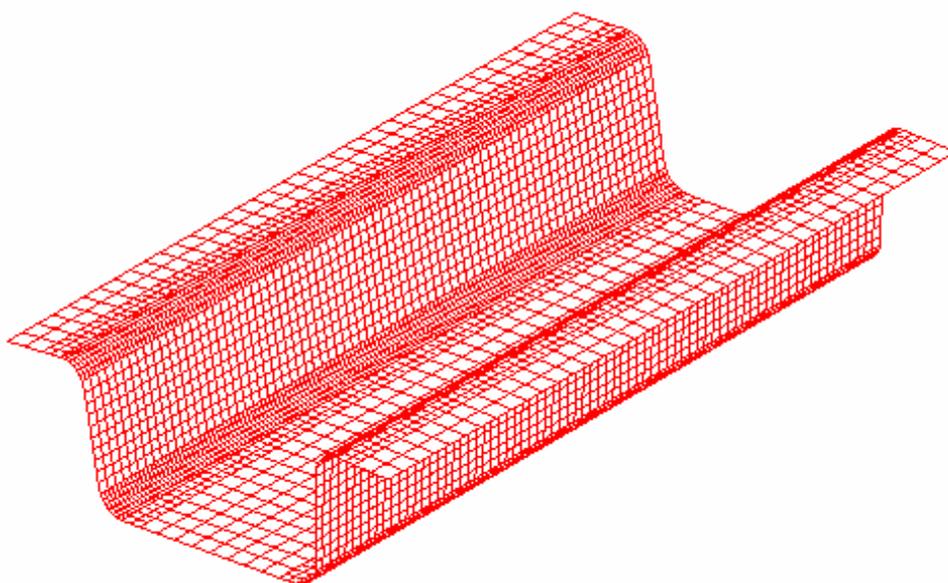

DATABASE MANIPULATION

Creating an eta/DYNAFORM Database and Analysis Setup

Start eta/DYNAFORM 5.5.

For workstation/Linux users, enter the command “**df55**” (default) from a UNIX shell. For PC users, double click the **eta/DYNAFORM 5.5 (DF55)** icon from the desktop.

After starting **eta/DYNAFORM**, a default database **Untitled.df** is created. You begin by importing FEA data files to the current database.

Import file

From the menu bar, select **File→Import** to open the IMPORT FILE dialog box illustrated in Figure 6.1. Next, Click the drop-down button of File Type and select DYNAIN (*dynain*) Then, go to the training input files located in the CD provided along with the eta/DYNAFORM installation. Locate the data file: **springback.dynain**. After importing the file, the model is displayed in the screen, as shown in Figure 6.2.

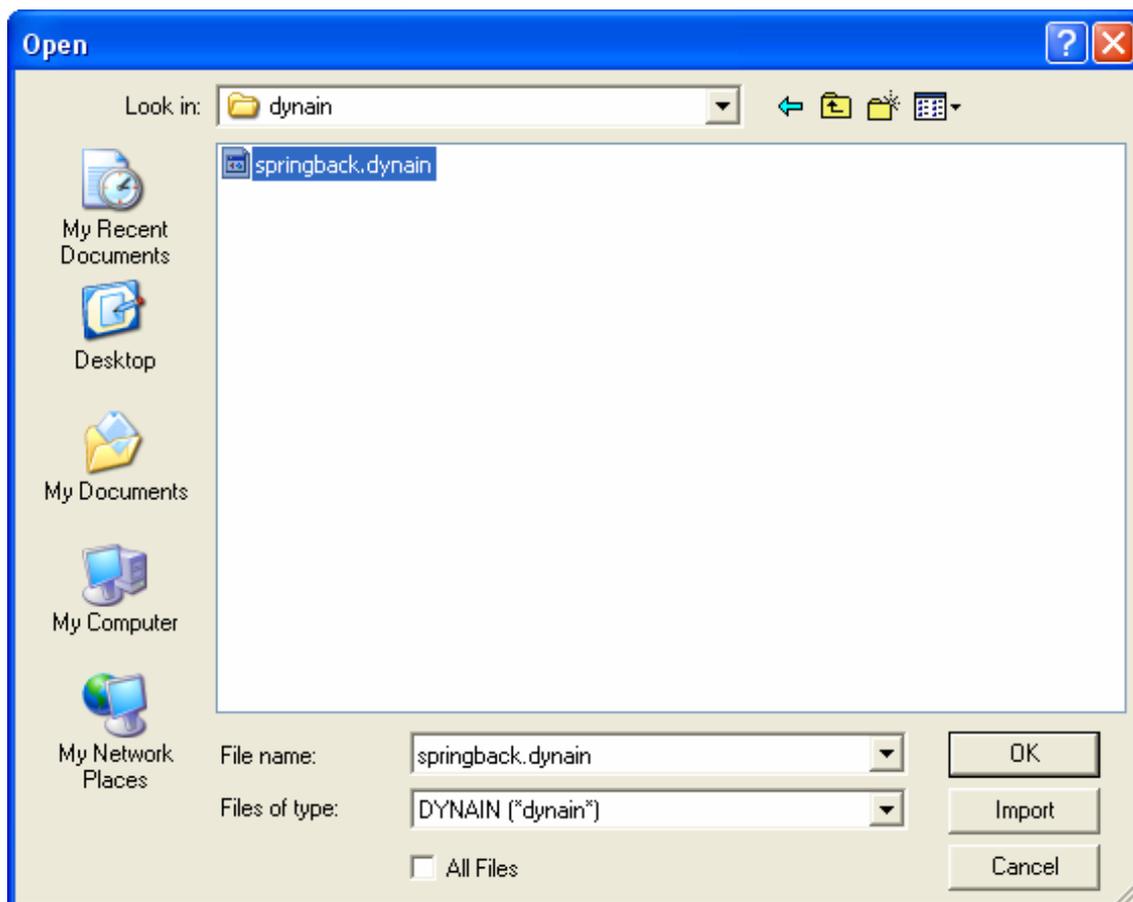


Figure 6.1 Import file dialog box

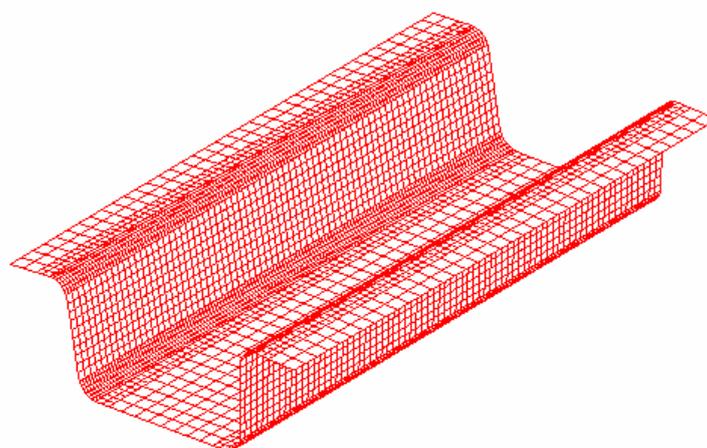


Figure 6.2 Illustration of U-Channel

Save the database

Select **File**⇒**Save as**, input the filename “springback.df” in the specified working directory, and then click the **Save** button to save the current database and exit the dialog box.



Figure 6.3 Save as dialog box

Database Unit

From the menu bar, select **Tools**→**Analysis Setup**. The default unit system for a new eta/DYNAFORM database is **mm, Newton, second, and Ton**.

AUTO SETUP

Prior to entering **AUTOSETUP** interface, upper/lower tool meshes are required. The other operation can be carried out in AutoSetup interface, such as **PHYSICAL OFFSET** of element, selection of **CONTACT OFFSET**. As illustrated in Figure 6.4, you can select **AUTOSETUP** option from the **SETUP** menu to display the **AUTOSETUP** interface.

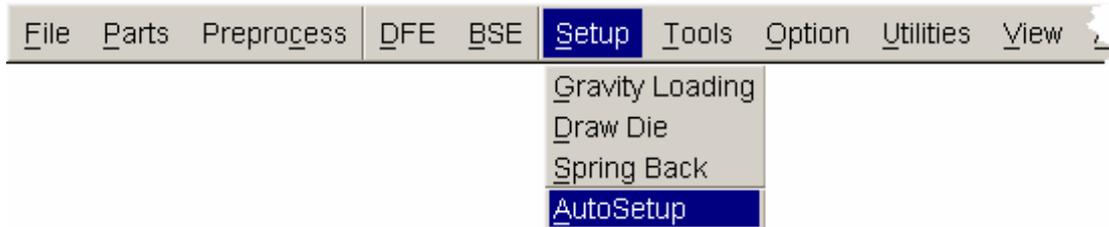


Figure 6.4 AutoSetup menu

I. Creation of a New Simulation

Click **AutoSetup** in the menu bar to display the **NEW SIMULATION** dialog box, as illustrated in Figure 6.5. You continue with defining basic parameters such as blank thickness, type of process, etc from the dialog box.

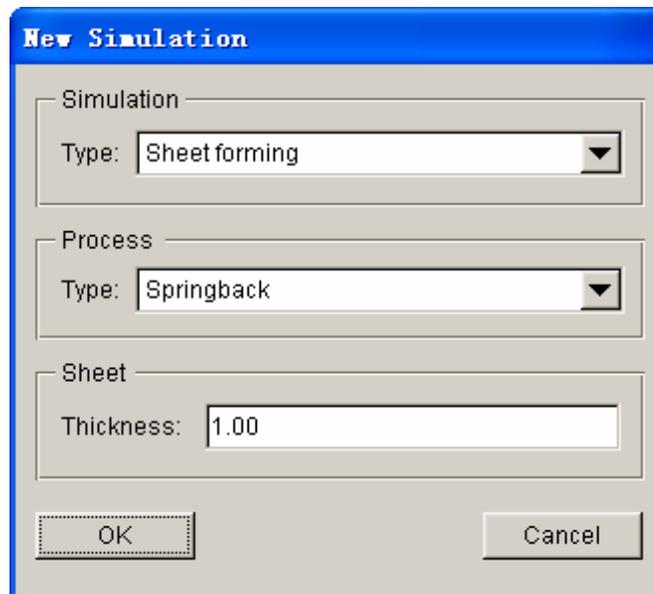


Figure 6.5 New simulation dialog

1. Select simulation type: Sheet forming;
2. Select process type: Springback;
3. Input blank thickness: 1.0 (mm);

- Click **OK** to display the main **AUTOSETUP** dialog box.

II. General

After entering **General** interface, you need to change Title into **Springback**. Accept other default values. See Figure 6.6.

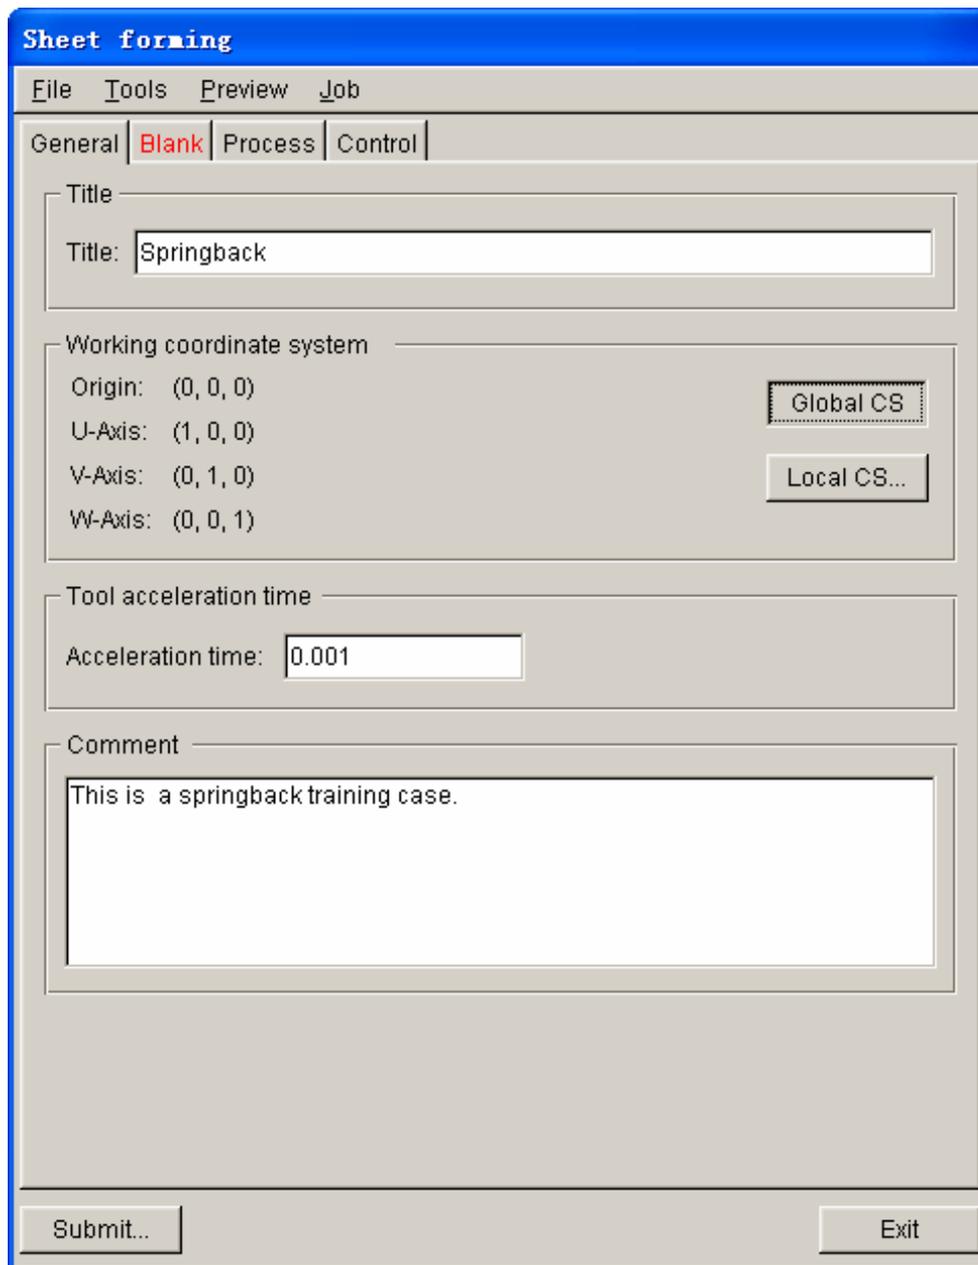


Figure 6.6 General interface

III. Blank Definition

1. Click the **Blank** tab in the **AutoSetup** interface to enter the blank definition page.
2. Click the **Parts...** button in **Geometry** field.

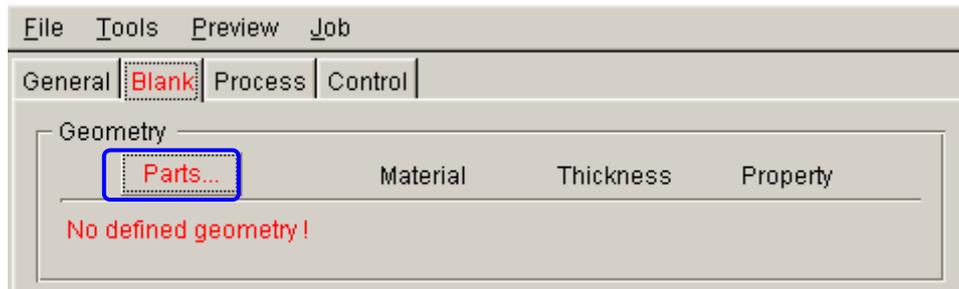


Figure 6.7 Define blank

3. Click **Add Part...** in the popped DEFINE GEOMETRY dialog box; select the part of BLANK in the popped dialog box, and click **OK** to exit the selection. Then, system will return to the Blank definition page.
4. Now, the basic parameters about the blank have been defined, and the tab of the **Blank** has changed from red into blank. See Figure 6.8.

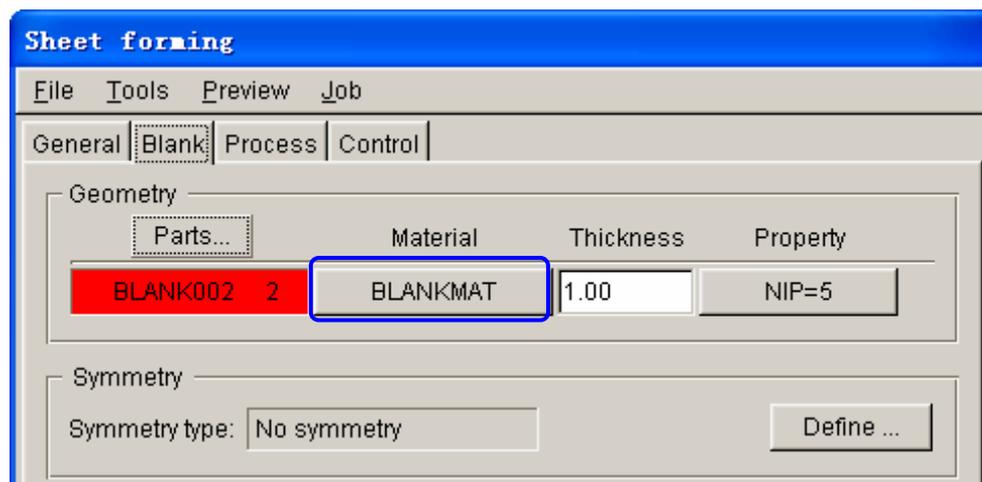


Figure 6.8 Blank definition interface

IV. Blank Material and Property Definition

Once blank has been defined, the program automatically selects a kind of default material and relative property as shown Figure 6.8. You can also press **BLANKMAT** button to redefine material.

Note: You must select the same material and thickness as forming simulation in springback analysis.

1. Click **BLANKMAT** button to pop up the MATERIAL dialog box, following by pressing the **Material Library...** button to select United States material library.

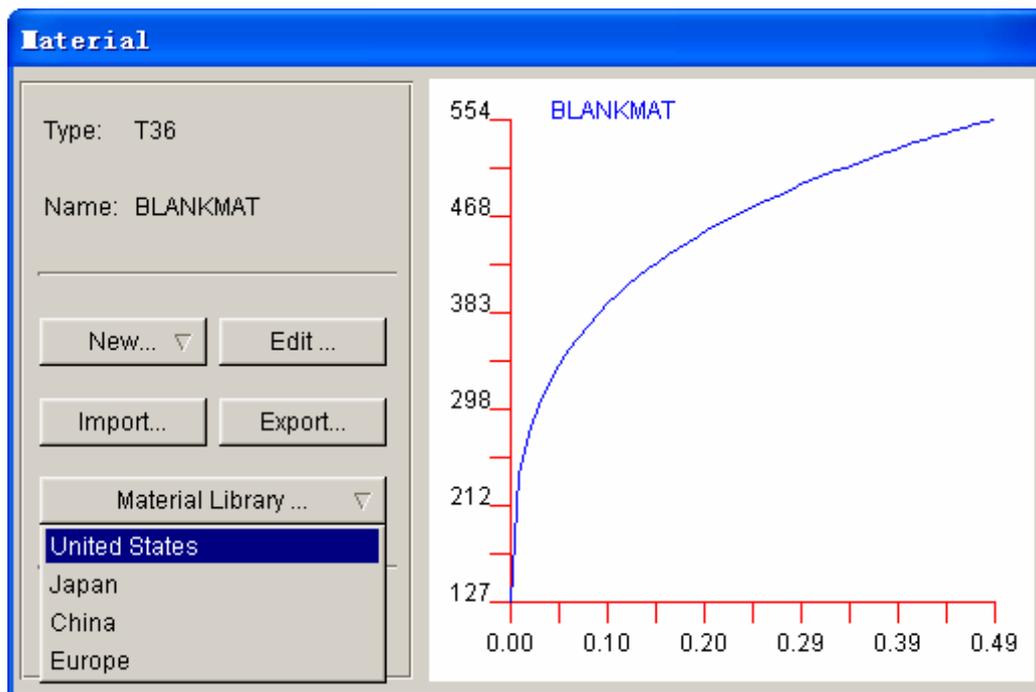


Figure 6.9 Material dialog box

2. Select the material model and material in the material library. In this example, you select mild steel DQSK. Then, return to the Blank definition interface.
3. Define property. Click **NIP=5** button. A dialog box (as shown Figure 6.10) is popped up. In the drop-down menu, select the fully integrated element recommended in the LS-DYNA springback analysis, and set the Number of Integration points as 7, then click **OK** to exit the dialog.

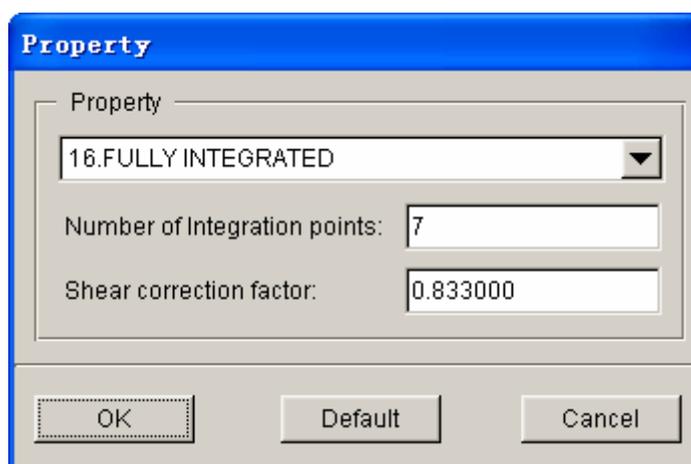


Figure 6.10 Property dialog box

V. Process Definition

A default spring process is created in springback analysis. You are not allowed to add

new processes. The relating parameters are setup as follows:

1. Define constraint nodes. Click **Edit...** button (shown in Figure 6.11) to define constraint nodes. Select three nodes on the bottom of the U-channel.

Note: The selected nodes can't lie in the same line, near the edge of the part and lie in the region where the deformation is larger; and these nodes must be apart from each other with some distance.

2. Select **Coarsening** option. It permits the solver to join the adjacent elements according to a specified angle. Coarsened mesh can reduce the computing time and instability during springback calculation. The default coarsening angle is **8°**.
3. Select the solving algorithm. eta/DYNAFORM provides Single-step Implicit and Multi-step Implicit algorithm, you select Multi-step Implicit algorithm in this example.

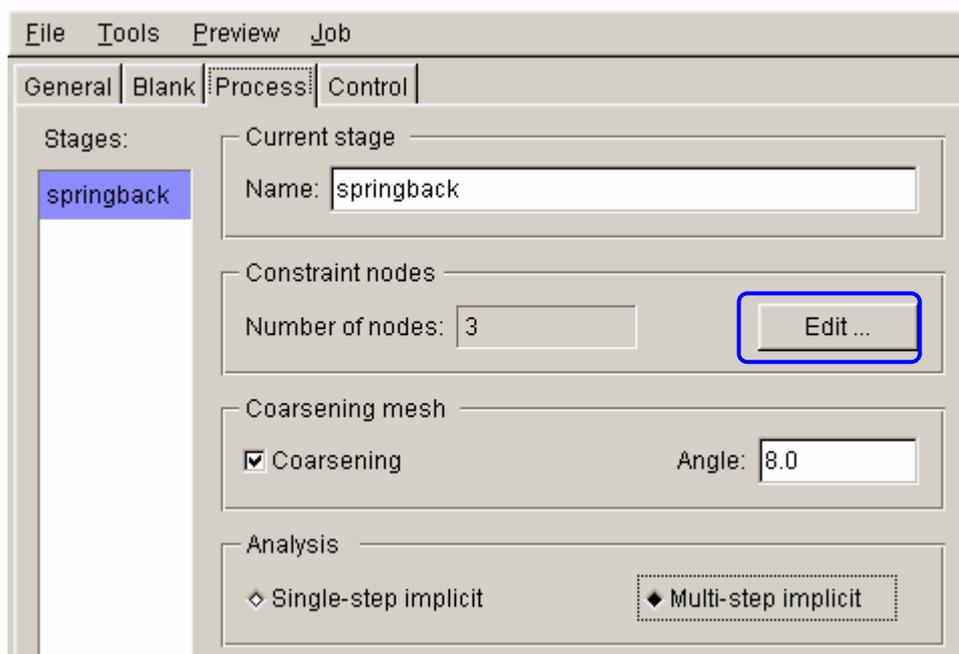


Figure 6.11 springback process setup

*Note: The parameters in Control interface is the recommended default parameters, you may accept the default values. You can also refer to the **eta/DYNAFORM User's Manual** and **LS-DYNA KEYWORDS USER'S MENU** for information about all of the **implicit parameter setup**.*

VI. Submit Job

1. Select **Job**→**Full Run Dyna...** in the menu bar. See Figure 6.12.

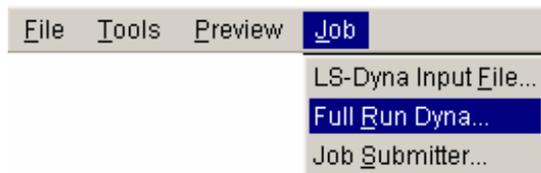


Figure 6.12 Job Submitter menu

2. The SUBMIT JOB dialog box illustrated in Figure 6.13.
3. Click **Submit** button from the SUBMIT JOB dialog box to display the Job Submitter interface. Now, the simulation is in progress.

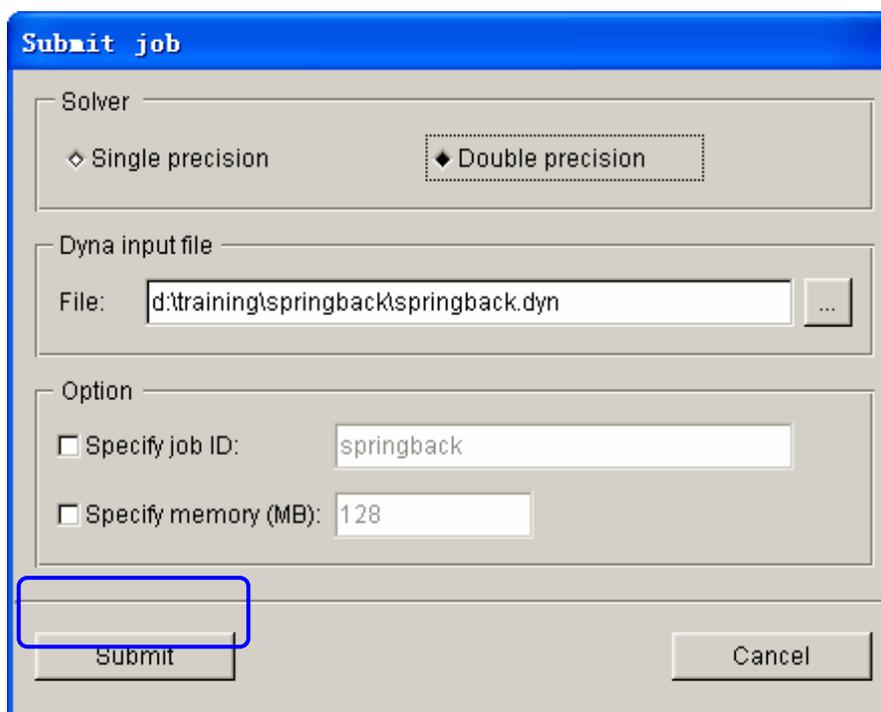


Figure 6.13 Submit job dialog box

POST PROCESSING (with eta/POST)

The eta/POST reads and processes all the available data in the **d3plot** and ASCII data files such as **glstat**, **rforc**, etc.. In addition to the undeformed model data, the **d3plot** file also contains all result data generated by LS-DYNA (stress, strain, time history data, deformation, etc.).

I. Reading d3plot file into the Post Processor

To run **eta/POST**, select the **PostProcess** in the **eta/DYNAFORM** main menu bar. The default path for **eta/POST** is **C:\Program Files\Dynaform 5.5**. In this directory, double-click the icon of **EtaPostProcessor.exe** to run **eta/POST**, or select **DYNAFORM5.5** in start menu. The GUI of eta/POST is shown in Figure 6.15.



Figure 6.14 PostProcess menu

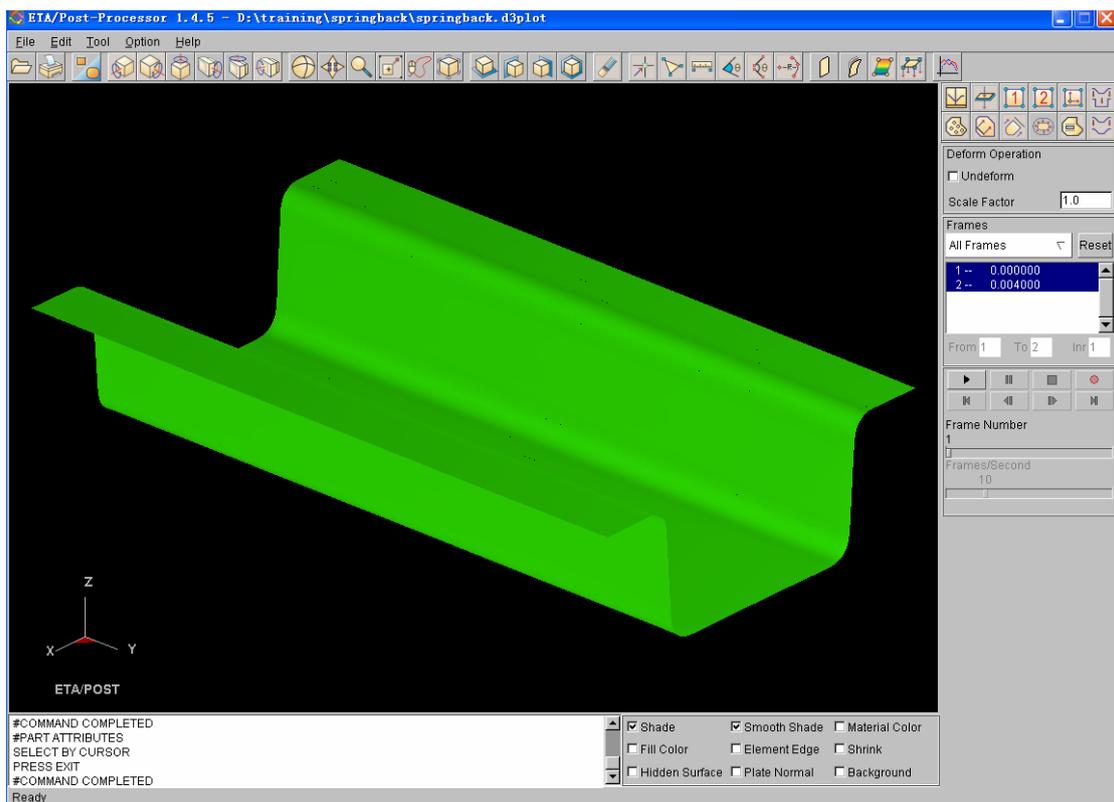


Figure 6.15 Post process GUI

1. Select **File**→**Open** in the eta/POST menu bar. The SELECT FILE dialog box is illustrated in Figure 6.16.

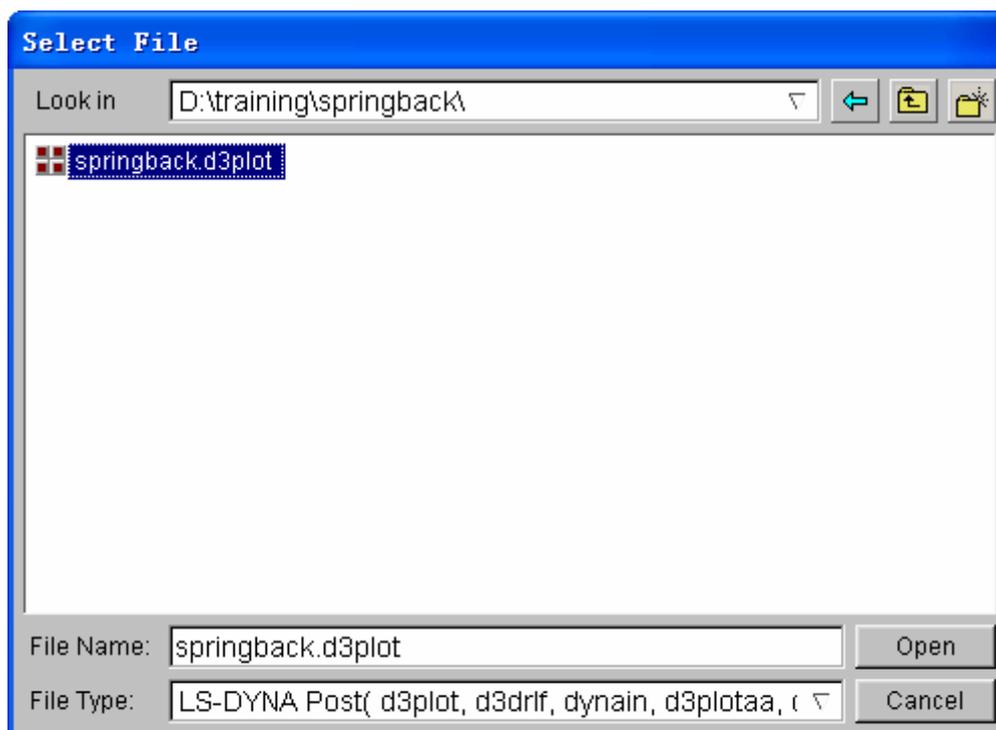


Figure 6.16 Select File dialog box

2. Select the result files (including d3plot, d3drif, dynain) from the file list.
3. Browse the directory where the result files are saved and select the correct file format, and then press the **Open** tab to read **d3plot** file. You can analyze and process the results through various operations provided by the eta/POST. Figure.6.17 shows the standard icon for springback analysis.



Figure 6.17 Standard icon for springback analysis

II. Springback analysis

1. Observe the springback change in the post process. There only are two frames in the file of d3plot. Figure 6.18 shows the blank shape before springback and after springback.

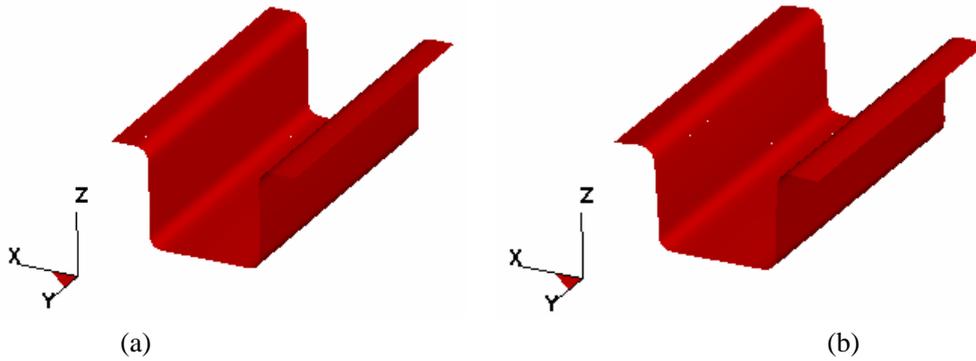



Figure 6.18 Springback results (a) before (b) after

- To better view the springback result, you can create a section line along the part. Select menu **Tool**→**Section Cut**, as shown in Figure 6.19.




Figure 6.19 Section Cut menu

- Click **Define Cut Plane** in the right dialog box, as shown in Figure 6.20a. A Control Option dialog box is popped up, as shown in Figure 6.20b.
- Select **W Along +Y Axis**, pick two nodes in the part, as shown in Figure 6.21.
- Click **Exit**, and press **Accept** in the popped dialog box. Then a section line is created automatically, as shown in Figure 6.22.
- Click **Apply** in the popped dialog box, and press the play button in the deformable window, then a clear springback can be observed in that section.
- You can use the tool provided in post process to measure the dimensions before and after springback, so that obtain the detail springback values. Click the icon  which set view as X-Z view, then click the icons  and  to measure the dimensions before and after springback. Figure 6.23 shows the results.

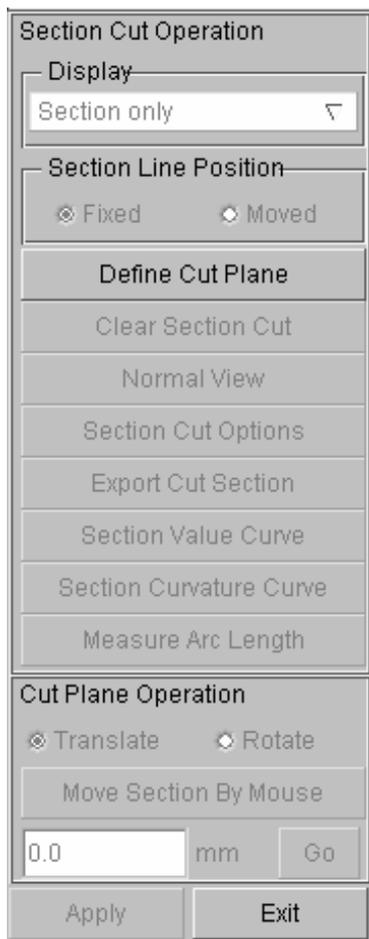

a)

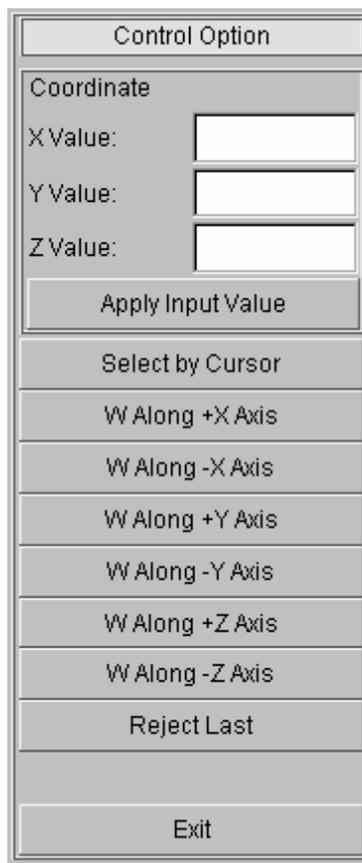

b)

Figure 6.20 section define

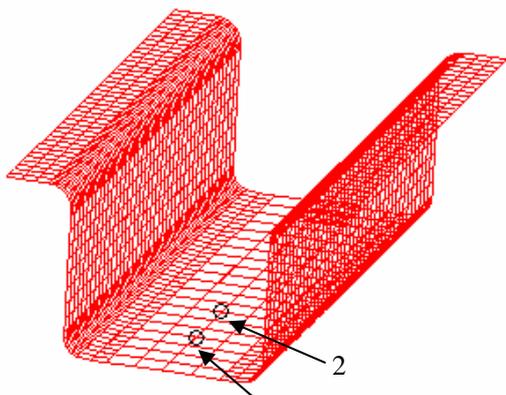


Figure 6.21 pick two nodes

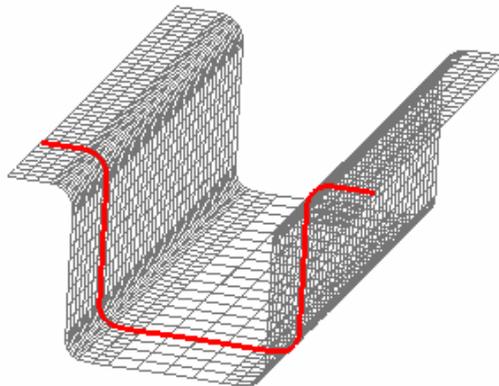


Figure 6.22 the created section line

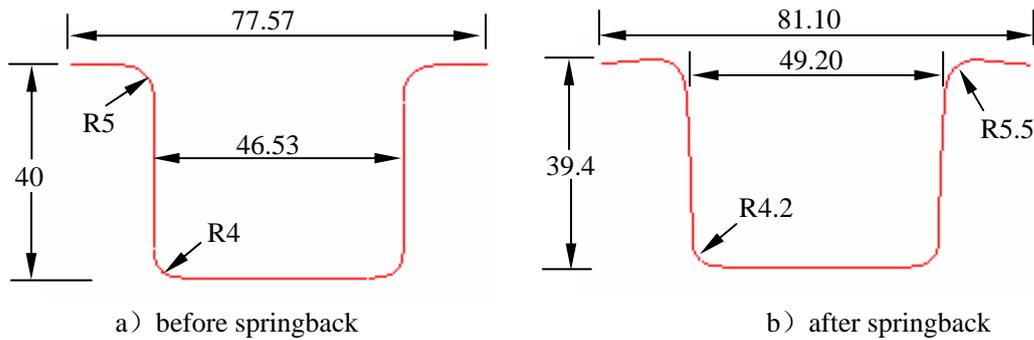


Figure 6.23 section dimensions before and after springback


Note: For the complex part, the springback varies for different location. Therefore, you should pick a serial of section lines in different location to better analyze springback result. In this example, the general method of analysis springback is given.

8. Other methods can be used to analysis springback. For example, you can import the dynain files before and after springback. This is because they lie in the same coordinate system, two section lines can be created by making them intersect the identity section, therefore, you can observe the change before and after springback conveniently.

III. Summary

This example introduces the general process of springback analysis by using **AutoSetup**. Springback analysis is different than forming analysis. It is carried out using the implicit method, which may cause convergence problems. We recommend you to use dynain file to perform springback analysis. Refer to the *eta/DYNAFORM and LS-DYNA User's Manual* for detail information about setup of implicit parameters in springback analysis.

Example 7. Sheet Metal Hydro-forming

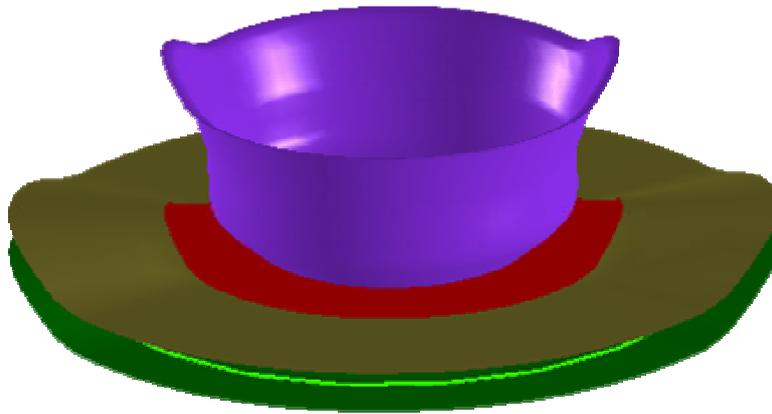

DATABASE MANIPULATION

Creating an eta/DYNAFORM Database and Analysis Setup

Start eta/DYNAFORM 5.5.

For workstation/Linux users, enter the command “**df55**” (default) from a UNIX shell. For PC users, double click the **eta/DYNAFORM 5.5 (DF55)** icon from the desktop.

After starting **eta/DYNAFORM**, a default database **Untitled.df** is created. You begin by opening the existing database.

Open the database

1. From the menu bar, select **File→Open...** to open the OPEN FILE dialog box illustrated in Figure 7.1.

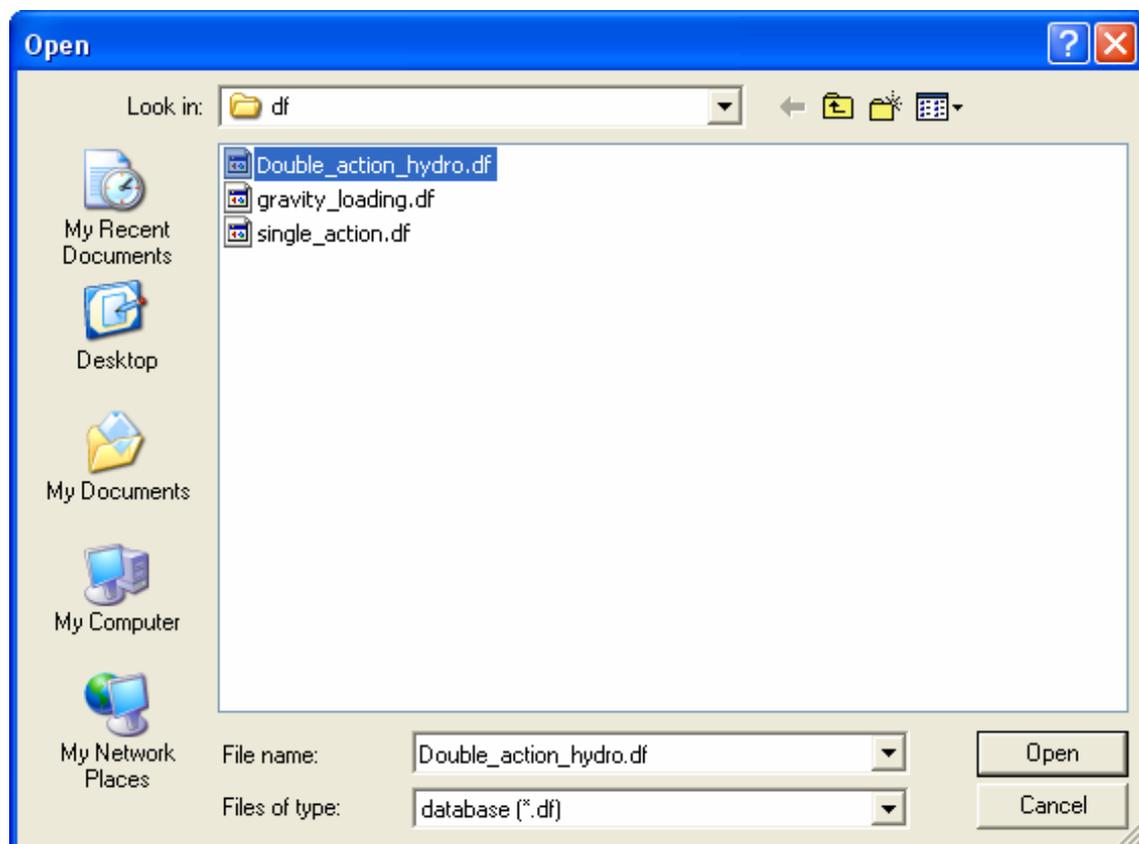


Figure 7.1 Open file dialog box

2. Go to the training input files located in the CD provided along with the eta/DYNAFORM installation, and open the data file named **Double_action_hydro.df**. The model illustrated in Figure 7.2 is displayed in the display area.

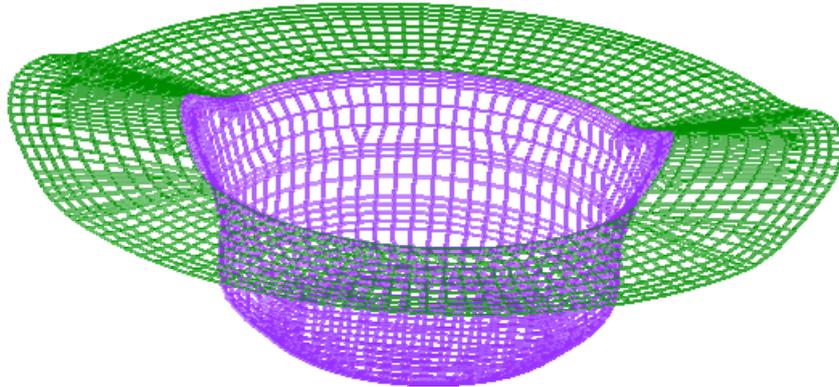


Figure 7.2 Illustration of model in Exercise 7

***Note:** The Icons bar may appear different depending on type of platform. Other functions on the **Toolbar** are further discussed in next section. You can also refer to the *eta/DYNAFORM User's Manual* for information about the **Toolbar** functions.*

Database Unit

From the menu bar, select **Tools**→**Analysis Setup**. The default unit system for a new eta/DYNAFORM database is **mm, Newton, second, and Ton**.

AUTO SETUP

Prior to entering **AUTOSETUP** interface, upper/lower tool meshes are required. The other operation can be carried out in AutoSetup interface, such as **PHYSICAL OFFSET** of element, selection of **CONTACT OFFSET**. As illustrated in Figure 7.3, you can select **AUTOSETUP** option from the **SETUP** menu to display the **AUTOSETUP** interface.

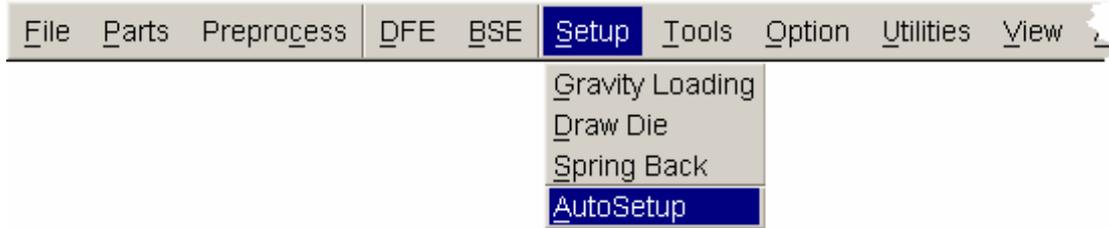


Figure 7.3 Setup menu

I. New Simulation

Click **AutoSetup** in the menu bar to display the **NEW SIMULATION** dialog box illustrated in Figure 7.4. You continue with defining basic parameters such as blank thickness, type of process, etc from the dialog box.

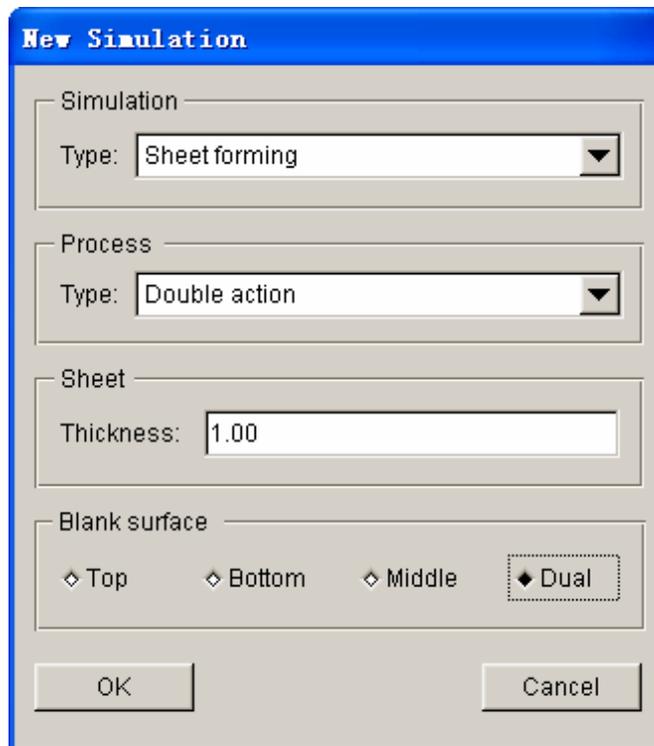


Figure 7.4 New simulation dialog box

1. Select simulation type: **Sheet forming**.

2. Select process type: **Double Action**.
3. Input blank thickness: **1.0** (mm).
4. Select tools reference: **Dual**.
5. Click **OK** to display the main **AUTOSETUP** dialog box.

II. General

After entering **General** interface, you do not need to modify any parameters except for typing in **double_action_hydro** in the input data field of **Title**. In addition, you can type in some comments about the setting/process in the **Comment** input field illustrated in Figure 7.5.

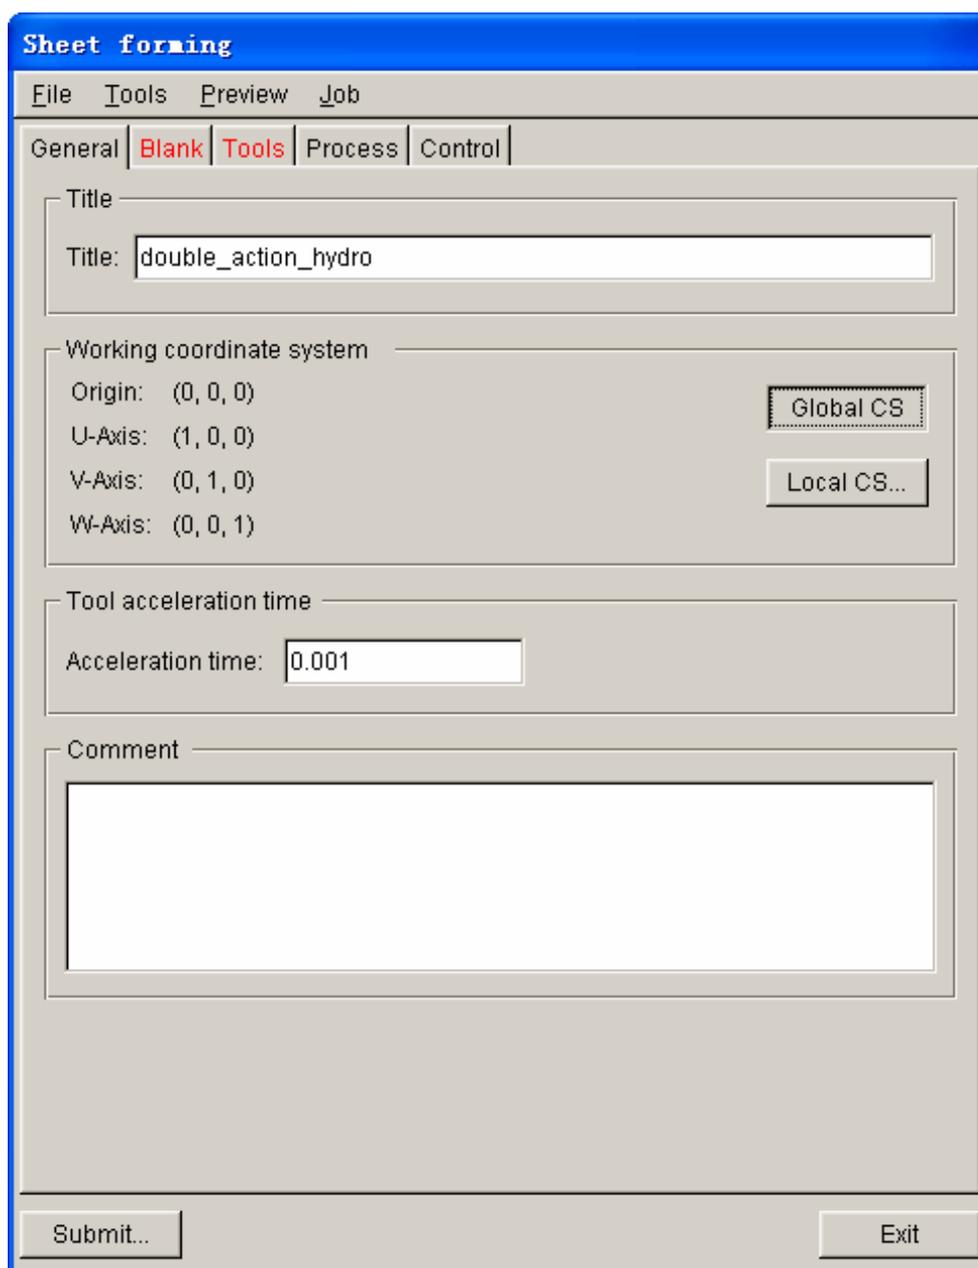


Figure 7.5 General interface

III. Blank Definition

1. Use your mouse cursor to click on **Blank** tab to display the blank definition interface.
2. Then, click **Parts...** button from **Geometry** field in blank definition interface. See Figure 7.6.

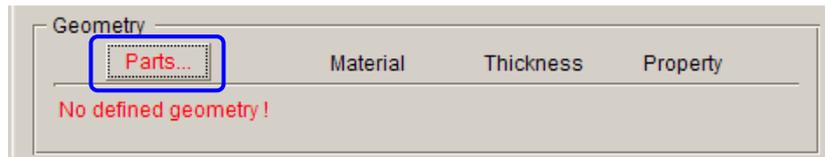


Figure 7.6 Define blank

3. The DEFINE GEOEMTRY dialog box illustrated in Figure 7.7 is displayed.

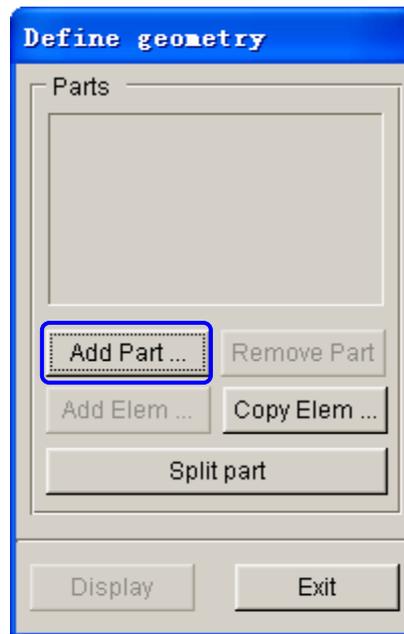


Figure 7.7 Define geometry dialog box

4. Click **Add Part...** button. Use your mouse cursor to select **BLANK** part from the SELECT PART dialog box illustrated in Figure 7.8.

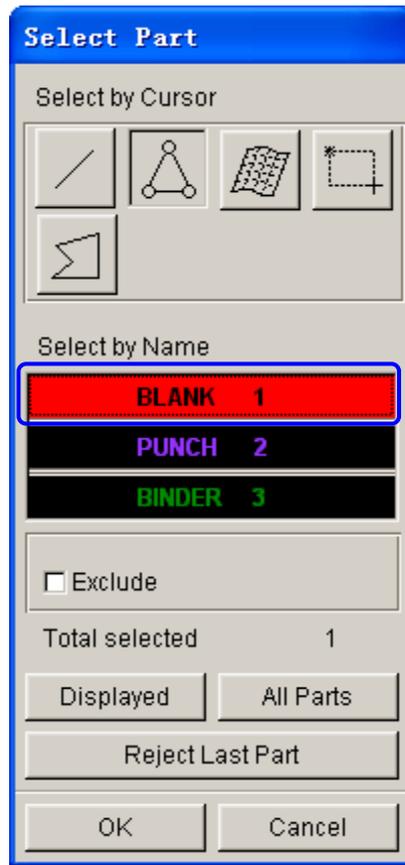


Figure 7.8 Select part dialog box

5. After selecting the part, click on OK button to return to the DEFINE GEOMETRY dialog box. The **BLANK** part is added to the list. See Figure 7.9.

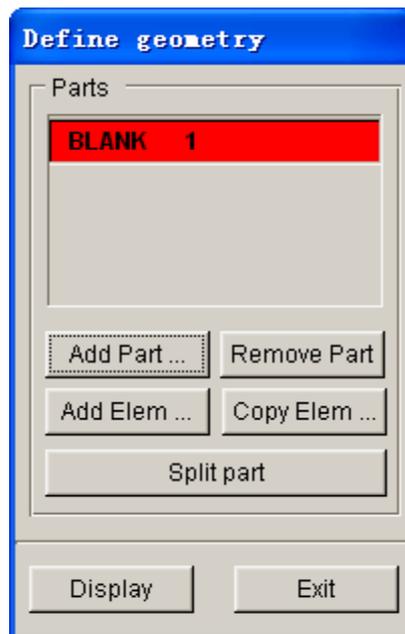


Figure 7.9 Blank geometry list

- Click the **Exit** button to return to the blank definition interface. Now, the color of Blank tab is changed to from RED to BLACK. See figure 7.10.

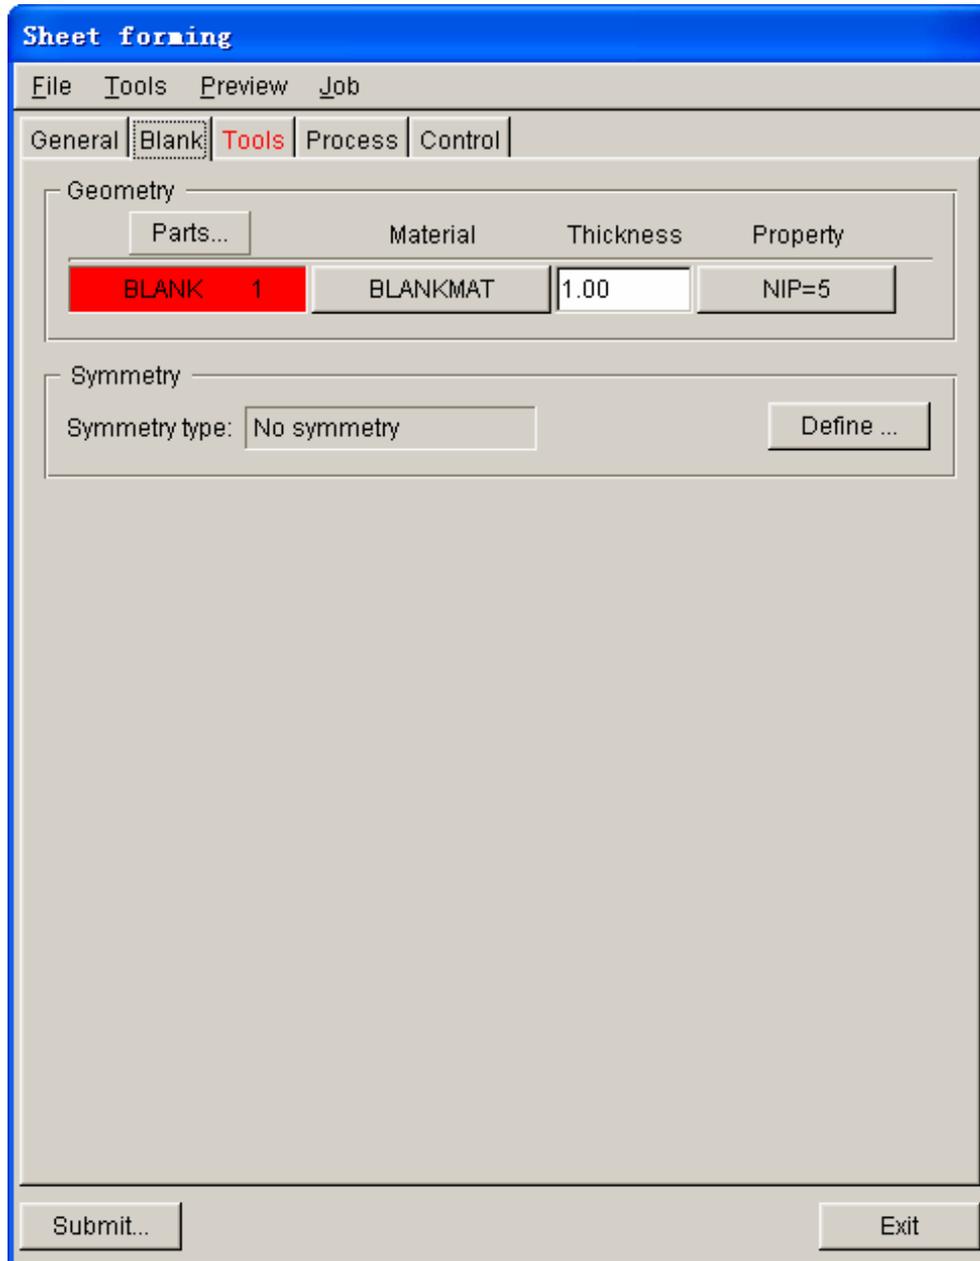


Figure 7.10 Blank definition interface

IV. Blank Material and Property Definition

Once the **BLANK** part is defined, the program automatically assigns a default blank material and relative property. You can also press the **BLANKMAT** button illustrated in Figure 7.11 to edit material definition.

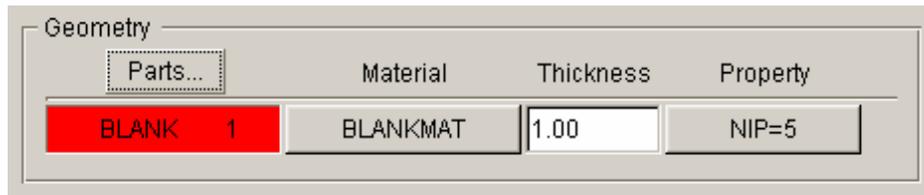


Figure 7.11 Blank definition

After clicking the **BLANKMAT** button, the MATERIAL dialog box illustrated in Figure 1.13 is displayed. You can create, edit or import material into the database. Moreover, you can press the **Material Library...** button to select generic material database provided by eta/DYNAFORM. Click on the **Material Library...** button to select the United States material library illustrated in Figure 7.12.

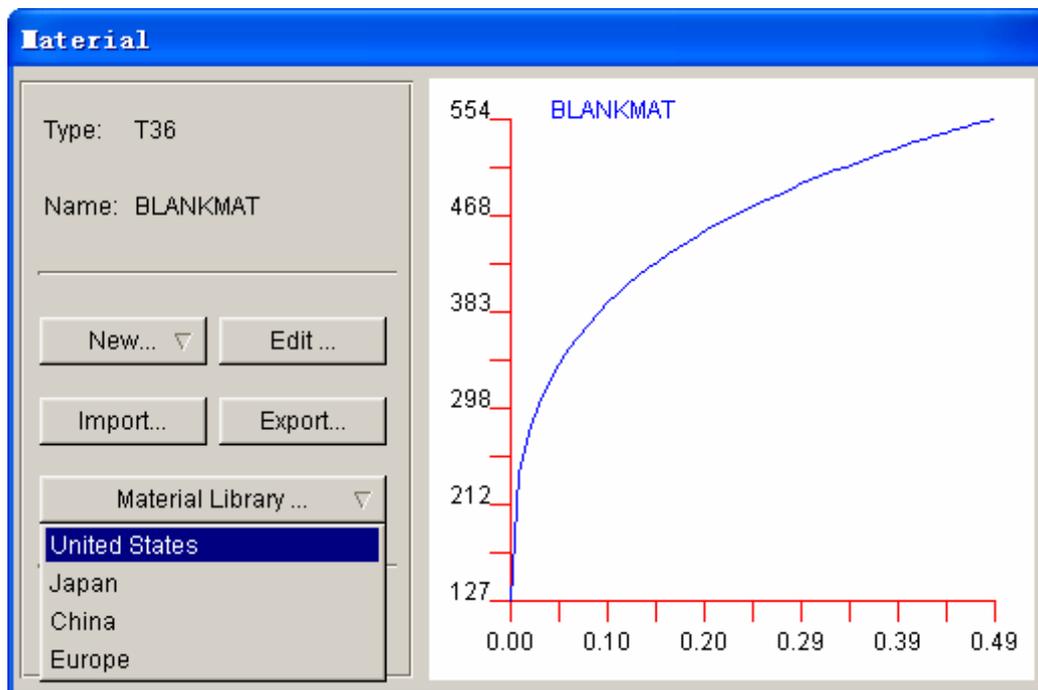


Figure 7.12 Material dialog box

Now, you continue to select a material from the material library, as shown in Figure 7.13.

Material Library										
Material Type	Strength Level	Material Name	T1	T18	T24	T36	T37	T39	T64	
STEEL	Mild	CQ	+	+	+	+	+	-	-	▲
		DQ	+	+	+	+	+	-	-	■
		DQSK	+	+	+	+	+	-	-	▼
	Medium	BH180	+	+	+	+	+	+	-	▲
		BH210	+	+	+	+	+	+	-	■
		BH250	+	+	+	+	+	+	-	▼
	High	HSLA250	+	+	+	+	+	+	-	▲
		HSLA300	+	+	+	+	+	-	-	■
		HSLA350	+	+	+	+	+	+	-	▼
	Advanced High	DP500	+	+	+	+	+	-	-	▲
		DP600	+	+	+	+	+	-	-	▼
	Hot Rolled	CQ	+	+	+	+	+	-	-	▲
		DQSK	+	+	+	+	+	-	-	■
		DDQIF	+	+	+	+	+	-	-	▼
	Stainless	SS11CrCb	+	+	+	+	+	-	-	▲
SS18CrCb		+	+	+	+	+	-	-	■	
SS304		+	+	+	+	+	-	-	▼	
ALUMINUM		AA5182	+	+	+	+	+	-	-	▲
		AA5454	+	+	+	+	+	-	-	■
		AA5754	+	+	+	+	+	-	-	▼
		AA6000	+	+	+	+	+	-	-	▼

Figure 7.13 United States generic material library

V. Tool Definition

1. Click on **Tools** tab to display tool definition interface.
2. Click  icon from the **Icon bar**, and turn off the **BLANK** part.
3. Based on the defined process, three standard tools: die, punch and binder, are listed at the left side of the tool definition interface. You can continue with definition of each tool. By default, the **punch** interface is displayed.
4. Press the **Parts...** button to assign a part as punch. See Figure 7.14.

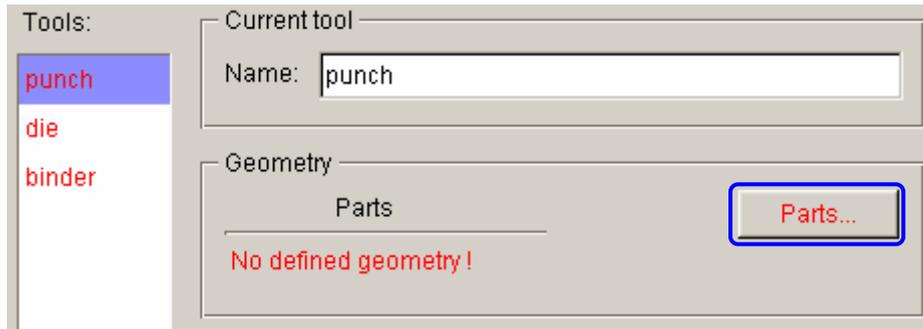


Figure 7.14 Punch definition

5. The DEFINE GEOMETRY dialog box illustrated in Figure 7.15 is displayed. Next, click the **Add Part...** button in the dialog box.

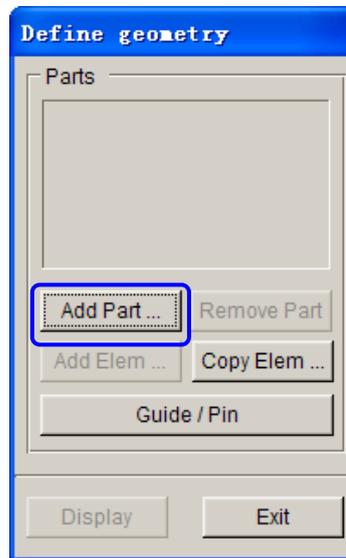


Figure 7.15 Define geometry dialog box

6. Select **PUNCH** part from the SELECT PART dialog box illustrated in Figure 7.16.

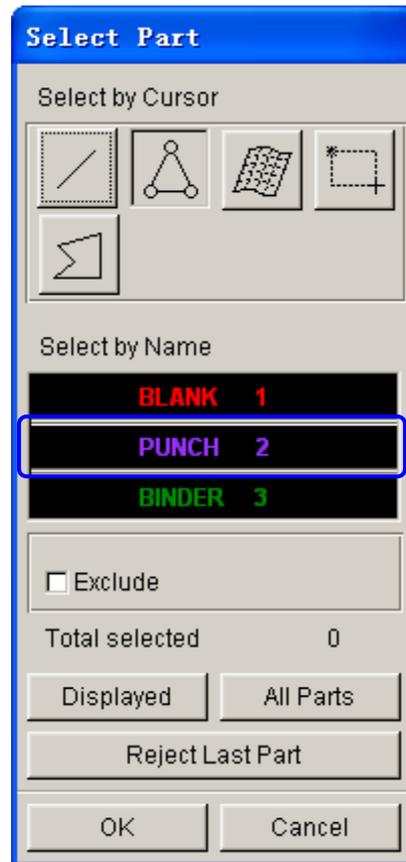


Figure 7.16 Select part dialog box

7. Click **OK** button to return to the DEFINE GEOMETRY dialog box. The **PUNCH** part is added to the list. See Figure 7.17.

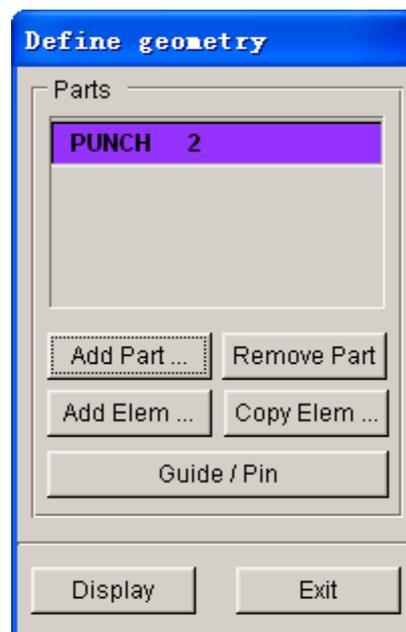


Figure 7.17 Punch geometry list

8. Click **Exit** button to return to tool definition interface. Now, you can observe

the font color of **die** is changed to BLACK. See Figure 7.18.

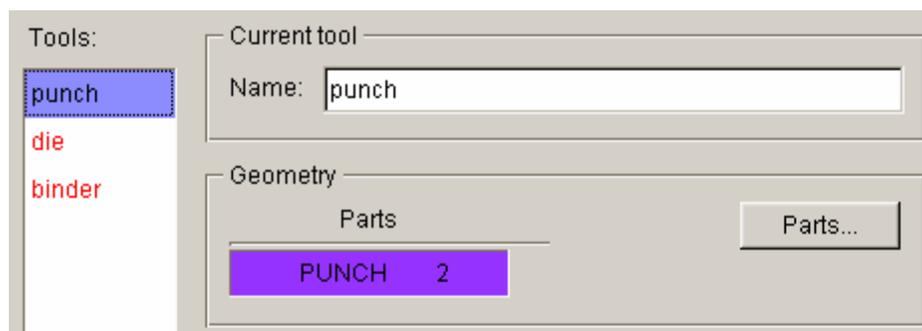


Figure 7.18 Punch definition interface

9. Click **die** located at the left side of tools list to display die definition interface.
10. Click the **Parts...** button to display the DEFINE GEOMETRY dialog box.
11. Click **Copy Elem...** button to display COPY ELEMENTS dialog box illustrated in Figure 7.19.
12. Next, toggle on the checkbox of Offset elements option. Then, click on the **Select...** button to display the SELECT ELEMENTS dialog box illustrated in Figure 7.20.
13. Toggle on **Select By** option in the dialog box. Then, press the **Unspecified** button to select **PUNCH** from the SELECT PART dialog box.
14. Click on the **Done** button to accept selection.
15. Again, press the **Unspecified** button to select **BINDER** from the SELECT PART dialog box.
16. Click on the **Done** button to accept selection.

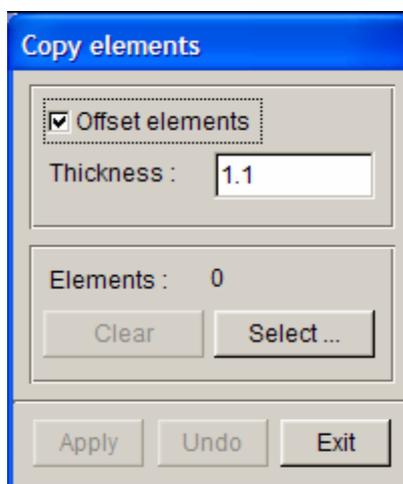


Figure 7.19 Copy elements dialog box

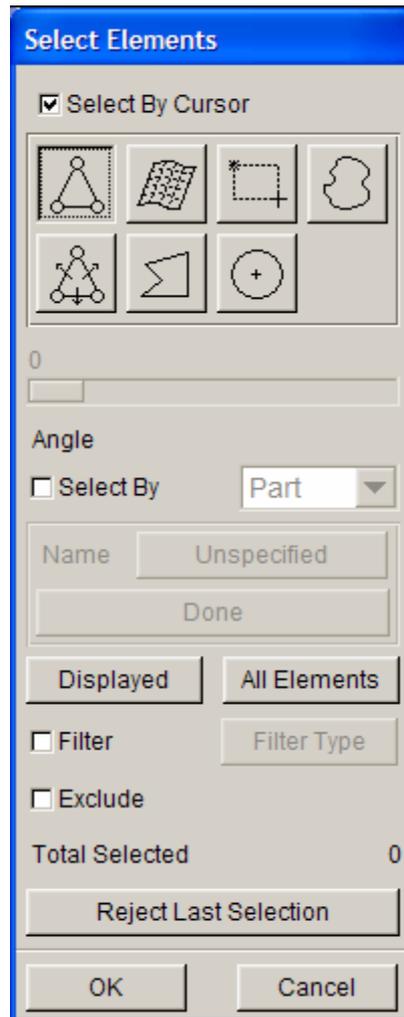


Figure 7.20 Select elements dialog box

17. Click **OK** button to accept the element selections and dismiss the SELECT ELEMENTS dialog box.
18. Click **Apply** button in the COPY ELEMENTS dialog box to offset elements, following by clicking the **Exit** button. All created elements are automatically added to a new part named **OFFSET00**, and the part is added to the list of **Die**. See Figure 7.21.

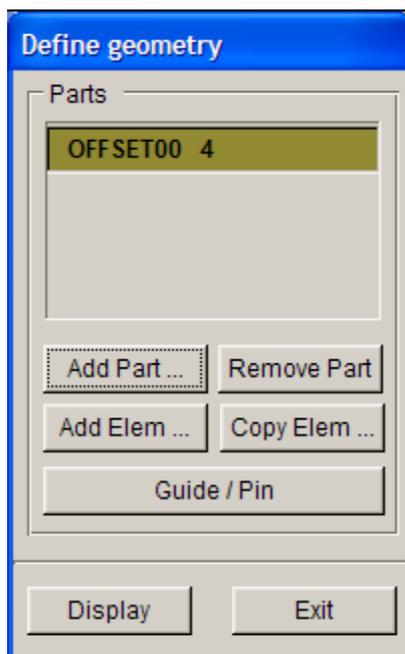


Figure 7.21 Die geometry list

19. From the DEFINE GEOEMTRY dialog box, click **Exit** button to return to tool definition interface. Now, the tag color of all tools is changed red into black. It means all tools have been defined. See figure 7.22.



Figure 7.22 Die definition interface

20. Click **binder** located at the left side of tools list to display die definition interface.
21. Click the **Parts...** button to display the DEFINE GEOMETRY dialog box.
22. The DEFINE GEOMETRY dialog box illustrated in Figure 7.15 is displayed. Next, click the **Add Part...** button in the dialog box.
23. Select **BINDER** part from the SELECT PART dialog box illustrated in Figure 7.23.
24. Click **OK** button to return to the DEFINE GEOMETRY dialog box. The **BINDER** part is added to the list. See Figure 7.24.

25. Click **Exit** button to return to tool definition interface. Now, you can observe the font color of **binder** is changed to BLACK. See Figure 7.25.

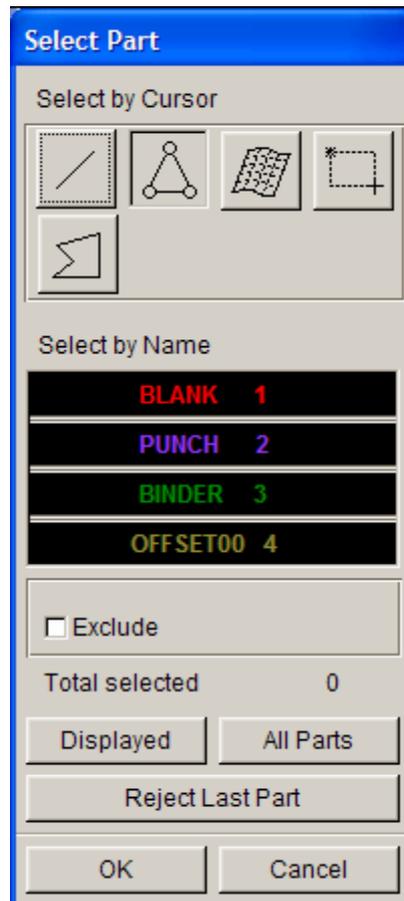


Figure 7.23 Select part dialog box

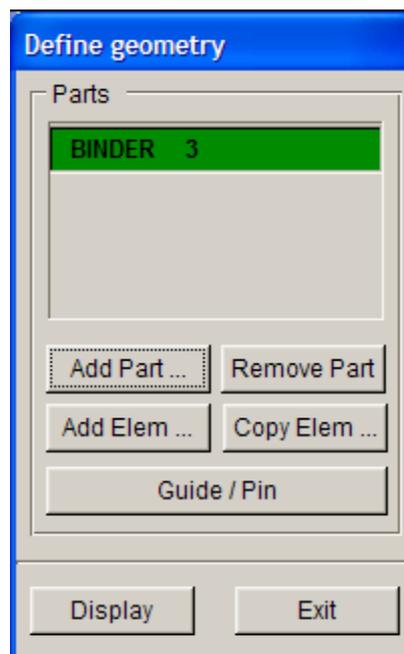


Figure 7.24 Binder geometry list

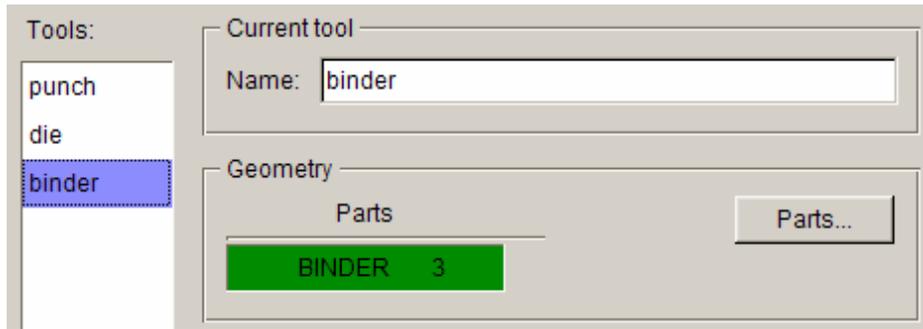


Figure 7.25 Binder definition interface

VI. Drawbead Definition

1. Select **Tools**→**Drawbeads...** from the AutoSetup menu bar. See Figure 7.26.



Figure 7.26 Tools menu

2. Then, click **New** button to create a new **Drawbead property**. See Figure 7.27.
3. The **DRAWBEAD PROPERTIES** window illustrated in Figure 7.28 is displayed.
4. Click **OK** button to accept the default parameters.

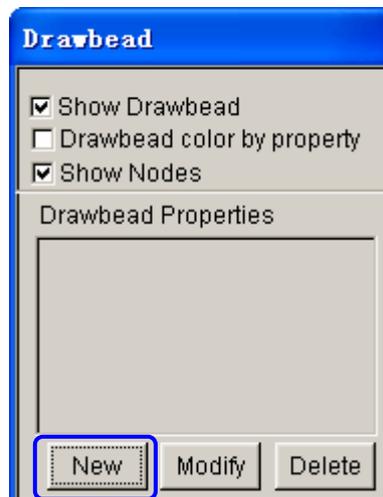


Figure 7.27 Drawbead dialog box

Property	Value
SECTION TITLE	bead1
STATIC FRICTION COEF.	1.000000E-001
DYNAMIC FRICTION COEF.	0.000000E+000
BENDING LOAD CURVE ID	0
Full Lock Force	<input checked="" type="checkbox"/> 4.278000E+002
DRAW BEAD DEPTH	1.000000E+000
BENDING CURVE SCALE	1.000000E+000

Figure 7.28 Drawbead properties window

- As illustrated in Figure 7.29, a new drawbead property named **bead1** is added to the list.

Property
bead1

Figure 7.29 Draw bead properties list

- Now, you continue to assign a drawbead line. Since no drawbead line is provided in the database, you have to create the line using the function provided in the LINE/POINT dialog box.
- Click **OK** button in the DRAWBEAD dialog box, following by clicking **Exit** button in the main interface to close the AUTOSSETUP window.
- From the menu bar, select **Preprocess**→**Line/Point** to display the

LINE/POINT dialog box illustrated in Figure 7.30. Then, press the **Offset** icon.

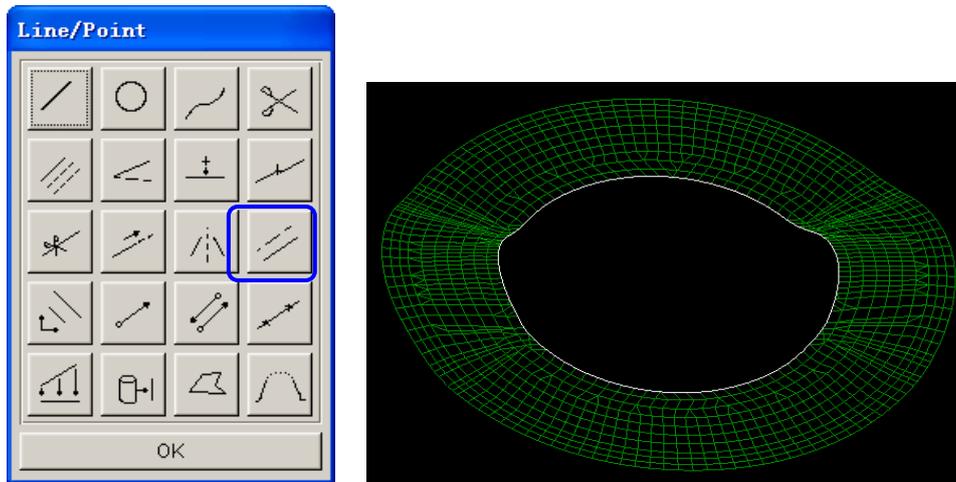


Figure 7.30 Offset a curve

9. Next, use your mouse cursor to select the line highlighted in Figure 7.30. Then, click **OK** button to define the coordinate system, following by clicking **Yes** button to accept the default **LCS**.
10. Type in **50** (mm) in the **OFFSET DISTANCE** dialog box illustrated in Figure 7.31.

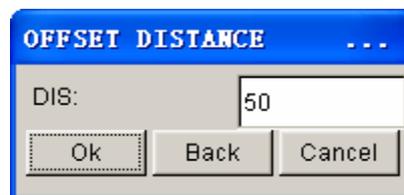


Figure 7.31 Offset distance dialog box

11. Click **OK** button to accept the input offset distance.
12. Select **No** in the pop-up dialog box illustrated in Figure 7.32.

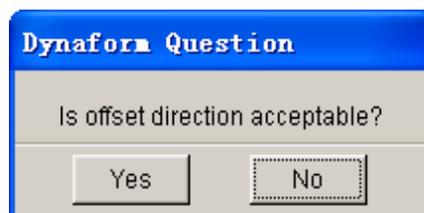


Figure 7.32 eta/DYNAFORM Question dialog box

13. Click **OK** button to dismiss the LINE/POINT dialog box.

14. Click on  icon from the **Icon bar** to save the database.
15. Again, open the DRAWBEAD dialog box in the AUTOSETUP interface. Press **New** button to create a new drawbead. See Figure 7.30.

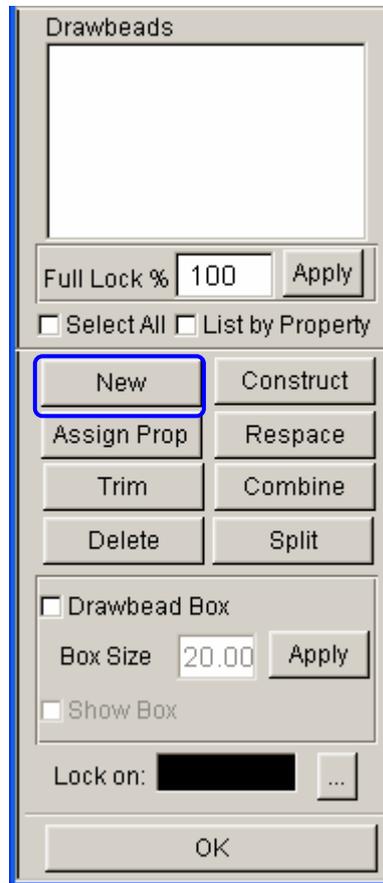


Figure 7.33 Create new drawbead

16. Use your mouse cursor to pick the highlighted drawbead line illustrated in Figure 7.34. The DRAWBEAD INPUT dialog box is displayed.
17. Click **OK** button to accept the default setting in DRAWBEAD INPUT dialog box.

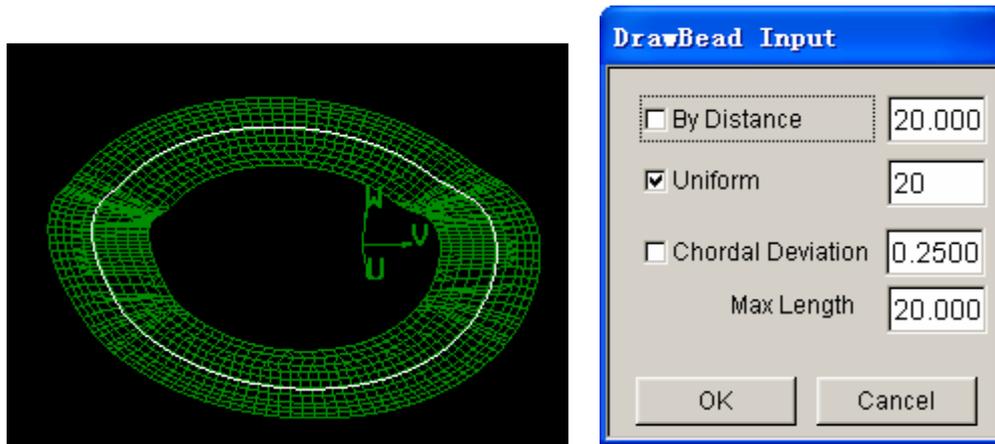


Figure 7.34 Drawbead parameters setting

18. The new drawbead named **Drawbead1** is added to the list.
19. Next, use your mouse cursor to pick **Drawbead1** from the drawbead list. Type in **20** (%) in the input data field of **Full Lock %** illustrated in Figure 7.35. Then, click **Apply** button to modify the full lock force of drawbead.

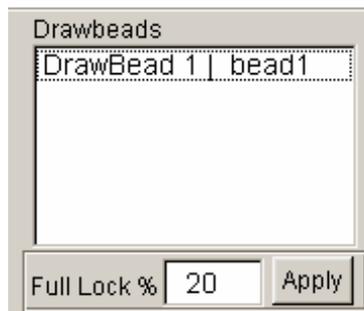


Figure 7.35 Drawbead list

20. Click  button illustrated in Figure 7.33 to lock drawbead to BINDER. Select **BINDER** from the SELECT PART dialog box.
21. The eta/DYNAFORM Question dialog box illustrated in Figure 7.36 is displayed. Select **Yes** to accept the projection.
22. Click **OK** button to dismiss the DRAWBEAD dialog box.

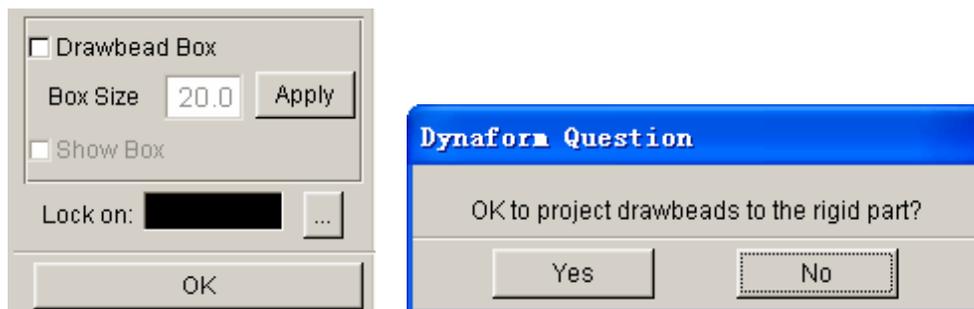


Figure 7.36 Lock the drawbead

VII. Tools Positioning

After defining all tools, the user needs to position the relative position of tools for the stamping operation. The tool positioning operation must be carried out each time the user sets up a stamping simulation model. Otherwise, the user may not obtain correct stamping simulation setup.

The tool position is related to the working direction of each tool. Therefore, you need to carefully check the working direction prior to positioning the tools. If the process template is chosen, the default working direction is selected. You can also define special working direction.

1. Click **Positioning...** button located at the lower right corner of the tool definition interface to display the POSITIONING dialog box illustrated in Figure 7.37. Alternatively, you can select **Tools→Positioning...** from the menu bar.

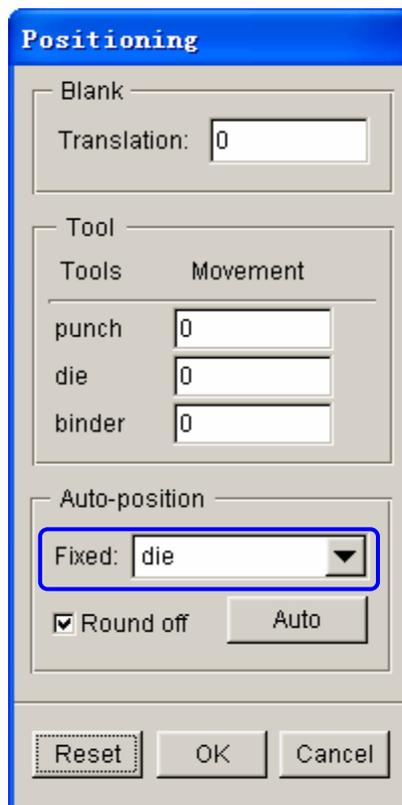


Figure 7.37 Before tool positioning

2. Select **die** as fixed tool and use it as the reference tool. The tool is stationary during automatic positioning.

3. Click **Auto** button to position all tools and blank automatically. See Figure 7.38.
4. Now, all tools and blank are moved to a preset location. The movement of each tool is listed in the input data field of corresponding tool. The value is the measurement from the home/final position to the current position.

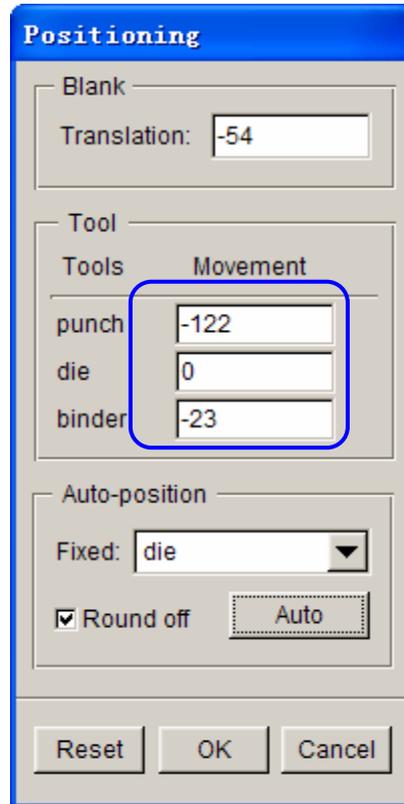


Figure 7.38 After tool auto positioning

5. Toggle off the checkbox of **Lines** and **Surfaces** in **Display Options** located at the lower right corner of the screen. See Figure 7.39.



Figure 7.39 Display option

6. Click  and  icon from the **Icon bar** to display the relative position of tools and blank, as shown in Figure 7.40.

7. Click **OK** button to save the current position of tools and blank, and return to the tool definition interface.

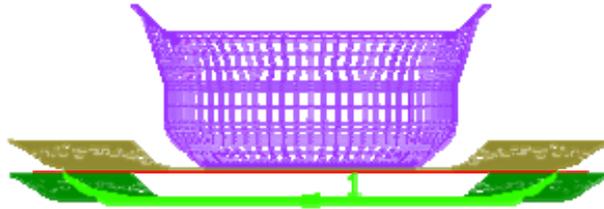


Figure 7.40 The relative position of tools and blank after positioning

***Note:** After autopositioning, the relative position of tools and blanks is displayed on the screen. However, you may select **Tools → Positioning...** from the Auto Setup menu bar, following by pressing the **Reset** button in the POSITIONING dialog box to set the tools and blank(s) back to its original position. Moreover, you can move the tools using the **Home...** function provided in the **Tools** menu.*

Now, you can continue with the next process which is definition of process parameters. In Auto Setup application, the definition and positioning of blank(s) and tools and definition of process are not required in strict order. Therefore, you can randomly modify each operation. However, you are recommended to accordingly set up the blank(s) definition, tools definition and process parameters.

VIII. Process Definition

The Process definition is utilized to set up process parameters of the current simulation such as time required for every process, tooling speed, binder force and so on. The parameters listed in process definition interface depend on the pre-selected process template, including type of simulation and process.

In this example, the type of simulation and process is **Sheet Forming** and **Double Action**, respectively. Therefore, two default processes are listed in the process definition interface: closing and drawing process.

You can press **Process** tab of the main interface to enter process definition interface.

Next, follow the steps listed below:

1. Select **closing** process from the list located at left side of the process definition interface as the current process. See Figure 7.41.
2. Verify the default setting of **closing** stage is similar to Figure 7.41.

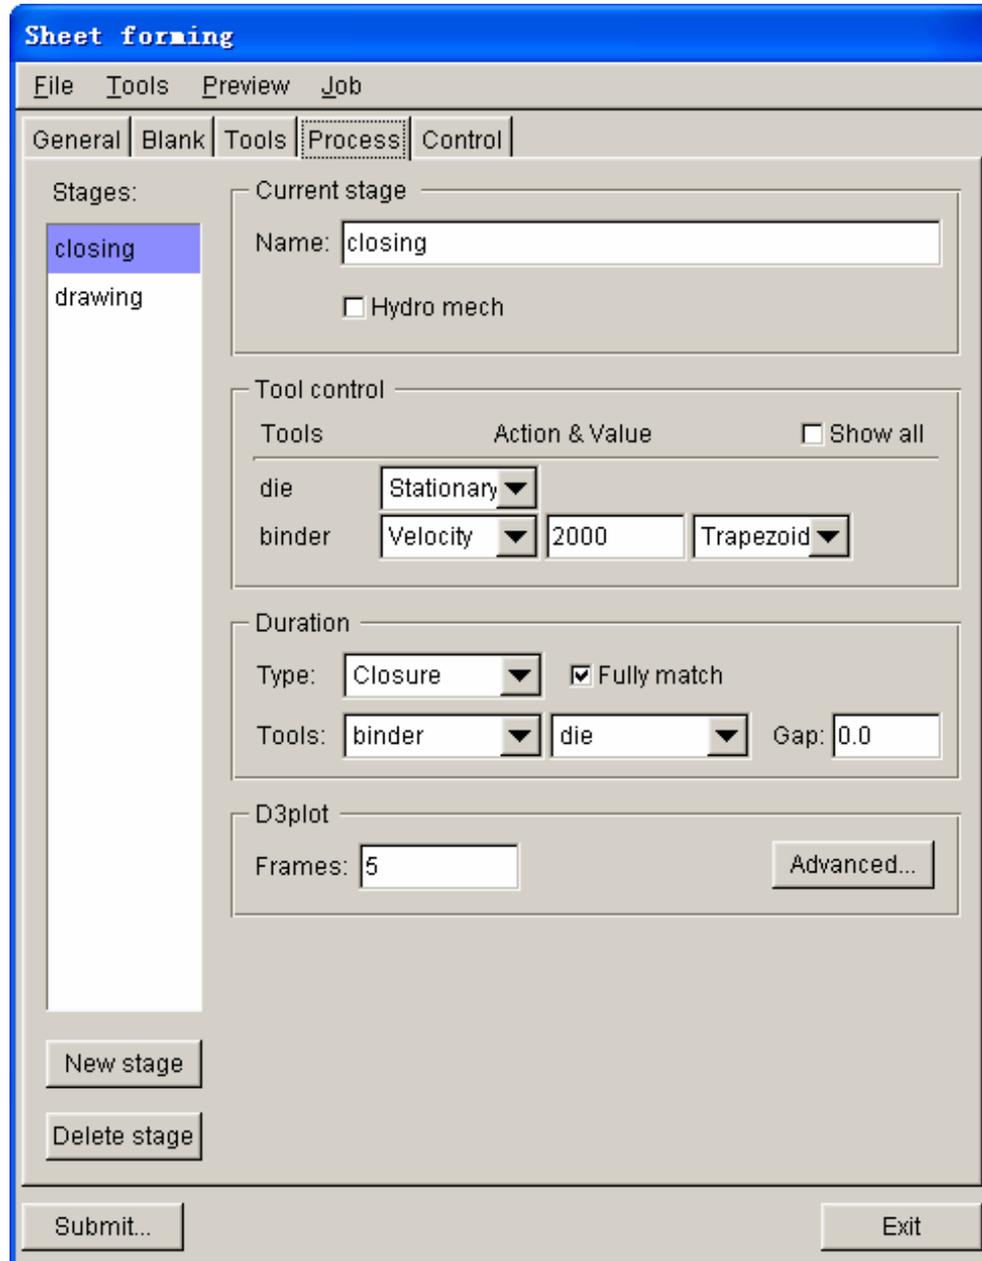


Figure 7.41 Closing process interface

3. Select **drawing** process from the list located at left side of the process definition interface as current process.
4. Next, toggle on checkbox of **Hydro mech** option, as shown in Figure 7.42. Click the drop-down button of **Hydro mech** option to select **Below** option,

indicating the fluid pressure is applied from the bottom of blank.

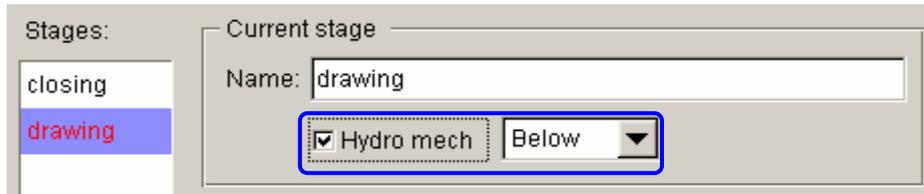


Figure 7.42 Hydro mech option

- From Tool control field illustrated in Figure 7.43, click the drop-down button of punch to select **Variable** option. Then, click **Define...** button to display the LOAD CURVE/TIME dialog box illustrated in Figure 7.44.

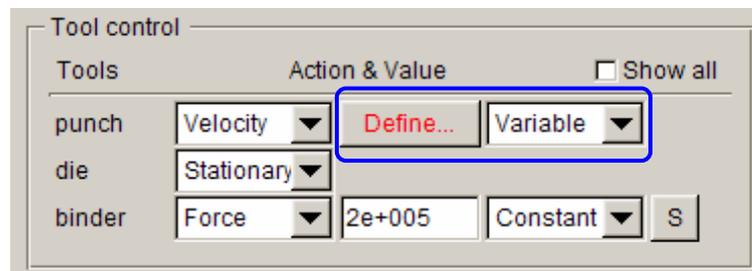


Figure 7.43 Tool control

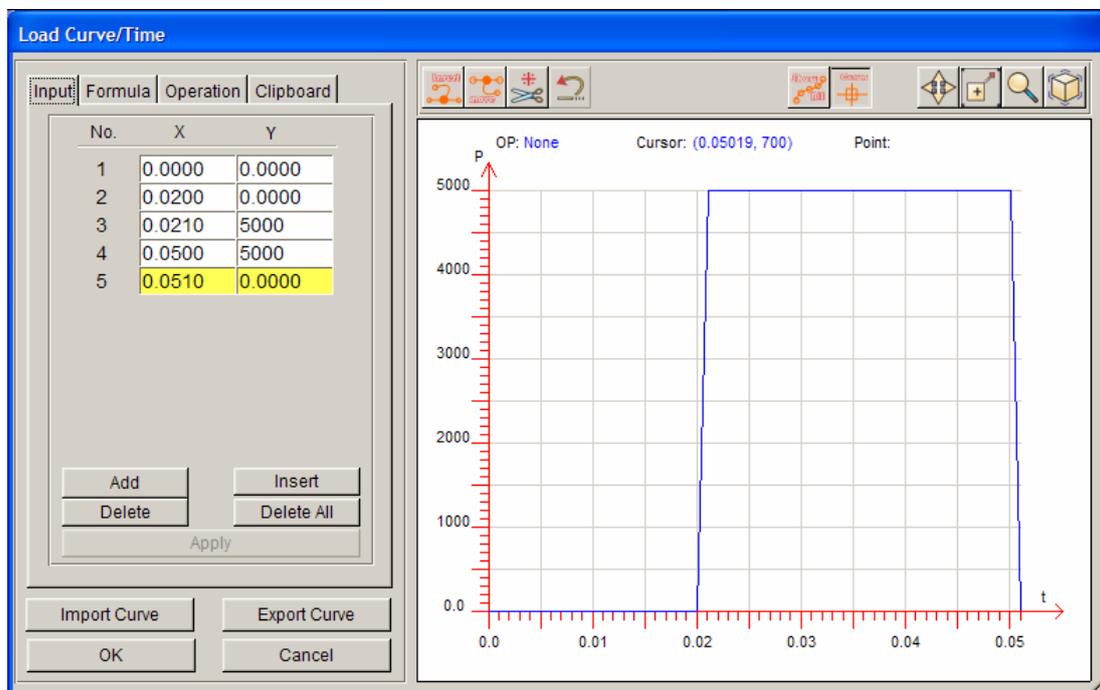


Figure 7.44 Punch load curve definition

- Use functions provided in Input page to key in the punch load curve illustrated in Figure 7.44.

- Now, let's continue to define the internal fluid pressure for sheet hydroforming process. Click the **No pressure** button illustrated in Figure 7.45.



Figure 7.45 Fluid pressure for sheet hydroforming process

- Select **Time variable** option as pressure control in HYDRO MECH dialog box illustrated in Figure 7.46.
- Click the **Edit...** button to display the LOAD CURVE/TIME dialog box.
- Use functions provided in Input page to key in the pressure load curve illustrated in Figure 7.47.
- Click **OK** button to dismiss the LOAD CURVE/TIME dialog box and complete the definition of internal pressure load curve. You observe the **No pressure** button is switched to **Variable P** button illustrated in Figure 7.48.

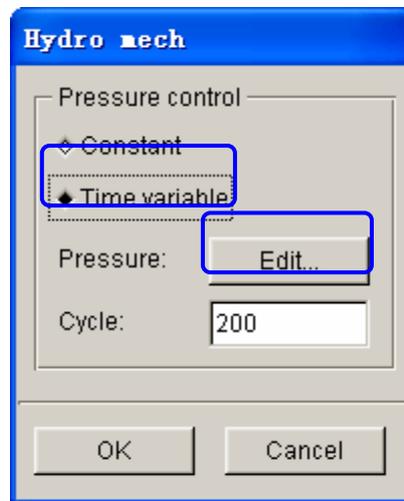


Figure 7.46 Hydro mech dialog box

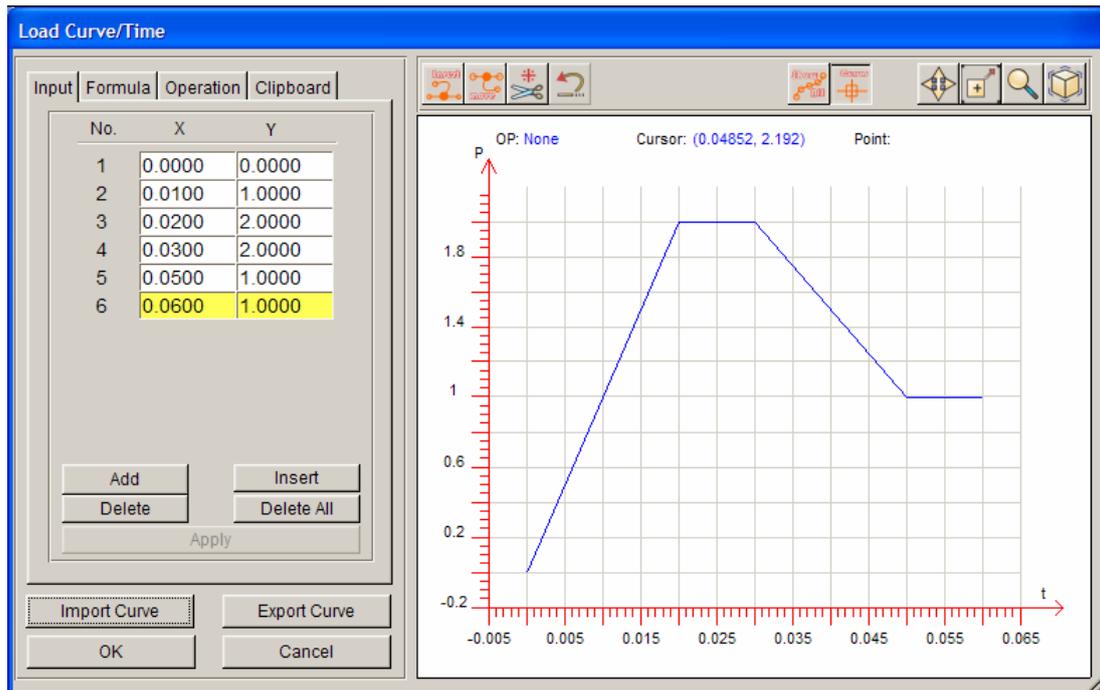


Figure 7.47 Internal pressure load curve definition

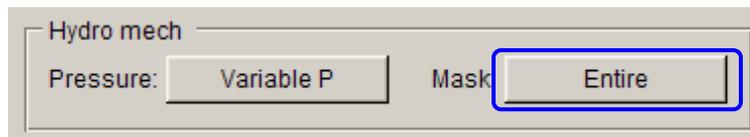


Figure 7.488 Internal pressure definition

12. Click on the **Entire** button illustrated in Figure 7.48 to defined the boundary of blank area subjected to applied internal fluid pressure.
13. The MASK dialog box illustrated in Figure 7.49 is displayed. Verify the **Inside** option is selected. In addition, the direction of projection is in positive **dz**.

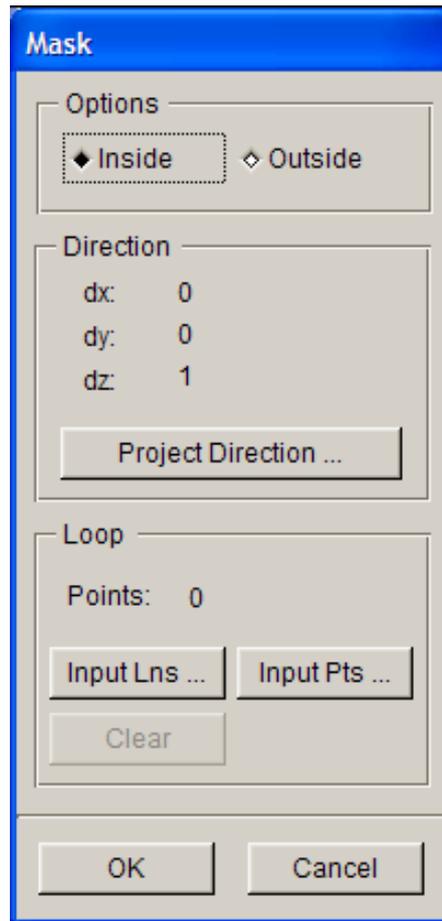


Figure 7.49 Internal pressure definition

14. Click on **Input Lns** button to define the boundary of mask using functions provided in SELECT LINE dialog box. Select the highlighted line illustrated in Figure 7.30, following by clicking **OK** button **twice** to return to process definition interface.
15. At Duration field illustrated in Figure 7.50, type in **0.051** (s) in the input data field of Time.



Figure 7.50 Duration of process

16. All process definition is complete. You can select **Preview→Summary** to review the summary of simulation setup.

IX. Animation

Prior to submitting a simulation job, you shall validate the process setting by viewing the animation of tool movement. The procedure to conduct animation is listed as the following:

1. Select **Preview→Animation...** in the menu bar. See Figure 7.51.

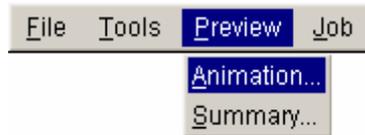


Figure 7.51 Animation menu

2. The animation of tool movement is shown on the display area.
3. You can select the **INDIVIDUAL FRAMES** option from the ANIMATE dialog box to display the incremental tool movement.
4. Click  to display the tool movement step by step.
5. The time step and displacement of tools are printed on the upper left hand corner of the display area.
6. Click **Exit** button to return the main interface.

X. Submit Job

After validating the tools movement, you may continue with submitting the stamping simulation through the steps listed below:

1. Click **Job→Job Submitter...** in the menu bar. See Figure 7.52.

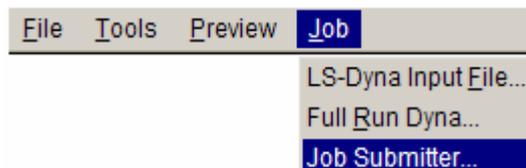


Figure 7.52 Job Submitter menu

2. The SUBMIT JOB dialog box illustrated in Figure 7.53 is displayed.

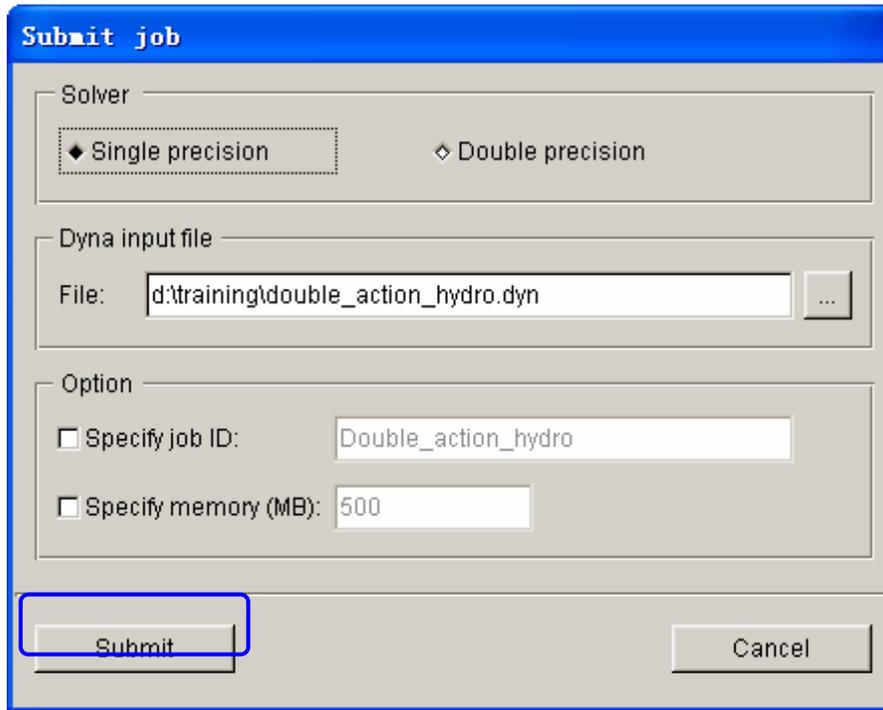


Figure 7.53 Submit job dialog box

3. Click **Submit** button from the SUBMIT JOB dialog box to display the Job Submitter interface.
4. Click **Submit Jobs** button to activate the LS-DYNA solver window illustrated in Figure 7.54. The simulation is in progress.

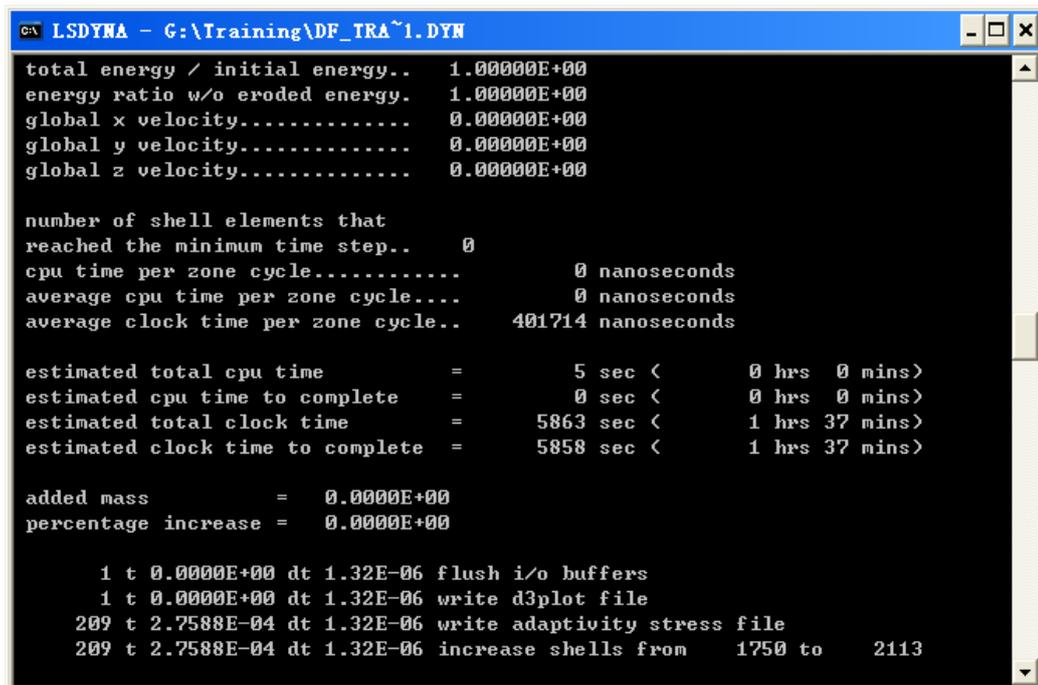


Figure 7.54 LS-DYNA solver window

When you submit a job from eta/DYNAFORM, an input deck is automatically created. The input deck is adopted by the solver, LS-DYNA, to process the stamping simulation. The default input deck names are **double_action_hydro.dyn** and **double_action_hydro.mod**. In addition, an index file named **double_action_hydro.idx** is generated for the reference in eta/POST. The **.dyn** file contains all of the keyword control cards, while the **.mod** file contains the geometry data and boundary conditions. Advanced users are encouraged to study the **.dyn** input file. For more information, refer to the *LS-DYNA User's Manual*.

Note: All files generated by either eta/DYNAFORM or LS-DYNA is stored in the directory in which the eta/DYNAFORM database has been saved. You shall ensure the folder doesn't include similar files prior to running the current job because these files will be overwritten.

POST PROCESSING (with eta/POST)

The eta/POST reads and processes all the available data in the **d3plot** and ASCII data files such as **glstat**, **rcforc**, etc.. In addition to the undeformed model data, the **d3plot** file also contains all result data generated by LS-DYNA (stress, strain, time history data, deformation, etc.).

Refer to previous examples for information about processing the result files.

MORE ABOUT eta/DYNAFORM 5.5

Inside the eta/DYNAFORM 5.5 installation directory in PC, there is a file named **.DyanformDefault** which controls key default parameters. Advanced users may edit these default parameters to customize the program.

For Unix/Linux users, the **.DynaformDefault** file is located under both the installation directory and the user's home directory. The **.DynaformDefault** file located under the installation directory will take precedence over the one located in the user home directory.

CONCLUSION

This concludes the training guide's basic overview of **eta/DYNAFORM 5.5**. This manual is meant to give you a basic understanding of finite element modeling for forming analysis, as well as displaying the forming results. It is by no means an extensive study of the simulation techniques and capabilities of **eta/DYNAFORM**. For more detailed study of **eta/DYNAFORM**, you are urged to attend a **eta/DYNAFORM** training session.

Please refer to the **eta/DYNAFORM**, **eta/POST** and the **LS-DYNA User's Manuals** for detailed description of individual functions and analysis settings.